

---

---

**Petroleum products and lubricants —  
Determination of cone penetration of  
lubricating greases and petrolatum**

STANDARDSISO.COM : Click to view the full PDF of ISO 2137:2020



STANDARDSISO.COM : Click to view the full PDF of ISO 2137:2020



**COPYRIGHT PROTECTED DOCUMENT**

© ISO 2020

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
CP 401 • Ch. de Blandonnet 8  
CH-1214 Vernier, Geneva  
Phone: +41 22 749 01 11  
Fax: +41 22 749 09 47  
Email: [copyright@iso.org](mailto:copyright@iso.org)  
Website: [www.iso.org](http://www.iso.org)

Published in Switzerland

# Contents

	Page
Foreword .....	v
Introduction .....	vi
<b>1 Scope</b> .....	<b>1</b>
<b>2 Normative references</b> .....	<b>1</b>
<b>3 Terms and definitions</b> .....	<b>1</b>
<b>4 Principle</b> .....	<b>2</b>
<b>5 Classifications, procedures and limitation</b> .....	<b>2</b>
<b>6 Apparatus</b> .....	<b>3</b>
<b>7 Sampling</b> .....	<b>14</b>
<b>8 Procedures for lubricating grease using full-scale methods</b> .....	<b>14</b>
8.1 Procedure for unworked penetration .....	14
8.1.1 Preparation of test portion .....	14
8.1.2 Cleaning the cone and movable attachments .....	14
8.1.3 Penetration measurement .....	14
8.2 Procedure for worked penetration .....	15
8.2.1 Preparation of test sample .....	15
8.2.2 Preparation of test portion .....	15
8.2.3 Penetration measurement .....	16
8.3 Procedure for prolonged worked penetration .....	16
8.3.1 Preparation of apparatus and test portion .....	16
8.3.2 Penetration measurement .....	16
8.4 Procedure for block penetration .....	17
8.4.1 Preparation of test portion .....	17
8.4.2 Penetration measurement .....	17
8.4.3 Additional determinations .....	17
<b>9 Procedures for lubricating grease using one-half-scale and one-quarter-scale cone method</b> .....	<b>17</b>
9.1 General .....	17
9.2 Procedure for unworked penetration .....	18
9.2.1 Preparation of test portion .....	18
9.2.2 Cleaning cone and movable attachments .....	18
9.2.3 Penetration measurement .....	18
9.3 Procedure for worked penetration .....	18
9.3.1 Preparation of test sample .....	18
9.3.2 Preparation of test portion .....	18
9.3.3 Penetration measurement .....	19
<b>10 Procedure for determining the cone penetration of petrolatum</b> .....	<b>19</b>
10.1 Preparation of the test portion .....	19
10.2 Penetration measurement .....	19
<b>11 Calculation</b> .....	<b>20</b>
11.1 Calculation of full-scale penetration .....	20
11.2 Conversion to full-scale penetration for the one-half-scale and one-quarter-scale cones .....	20
11.2.1 General .....	20
11.2.2 One-quarter-scale cone .....	20
11.2.3 One-half-scale cone .....	20
<b>12 Expression of results</b> .....	<b>20</b>
<b>13 Precision</b> .....	<b>20</b>
13.1 General .....	20
13.2 Repeatability, <i>r</i> .....	20

13.3	Reproducibility, <i>R</i> .....	20
<b>14</b>	<b>Test report</b> .....	<b>21</b>
	<b>Bibliography</b> .....	<b>22</b>

STANDARDSISO.COM : Click to view the full PDF of ISO 2137:2020

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular, the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see [www.iso.org/directives](http://www.iso.org/directives)).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see [www.iso.org/patents](http://www.iso.org/patents)).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation of the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT), see [www.iso.org/iso/foreword.html](http://www.iso.org/iso/foreword.html).

This document was prepared by Technical Committee ISO/TC 28, *Petroleum and related products, fuels and lubricants from natural or synthetic sources*.

This fourth edition cancels and replaces the third edition (ISO 2137:2007), which has been technically revised. The main changes compared to the previous edition are as follows:

- cleaning of cone and shaft assembly with solvent has been introduced to eliminate any drag forces;
- the precision table for repeatability and reproducibility for one-half-scale and one-quarter-scale has been revised to keep only an unconverted value.

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at [www.iso.org/members.html](http://www.iso.org/members.html).

## Introduction

ISO 2137 was first published in 1972. A second edition was issued in 1985. The third revision was mainly on the dimensional tolerances of the various cones, to better fit with what is available from laboratory equipment suppliers. This revision was necessary because of all the quality plans and data integrity programmes established by numerous laboratories to conform with the various ISO quality standards. In the third edition of ISO 2137, the dimensional tolerances were enlarged to allow most of the cones to fulfil the requirements.

Before adopting changes in the third revision, an interlaboratory study was performed with cones conforming to new requirements and demonstrated that the precision of the method was not altered by changing the tolerances. Tolerances were retained only on the characteristics where it was established that they have a direct impact on the penetration determination, i.e. tip angle, tip height, tip top thickness, tip base diameter, cone angle, total mass of cone plus movable attachments.

STANDARDSISO.COM : Click to view the full PDF of ISO 2137:2020

# Petroleum products and lubricants — Determination of cone penetration of lubricating greases and petrolatum

**WARNING** — The use of this document can involve hazardous materials, operations and equipment. This document does not purport to address all of the safety problems associated with its use. It is the responsibility of users of this document to take appropriate measures to ensure the safety and health of personnel prior to the application of the standard, and to determine the applicability of any other restrictions for this purpose.

## 1 Scope

This document specifies several methods for the empirical estimation of the consistency of lubricating greases and petrolatum by measuring the penetration of a standardized cone.

## 2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 23572, *Petroleum products — Lubricating greases — Sampling of greases*

## 3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at <https://www.iso.org/obp>
- IEC Electropedia: available at <http://www.electropedia.org/>

### 3.1

#### **penetration**

depth that a standard object, cone or needle penetrates into a test portion under standardized conditions of time, temperature, load, etc

[SOURCE: ISO 1998-2:1998, 2.80.001 — modified: the Note has been deleted.]

### 3.2

#### **cone penetration**

distance that a standardized cone penetrates into a test portion under standardized conditions of load, time and temperature

Note 1 to entry: The cone penetration is expressed in units of 0,1 mm.

### 3.3

#### **working**

shearing action of a grease worker

### 3.4

#### **unworked penetration**

*cone penetration* (3.2) of a test portion that has received only minimum disturbance in transfer from the sample container to the cup of the grease worker

### 3.5

#### **worked penetration**

*cone penetration* (3.2) of a test portion after it has been subjected to a defined number of strokes in a grease worker

### 3.6

#### **prolonged worked penetration**

*cone penetration* (3.2) of a test portion which has been worked more than the defined number of strokes in *worked penetration* (3.5)

### 3.7

#### **block penetration**

*cone penetration* (3.2) determined on a test portion which is sufficiently hard to hold its shape without a container

## 4 Principle

The cone penetration of lubricating grease is determined at 25 °C by releasing the cone assembly from the penetrometer and allowing the cone to drop for 5 s, and measuring the extent of the penetration. Three determinations shall be made and the average shall be reported as a result.

Unworked penetrations are determined on test portions transferred with a minimum of disturbance to a container suitable for test purposes.

Worked penetrations are determined immediately after working the test portion for 60 double strokes in a standard grease worker.

Prolonged worked penetrations are determined on test portions worked more than 60 double strokes.

Block penetrations are determined on a freshly prepared face of a cube cut from a block of grease with a standard cutter.

The cone penetration of petrolatum is determined by first melting and cooling a test sample under specified conditions and then measuring the penetration as for lubricating grease.

## 5 Classifications, procedures and limitation

The National Lubricating Grease Institute (NLGI) classifies greases according to their consistency, as measured by the 60 strokes worked penetration. The NLGI classification includes nine consistency numbers or grades, each grade corresponding to a given range of worked penetration. The NLGI classification is given in ISO 6743-99 and ISO 12924.

[Clause 8](#) specifies four procedures for determining the consistency of lubricating greases by measuring the penetration of a full-scale cone. These procedures cover the measurement of unworked, worked, prolonged worked and block penetrations. Penetrations up to 500 units can be measured.

[Clause 9](#) specifies methods for determining the consistency of lubricating greases when only small samples are available, by the use of cones a one-half-scale or one-quarter-scale of that used in [Clause 8](#). The methods are applicable to greases having penetrations of 175 units to 385 units with the full-scale cone and are intended for use only if the size of the test sample prevents the use of cones described in [Clause 8](#). They are not intended to replace the full-scale penetration as described in [Clause 8](#), although a conversion to full-scale penetration is given in [10.2](#). See [9.1](#) for the limitations on the use of one-quarter-scale cones due to the poor precision.

NOTE 1 Unworked penetrations do not generally represent the consistency of greases in use as effectively as do worked penetrations. The latter are usually preferred for inspecting lubricating greases.


NOTE 2 Penetration of block greases can be obtained on those products that are sufficiently hard to hold their shape. These greases generally have penetrations below 85 units.

[Clause 10](#) specifies a method for the determination of the consistency of petrolatum by measurement of the penetration of a full-scale cone, having penetrations up to 300 units. This method can also be used to estimate the consistency of slack waxes.

## 6 Apparatus

**6.1 Penetrometer**, similar to that shown in [Figure 1](#), capable of measuring, in tenths of a millimetre, the penetration of a cone in a test material.

[Figure 1](#) shows a combined assembly; generally, it is allowed to displace vertically either the cone assembly or the plate.

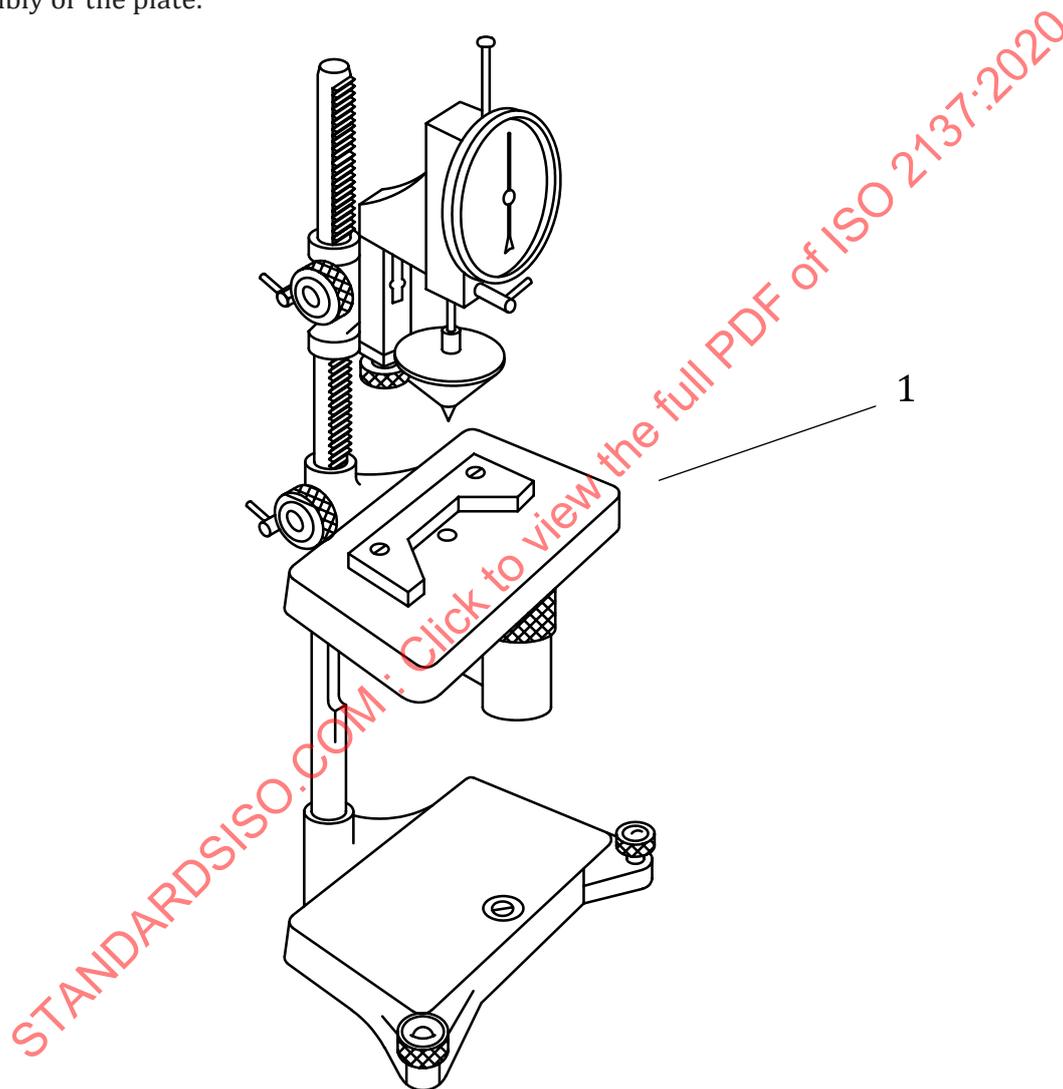

### Key

1 centring device

**Figure 1 — Penetrometer**

The cone assembly or the table of the penetrometer shall be adjustable to enable accurate placement of the tip of the cone on the level surface of the material while maintaining a “zero” reading on the indicator. The cone shall fall, when released, without appreciable friction for at least 62 mm. The tip of the cone shall not hit the bottom of the sample container. The instrument shall be provided with level jigs screws and a spirit level to maintain the cone shaft in a vertical position.

The measurement of the penetration depth may be performed using either mechanical devices (mechanical indicator) or electronic devices (digital indicator).

## 6.2 Cones

**6.2.1 Full-scale cone**, consisting of a conical body of magnesium or other suitable material with a detachable, hardened steel tip.

Dimensions and tolerances shall be as shown in [Figure 2](#). The total mass of the cone shall be  $102,50 \text{ g} \pm 0,05 \text{ g}$  and the total mass of its movable attachments shall be  $47,50 \text{ g} \pm 0,05 \text{ g}$ . The attachments consist of a rigid shaft having a stop at its upper end and a suitable means at its lower end for engaging the cone. The interior construction may be modified to achieve the specified mass, provided that the general contour and mass distribution are not altered. The outer surface shall be polished to a very smooth finish.

For penetrations up to 400 units, the optional cone as shown in [Figure 3](#) may be used. For this cone the total mass shall be  $102,50 \text{ g} \pm 0,05 \text{ g}$ , and the total mass of movable attachments shall be  $47,50 \text{ g} \pm 0,05 \text{ g}$ .

**6.2.2 One-half-scale cone and shaft**, made of steel, stainless steel or brass with a hardened steel tip of 45 Rockwell C hardness to 50 Rockwell C hardness and constructed to conform to the dimensions and tolerances shown in [Figure 4](#).


The shaft may be made of stainless steel. The total mass of the cone and its movable attachments shall be  $37,50 \text{ g} \pm 0,05 \text{ g}$ . The mass of the cone shall be  $22,500 \text{ g} \pm 0,025 \text{ g}$ . The mass of the movable attachments shall be  $15,000 \text{ g} \pm 0,025 \text{ g}$ .

**6.2.3 One-quarter-scale cone and shaft**, consisting of a conical body of plastics or other low-density material with a hardened steel tip of 45 Rockwell C hardness to 50 Rockwell C hardness, and constructed to conform to the dimensions and tolerances shown in [Figure 5](#).

The shaft may be constructed of magnesium alloy. The total mass of the cone and its movable attachments shall be  $9,380 \text{ g} \pm 0,025 \text{ g}$ . The total mass of the cone and its movable attachments may be adjusted by adding small a shot to the cavity of the shaft.

Dimensions in millimetres


Tolerances on dimensions except where otherwise stated:  $\pm 1$  mm

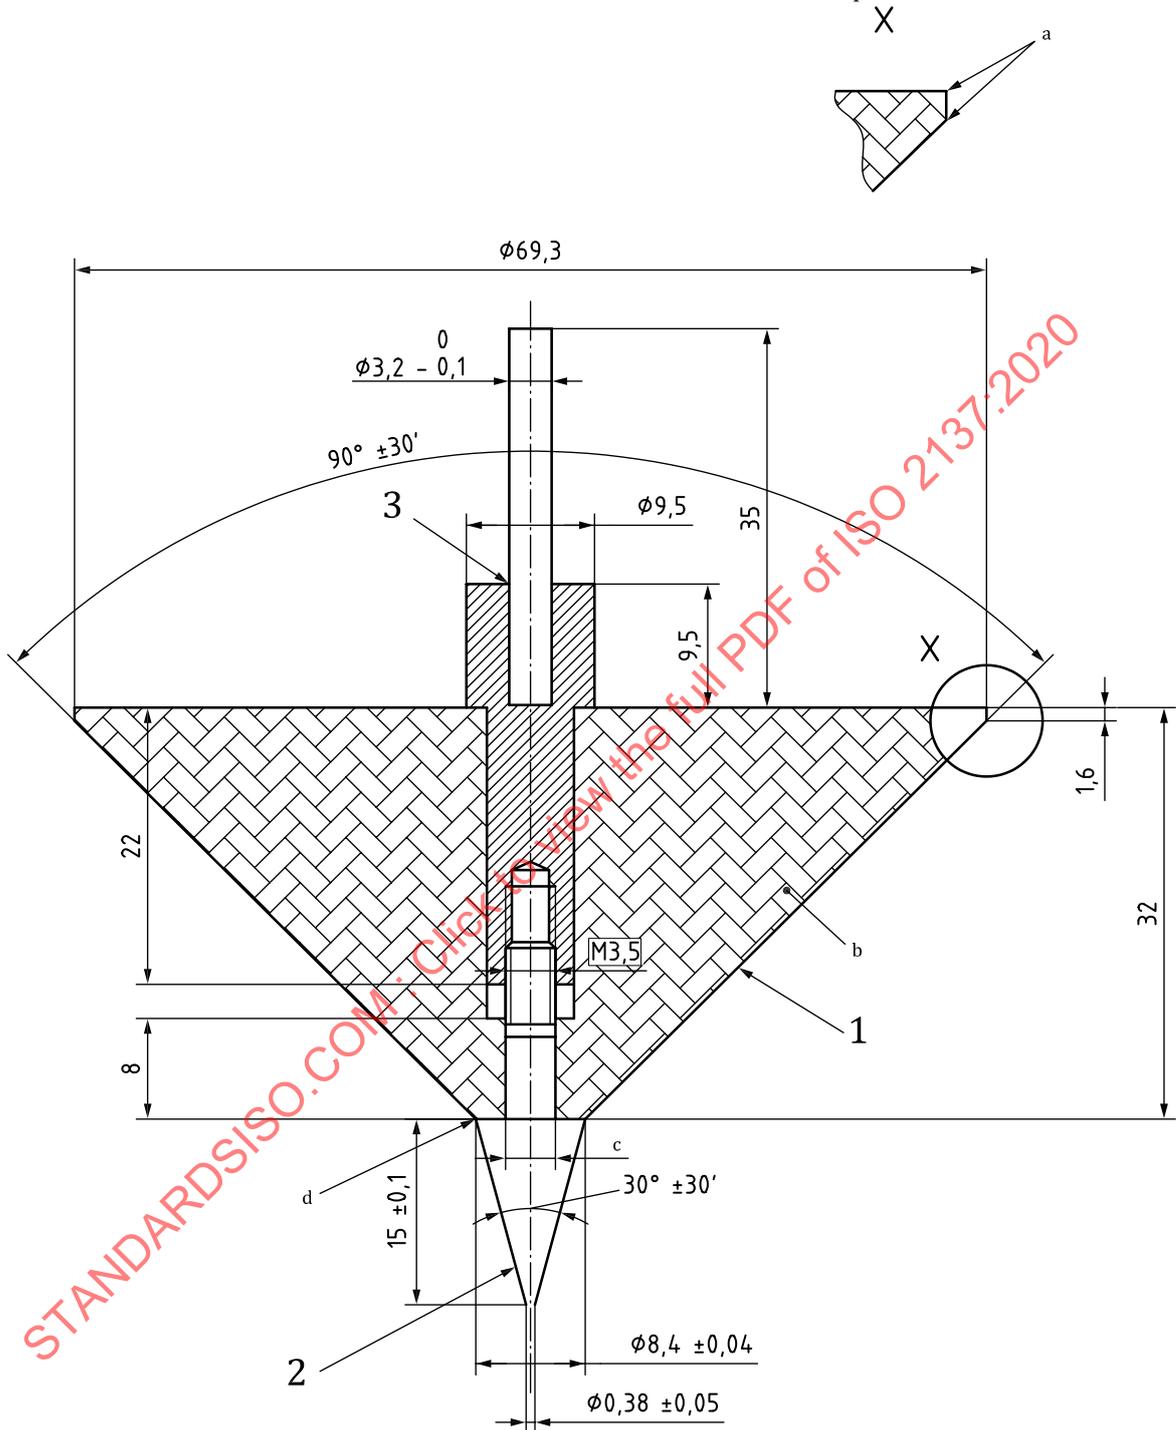

**Key**

- |   |   |   |   |
|---|---|---|---|
| 1 | smooth and polished surface             | b | Magnesium or any other suitable material. |
| 2 | hardened steel tip                      | c | $\phi 4$ max., tight fit.                 |
| 3 | shaft stainless steel — tight press fit | d | No shoulder.                              |
| a | Do not round the edges.                 |   |   |

**Figure 2 — Cone of the penetrometer — Full-scale cone**

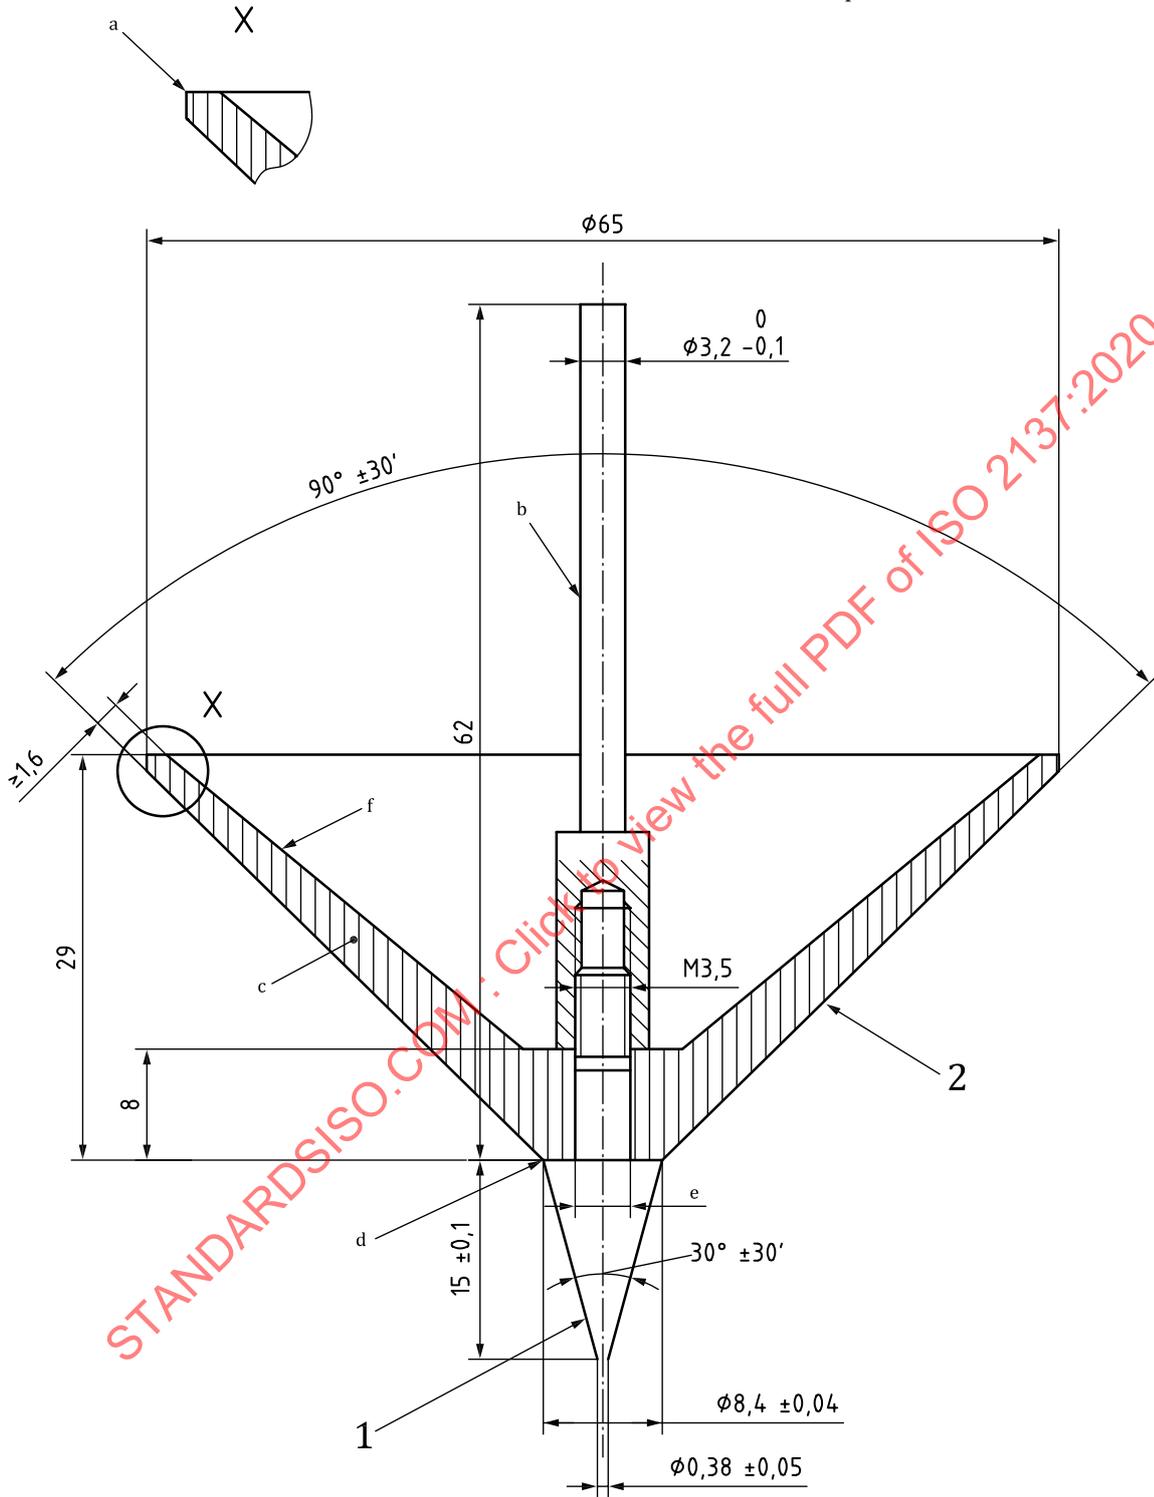


**Key**

- |   |                             |   |   |
|---|-----------------------------|---|---|
| 1 | hardened steel tip          | c | Brass or corrosion resistant steel.         |
| 2 | smooth and polished surface | d | No shoulder.                                |
| a | Break all sharp edges.      | e | $\varnothing 4$ max., tight fit.            |
| b | Stainless steel.            | f | Machining to the required mass (see 5.2.1). |

**Figure 3 — Cone of the penetrometer — Optional cone**

Dimensions in millimetres

Tolerances on dimensions except where otherwise stated:  $\pm 0,5$  mm

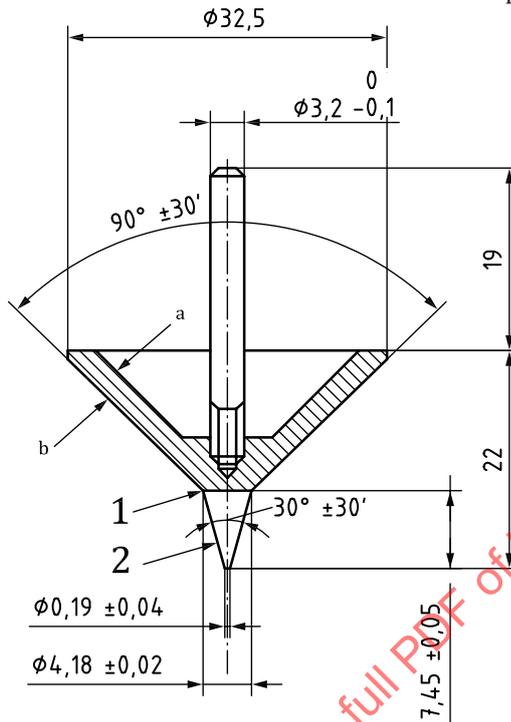

**Key**


- 1 sharp corner
- 2 hardened steel tip

- a Machine this surface to give specified mass.
- b Polish all outside surfaces.

**Figure 4 — One-half-scale cone**

STANDARDSISO.COM : Click to view the full PDF of ISO 2137:2020

Tolerances on dimensions except where otherwise stated:  $\pm 0,25$  mm

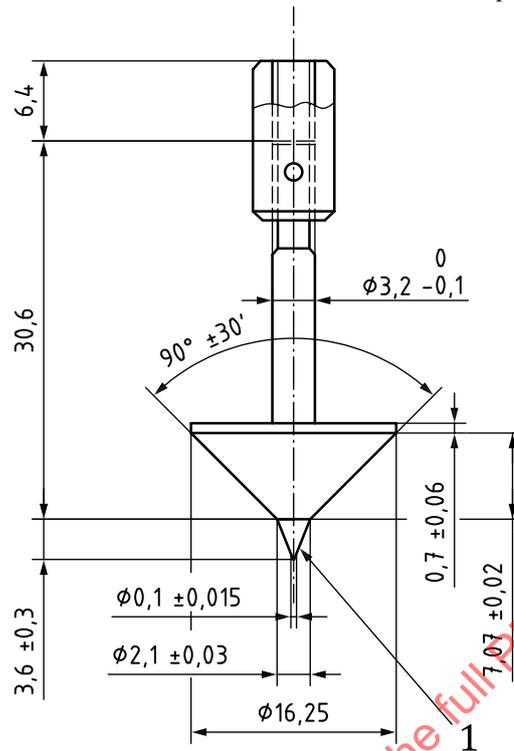

**Key**

1 hardened steel trip — angle:  $30^\circ \pm 30'$

**Figure 5 — One-quarter-scale cone**

**6.3 Grease workers**

**6.3.1 Full-scale grease worker**, conforming to the dimensions shown in [Figure 6](#).

The sizes of non-dimensioned parts are not critical and may be varied according to individual requirements. Other methods of fastening the cover and securing the worker may be used. The grease worker may be constructed for either manual or mechanical operation. The design shall be such that a rate of 60 strokes per minute  $\pm 10$  strokes per minute, with a minimum length of 63 mm, can be maintained. A suitable thermometer, standardized at 25 °C, shall be provided for insertion through the vent valve.

**6.3.2 One-half-scale grease worker**, conforming to the dimensions given in [Figure 7](#), of stainless steel and with a capacity of 50 ml.

Other methods of fastening the cover and securing the worker may be used. The worker may be constructed for either manual or mechanical operation. The design shall be such that a rate of 60 strokes per minute  $\pm 10$  strokes per minute, with a minimum length of 35 mm, can be maintained.

**6.3.3 One-quarter-scale grease worker**, made of stainless steel and conforming to the dimensions given in [Figure 8](#).

Other methods of fastening the cover and securing the worker may be used. The worker may be constructed for either manual or mechanical operation. The design shall be such that a rate of 60 strokes per minute  $\pm 10$  strokes per minute, with a minimum length of 14 mm, can be maintained.

**6.3.4 Overflow-ring (optional)**, conforming to the illustration shown in [Figure 6](#).

This is a useful aid for returning displaced grease to the grease worker cup. The overflow ring shall be positioned at least 13 mm below the rim of the cup while making a penetration measurement. A rim of 13 mm high is helpful.

**6.4 Grease cutter**, having a sharp, rigidly mounted, bevelled blade, essentially as shown in [Figure 9](#).

It is necessary that the blade be straight and sharpened as shown in [Figure 9](#). Grind both surfaces to 1,2 mm thick. Also grind the lower edge.

For optimal functioning, the supporting wood table shall be grained perpendicular to the blade.

**6.5 Air bath or constant temperature test room**, capable of being maintained at  $25,0\text{ °C} \pm 0,5\text{ °C}$  and holding the assembled grease worker.

If the bath is to be used for samples for unworked penetrations, a means shall be provided for protecting the grease surface from water. A cover shall also be provided to maintain the air temperature above the sample at  $25\text{ °C}$ .

An air bath, maintained at  $25,0\text{ °C} \pm 0,5\text{ °C}$ , is required for determining block penetration; a tightly sealed container placed in the water bath will suffice.

Water bath may be used as an alternate to air bath.

**6.6 Thermometer, calibrated at  $25\text{ °C}$** , for the water bath or air bath.


**6.7 Oven**, capable of maintaining a temperature of  $85\text{ °C} \pm 2\text{ °C}$ , for melting the petrolatum samples.

**6.8 Spatula**, corrosion-resistant, square-ended, with a stiff blade approximately 32 mm wide and at least 150 mm long; for tests with one-half-scale and one-quarter-scale cones, the width should be approximately 13 mm.

**6.9 Timer**, graduated in 0,1 s.

Dimensions in millimetres

Tolerances on dimensions except where otherwise stated:  $\pm 0,25$  mm

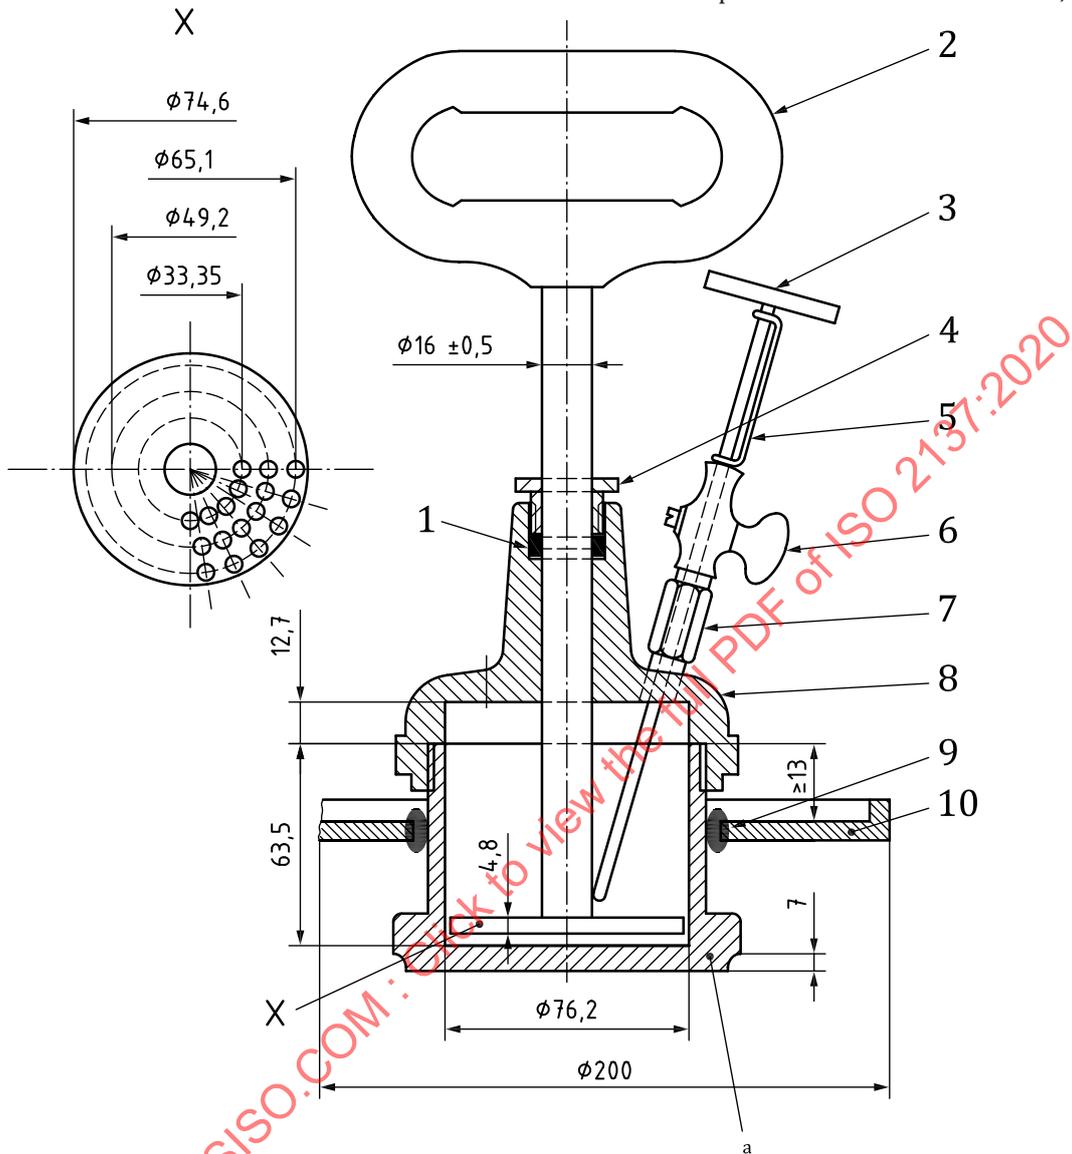

**Key**


- |   |                   |    |                          |
|---|-------------------|----|--------------------------|
| 1 | packing           | 6  | vent valve               |
| 2 | handle            | 7  | adapter                  |
| 3 | thermometer       | 8  | cover                    |
| 4 | packing nut       | 9  | split rubber tube        |
| 5 | thermometer gauge | 10 | overflow ring (optional) |

<sup>a</sup> Optional, concentric to the interior of the cup, for use with the centring device.

Plan of perforated plate (detail X) —  
 circle 1( $\phi$  33,35): 12 holes  
 circle 2( $\phi$  49,20): 17 holes  
 circle 3( $\phi$  65,10): 22 holes  
 all holes:  $6,4 < \phi < 6,53$

**Figure 6 — Full-scale grease worker**

Dimensions in millimetres

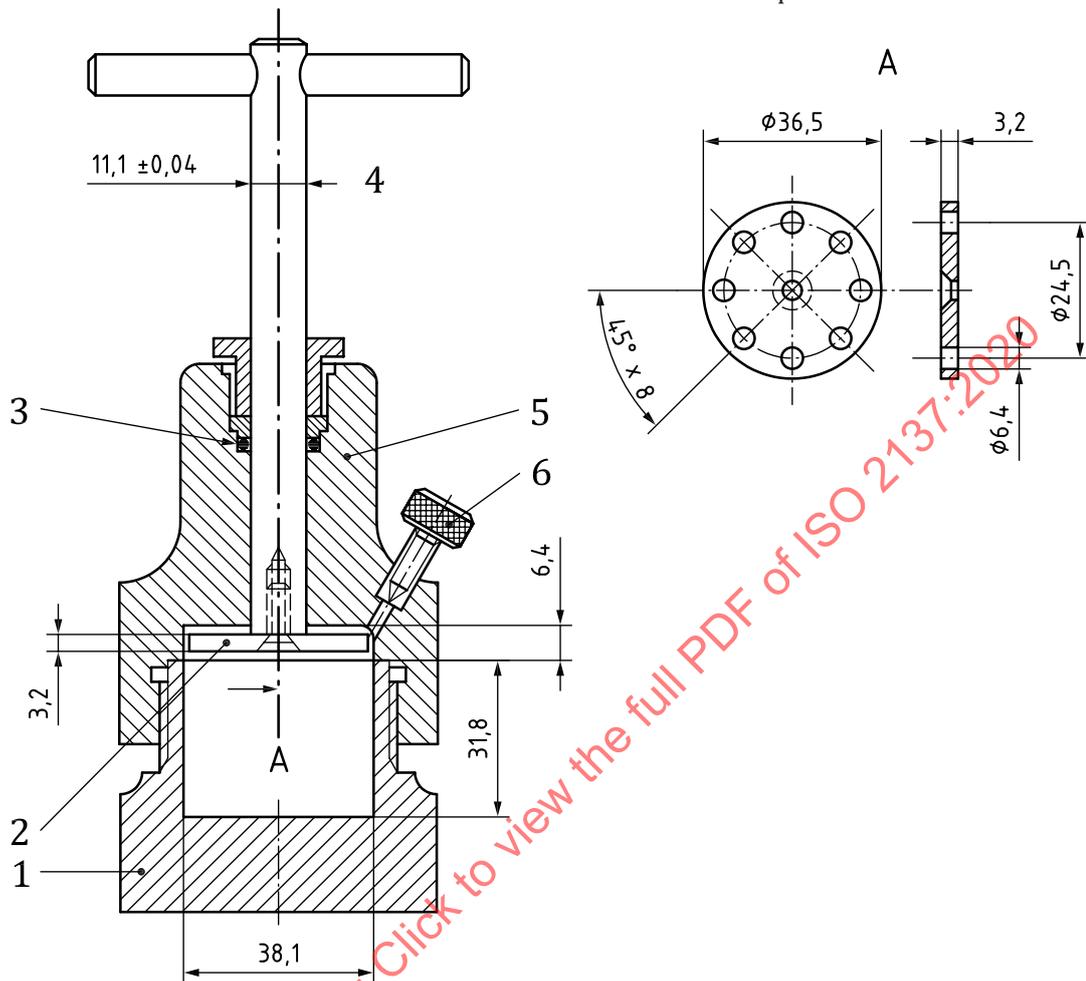Tolerances on dimensions except where otherwise stated:  $\pm 0,25$  mm**Key**

- |   |              |   |       |
|---|--------------|---|-------|
| 1 | base         | 4 | shaft |
| 2 | grease plate | 5 | cover |
| 3 | ring         | 6 | valve |


**Figure 7 — One-half-scale grease worker**

**6.10 Test-portion containers (for petrolatum)**, cylindrical, having a flat bottom  $100 \text{ mm} \pm 5 \text{ mm}$  in diameter and 65 mm or more in depth, constructed of metal at least 1,6 mm thick and, if necessary, each provided with a well-fitting watertight cover (see [10.1.3](#)).

Containers of the “ointment box” type having somewhat flexible sides should not be used, for these permit slight working of the petrolatum, due to flexing of the sides in handling.

Dimensions in millimetres

Tolerances on dimensions except where otherwise stated:  $\pm 0,25$  mm

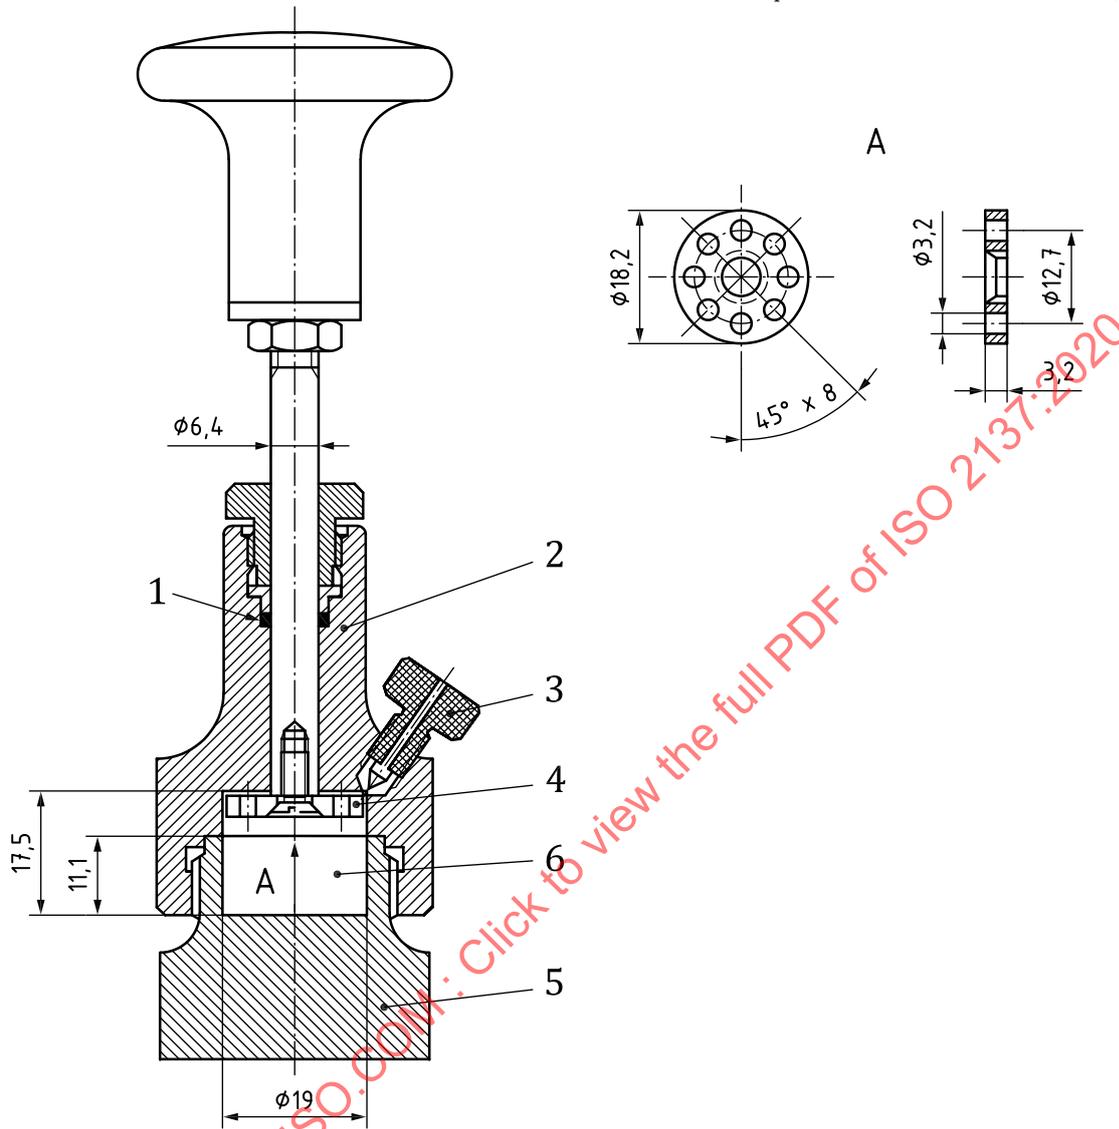


**Key**

- |   |       |   |  |
|---|-------|---|--|
| 1 | ring  | 4 | grease plate   |
| 2 | cover | 5 | base   |
| 3 | valve | 6 | chamber: $\varnothing 19,0 \times 17,5$ height — capacity with the plate, as shown: 4 ml |

**Figure 8 — One-quarter-scale grease worker**

Dimensions in millimetres

Tolerances on dimensions except where otherwise stated:  $\pm 0,25$  mm

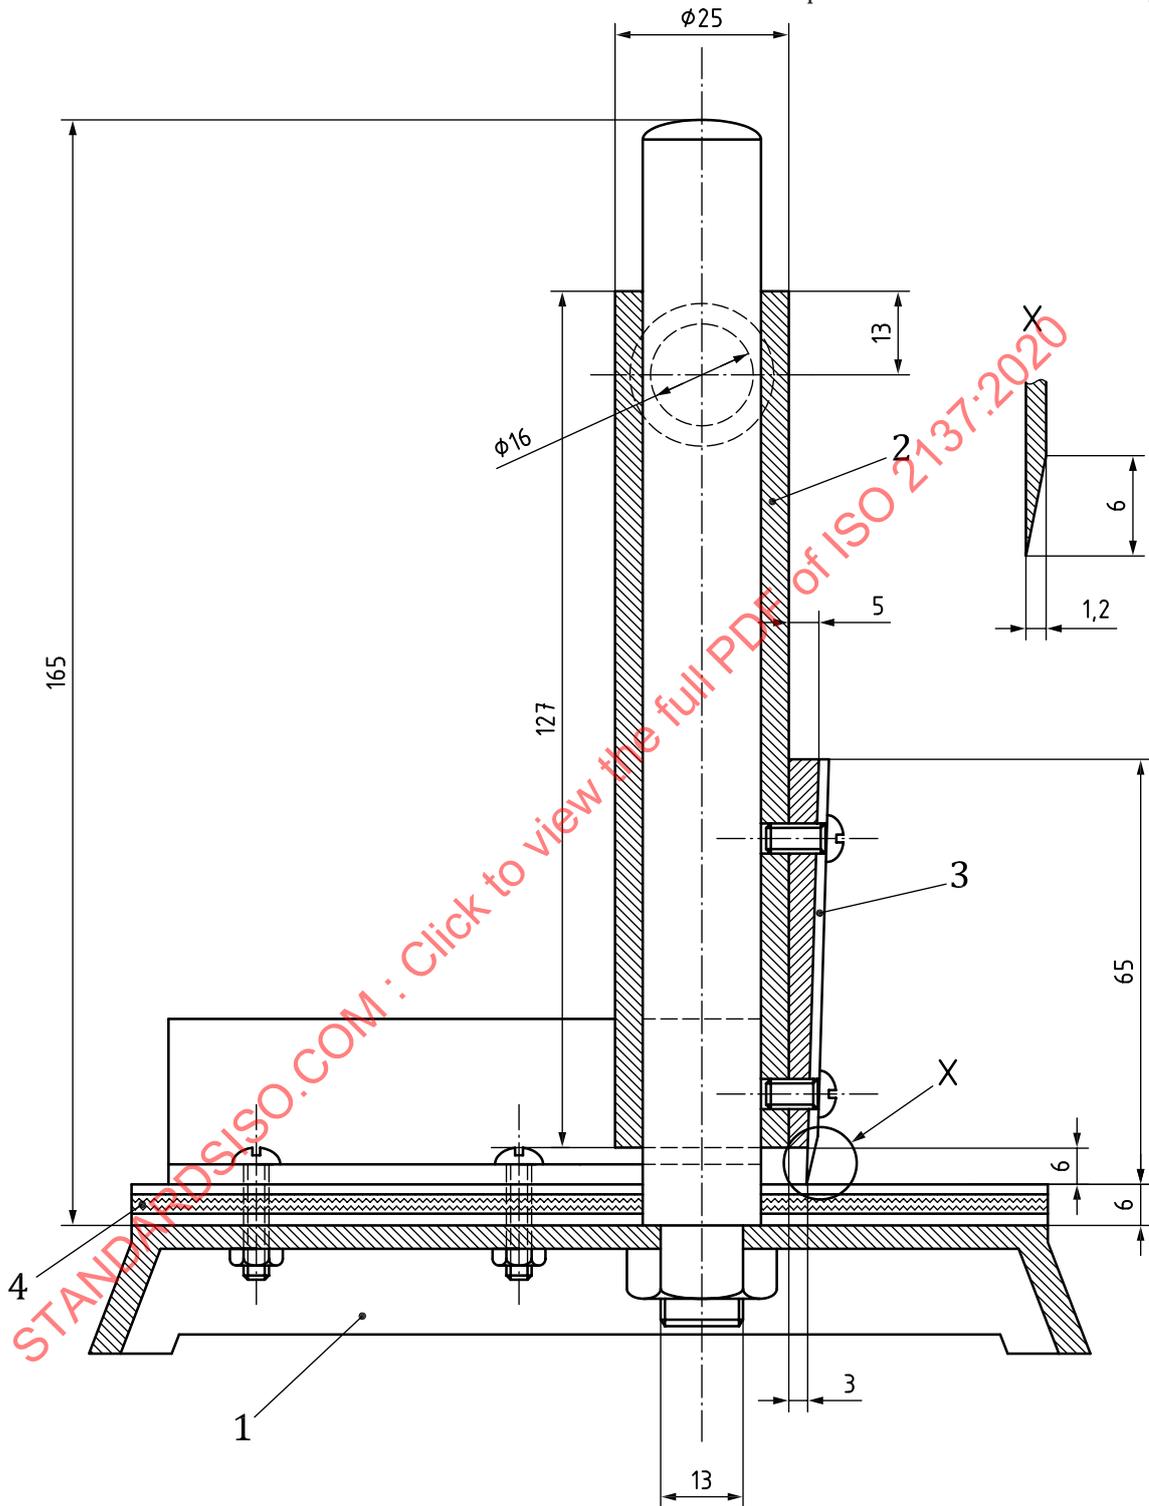

**Key**

- 1 base
- 2 tube
- 3 blade 65 × 185 — hardened steel
- 4 plywood or hard wood, 6,4 mm thick

**Figure 9 — Grease cutter**

## 7 Sampling

Unless otherwise specified in a commodity specification, samples shall be drawn in accordance with ISO 23572.

The samples shall be examined for any sign of non-homogeneity such as oil separation, phase changes or gross contamination. If any abnormal conditions are found, a new sample shall be drawn.

The size of the sample shall be large enough to fill the required number of cups.

## 8 Procedures for lubricating grease using full-scale methods

### 8.1 Procedure for unworked penetration

#### 8.1.1 Preparation of test portion

**8.1.1.1** Take sufficient sample (at least 0,5 kg) to overfill the cup of the grease worker (6.3.1). If the penetration is over 200 units, at least three times the amount needed to fill the cup is required.

**8.1.1.2** Place the empty assembled grease worker, or metal container of equal inside dimensions, and an appropriate amount of the test sample in a metal container in the air bath (6.5) maintained at 25 °C for sufficient time to bring the temperature of the sample to 25 °C ± 0,5 °C.

**8.1.1.3** Transfer from the container a test portion, preferably in one lump, to overfill the cup of the grease worker or metal container of equal inside dimensions (see below). Make this transfer in such a manner that the grease is worked as little as possible. Jar the cup to drive out trapped air and pack the grease with the spatula (6.8), with as little manipulation as possible, to obtain a cupful without air pockets. Scrape off the excess grease extending above the rim, creating a flat surface, by moving the blade of the spatula, held inclined toward the direction of motion at an angle of approximately 45°, across the rim of the cup. Do not perform any further levelling or smoothing of the surface throughout the determination of unworked penetration and carry out the measurement immediately.

**8.1.1.4** The penetration of soft greases is dependent upon the diameter of the container. Therefore, greases having unworked penetrations over 265 units should be tested in containers having the same diameter limitations as those of the grease worker cup. The results on greases having penetrations below 265 units are not significantly affected if the diameter of the container exceeds that of the grease worker cup.

Before proceeding for penetration test, ensure that the grease test portion temperature is maintained at 25,0 °C ± 0,5 °C uniformly.

#### 8.1.2 Cleaning the cone and movable attachments

First check if the needle of the cone is not damaged. Clean the penetrometer cone carefully (preferably using a volatile gum-free solvent) before each test. Bending of the cone shaft can be avoided by holding it securely in its raised position whilst cleaning. Remove all grease or oil from the penetrometer shaft (preferably using a volatile gum-free solvent), as they can cause drag on the shaft assembly. Do not rotate the cone, as this can cause wear on the release mechanism. Take care that the needle of the cone is not damaged during cleaning process.

NOTE For penetrations up to 400 units, the optional cone as shown in [Figure 3](#) can be used.

#### 8.1.3 Penetration measurement

**8.1.3.1** Place the cup on the penetrometer table, which shall be adjusted to a perfectly horizontal position, making certain that it cannot rock. Set the mechanism to hold the cone in the “zero” position

and adjust the apparatus carefully so that the tip of the cone just touches the surface of the test portion at the point specified in [8.1.3.2](#) or [8.1.3.3](#). Watching the shadow of the cone tip is an aid to accurate setting.

For greases with penetrations over 400 units, centre the cup to within 0,3 mm of the tip of the cone. One way to centre the cup accurately is to use a centring device (see [Figure 1](#)). Release the cone shaft rapidly, allow it to drop for  $5,0 \text{ s} \pm 0,1 \text{ s}$  and re-clamp it in this position. The release mechanism shall not drag on the shaft. Gently depress the indicator shaft until it is stopped by the cone shaft and read the penetration from the indicator scale.

**8.1.3.2** If the test portion has a penetration over 200 units, centre the cone carefully in the container. This test portion shall be used for only one test.

**8.1.3.3** If the test portion has a penetration of 200 units or less, perform three tests in a single container, spacing the penetrations on three radii approximately  $120^\circ$  apart, and approximately midway between the centre and the side of the container, so that the cone neither strikes the side of the container nor impinges on the disturbed area made in a previous test.

**8.1.3.4** Make a total of three determinations on the test portion [either in three containers (see [8.1.3.2](#)) or in one container (see [8.1.3.3](#))] and record the values obtained.

## 8.2 Procedure for worked penetration

### 8.2.1 Preparation of test sample

#### 8.2.1.1 Sample

Take sufficient sample (at least 0,5 kg) to overfill the cup of the grease worker ([6.3.1](#)).

#### 8.2.1.2 Working

Transfer a sufficient quantity of the laboratory sample to the cup of the clean grease worker ([6.3.1](#)) to overfill it (mounded up approximately 13 mm at the centre), avoiding the inclusion of air by packing with the spatula ([6.8](#)). Jar the cup from time to time as it is being packed to remove any trapped air.

Assemble the grease worker with the plunger raised and, with the vent valve open, depress the plunger to the bottom. Insert a thermometer ([6.6](#)) through the vent valve so that its tip is in the centre of the grease. Place the assembled grease worker in the bath ([6.5](#)) maintained at  $25^\circ\text{C}$  until the temperature of the grease worker and contents is  $25,0^\circ\text{C} \pm 0,5^\circ\text{C}$  as indicated by the thermometer.

Then remove the grease worker from the bath and wipe off excess water adhering to its surfaces. Remove the thermometer and close the vent cock.

Subject the grease to 60 full (63 mm to 71,5 mm) double strokes of the plunger, completed in approximately 1 min, and return the plunger to its top position. Open the vent valve, remove the top and plunger, and return to the cup as much of the grease clinging to the plunger as can readily be removed.

As the worked penetration of a lubricating grease can change significantly on standing, proceed in accordance with [8.2.2](#) and [8.2.3](#) without delay.

If it is desired to immerse the part of the grease worker above its closure, care should be taken that the lid is watertight in order to prevent the entrance of water to the grease worker.

### 8.2.2 Preparation of test portion

**8.2.2.1** Prepare the worked test sample ([8.2.1.2](#)) in the cup for testing so that a uniform and reproducible structure of grease is obtained.

**8.2.2.2** Jar the cup sharply on the bench or floor and pack the grease down with the spatula (6.8) to fill the holes left by the plunger and to remove any air pockets.

The jarring should be as vigorous as is required to remove the entrapped air without splashing the sample from the cup. When performing these operations, a minimum of manipulation shall be used, as continued agitation of the grease can have the effect of increasing the working beyond the specified 60 strokes.

**8.2.2.3** Scrape off the excess grease extending above the rim of the cup, creating a flat surface, by moving the blade of the spatula, held inclined toward the direction of motion at an angle of approximately 45°, across the rim of the cup. Retain the portion of grease that is removed.

**8.2.2.4** Particularly when testing soft greases, retain the grease removed when scraping the cup to provide a full cup for subsequent tests. Keep the outside of the rim of the cup clean so that the grease forced by the penetrometer cone to overflow the cup can be returned to the cup prior to preparing the sample for the next test.

### **8.2.3 Penetration measurement**

**8.2.3.1** Determine the penetration of the sample as described in 8.1.2 and 8.1.3.1.

**8.2.3.2** Immediately make two more determinations in succession on the same test portion. First, return to the cup the portion of grease previously removed with the spatula in 8.2.2.3. Then repeat the operation specified in 8.2.2 through 8.2.3.1. Record the three values obtained.

## **8.3 Procedure for prolonged worked penetration**

### **8.3.1 Preparation of apparatus and test portion**

#### **8.3.1.1 Temperature**

Maintain the temperature of the room used for the test within the range of 15 °C to 30 °C. No further control of the grease worker temperature is necessary, but, before starting the test, the grease shall have been in the room for sufficient time to bring its temperature within the range of 15 °C to 30 °C.

#### **8.3.1.2 Working**

Fill a clean grease worker cup and assemble the worker as described in 8.2.1.2. Subject the grease sample to the prescribed (for instance 100 000) or agreed number of double strokes.

In order to minimize leakage during working, special attention should be paid to the gland in the grease worker cover.

### **8.3.2 Penetration measurement**

Immediately after the working has been completed, place the grease worker in a constant-temperature water bath or air bath (6.5) to bring the test portion temperature to 25,0 °C ± 0,5 °C within 1,5 h. Remove the worker from the bath and subject the grease to a further 60 (63 mm to 71,5 mm) double strokes. Prepare and penetrate the test portions as described in 8.2.2 and 8.2.3.

## 8.4 Procedure for block penetration

### 8.4.1 Preparation of test portion

**8.4.1.1** Take sufficient sample of the grease, which shall be hard enough to hold its shape to permit cutting from it a test sample comprised of a cube with sides approximately 50 mm in length.

**8.4.1.2** By means of the grease cutter (6.4), cut as a test sample from the laboratory sample at room temperature, a cube with sides approximately 50 mm in length. While holding this test sample so that the unbevelled edge of the cutter is toward it, slice off a layer approximately 1,5 mm in thickness from each of the three faces adjacent to a single corner, which may be truncated for identification.

**8.4.1.3** Take care not to touch those portions of the newly exposed faces that are used for testing or to set a prepared face against the base plate or guide of the cutter.

**8.4.1.4** Bring the temperature of the finished test portion to  $25,0\text{ °C} \pm 0,5\text{ °C}$  by placing it in a constant-temperature air bath maintained at  $25\text{ °C}$  for at least 1 h (see the last paragraph of 8.1.1.4).

### 8.4.2 Penetration measurement

Place the test portion on the table of the penetrometer, which shall be adjusted to a perfectly horizontal position, with one of the prepared faces upward, and press it down by the corners to make it rest level and firmly on the table so that it cannot rock during the test. Set the mechanism to hold the cone in the “zero” position and adjust the apparatus carefully so that the tip of the cone just touches the surface at the centre of the test portion.

Determine the penetration as described in 8.1.2 and 8.1.3. Carry out a total of three tests on the exposed face of the test portion, locating the tests at least 6 mm from the edge and as far apart as possible without impinging on any touched portion, air hole or other apparent flaw in the surface. If the result of any of these tests differs from the others by more than three units, carry out additional tests until three values agreeing within three units are obtained. Average these three values for the face being tested.

### 8.4.3 Additional determinations

In order to equalize, in the final value, the effect of the fibre orientation in testing fibrous grease, repeat the procedure described in 8.4.2 on each of the other prepared faces of the test portion and record the average values obtained.

Smooth-textured, non-fibrous greases may be tested on one face only, when agreed upon between the interested parties.

## 9 Procedures for lubricating grease using one-half-scale and one-quarter-scale cone method

### 9.1 General

These test procedures are applicable to greases having penetration of 175 units to 385 units and are intended for use only where the size of the sample prevents the use of full-scale test.

Actual reduced-scale penetration values are not to be used or reported and shall be converted to full-scale penetration values.

The use of the one-quarter-scale cone should be limited as much as possible, due to the poor precision, to cases where the quantity of test grease is not sufficient for use of the one-half-scale cone. It is not recommended to use the one-quarter-scale cone for the determination of the penetration change of greases after mechanical shear tests in bearings or in specific test rigs.

## 9.2 Procedure for unworked penetration

### 9.2.1 Preparation of test portion

Take sufficient sample to overfill the cup of the grease worker ([6.3.2](#) or [6.3.3](#)). If the penetration by the one-quarter-scale cone is greater than 47 units or by the one-half-scale cone greater than 97 units, at least three times the amount needed to fill the cup shall be taken, as only one test shall be made in one grease cup.

Proceed as described in [8.1.1.2](#).

### 9.2.2 Cleaning cone and movable attachments

Clean the penetrometer cone ([6.2.2](#) or [6.2.3](#)), preferably using a volatile gum-free solvent, carefully before each test. Bending of the cone shaft can be avoided by holding it securely in its raised position while cleaning. Remove all grease or oil from the penetrometer shaft (preferably using a volatile gum-free solvent), as they can cause drag on the shaft assembly. Do not rotate the cone, as this can cause wear of the release mechanism.

### 9.2.3 Penetration measurement

**9.2.3.1** Carry out a preliminary determination of the penetration as specified below with the cone at the centre of the test portion surface; if the approximate value of the penetration is already known, this step may be omitted.

**9.2.3.2** If the test portion has a penetration over 47 units by the one-quarter-scale cone ([6.2.3](#)) or over 97 units by the one-half-scale cone ([6.2.2](#)), centre the cone carefully in the container; this test portion can then be used for only one test.

**9.2.3.3** If the test portion has a penetration of 47 units or less by the one-quarter-scale cone or 97 units or less by the one-half-scale cone, perform three tests in a single container, spacing these tests on three radii approximately 120° apart, and approximately midway between the centre and side of the container so that the cone neither strikes the side of the container nor impinges on the disturbed area made in a previous test.

**9.2.3.4** Proceed as described in [8.1.3.1](#) and [8.1.3.4](#).

## 9.3 Procedure for worked penetration

### 9.3.1 Preparation of test sample

#### 9.3.1.1 Sample

Take sufficient sample to overfill the cup of the appropriate grease worker ([6.3.2](#) or [6.3.3](#)).

#### 9.3.1.2 Working

Proceed in accordance with [8.2.1.2](#) but mounding up to approximately 6 mm and without using a thermometer in the grease worker.

### 9.3.2 Preparation of test portion

Proceed in accordance with [8.2.2](#).