

# AERONAUTICAL MATERIAL SPECIFICATION

Society of Automotive Engineers, Inc.  
29 West 39th Street  
New York City

## AMS 2645C

Issued 7-1-48

Revised 3-1-55

### FLUORESCENT PENETRANT INSPECTION

1. ACKNOWLEDGMENT: A vendor shall mention this specification number and its revision letter in all quotations and when acknowledging purchase orders.
2. APPLICATION: Detection of surface discontinuities such as cracks, laps, porosity, cold shuts, lack of bond, and similar defects.
3. MATERIALS AND EQUIPMENT:
  - 3.1 Penetrant: Shall be a highly fluorescent liquid capable of penetrating fine discontinuities. Unless otherwise permitted, the penetrant shall be made up from a water-washable base or shall be washable with water after application of an emulsifying agent to the film on parts; penetrant and emulsifying agent shall be non-toxic and non-corrosive.
  - 3.2 Developer: Shall be a highly absorbent, non-fluorescent, and non-toxic powder, capable of being used either dry or suspended in water. When the suspension is used, the powder shall be thoroughly mixed with water to a concentration of not less than 1 lb to 5 gal and a uniform distribution maintained by mechanical agitation.
  - 3.3 Equipment: Shall be so constructed and arranged as to permit uniform, controlled operation.
  - 3.4 Lighting: A darkness booth or similar darkness area with a filtered black light source shall be provided. The black light shall be at least equal to that produced by a 100 w mercury vapor projection spot lamp equipped with a filter to transmit wave lengths of between 3200 and 4000 angstrom units and absorb substantially all visible light.
4. PREPARATION OF PARTS:
  - 4.1 Parts shall normally be fluorescent penetrant inspected prior to all surface treatments such as plating, anodizing, dichromating, peening, or similar treatments which would tend to close or mask surface discontinuities. Fluorescent penetrant inspection may be performed after surface treatments provided it is demonstrated that the treatment is of such a nature that discontinuities are not obscured.
  - 4.2 If machined surfaces are to be inspected, they shall be finished with a clean cut to prevent flowing or burnishing of the surface layer or shall be etched with a suitable etchant to remove flowed or burnished layers which might mask discontinuities. Parts shall not be etched indiscriminately because etching itself tends to mask surface discontinuities.
  - 4.3 All parts shall be cleaned and dried in such a manner as to leave the surfaces free from grease, oil, soaps, alkalies, and other substances which would interfere with inspection. Vapor degreasing is generally suitable for this purpose.

Section 7C of the SAE Technical Board rules provides that: "All technical reports, using standards approved and practices recommended, are advisory only. Their use by anyone engaged in industry or trade is entirely voluntary. There is no agreement or recommended practice, and no commitment to conform to or be dictated by any technical reports or standards, technical reports, the Board and its Committee will not investigate or consider patents which may apply to the subject matter. Prospective users of the report are responsible for protecting themselves against liability for infringement of patents."

- 4.4 This section shall not be interpreted as prohibiting additional fluorescent penetrant inspections after further processing or after use of parts.
5. PROCEDURE: After preparation, the parts shall immediately be subjected to the following operations:
- 5.1 Parts shall be immersed in the penetrant, or shall be sprayed or brushed with the penetrant, and shall be allowed to remain immersed in the penetrant or to stand for a sufficient length of time to allow satisfactory penetration into all discontinuities. This time shall not be less than 5 minutes. The time of immersion or standing will depend upon the character and fineness of the discontinuities, the effectiveness of penetration increasing with time.
- 5.2 Parts shall be removed from the penetrant and cleaned thoroughly using a medium which will remove penetrant from the surfaces of parts; washing with water shall be used when the penetrant is water washable or when an emulsifying agent is applied to surfaces of parts to render the penetrant water washable. When other than water washable penetrants are used, the penetrant shall be removed with a suitable cleaner. During cleaning, the parts may be viewed under a suitable "black light" to ensure complete removal of the penetrant from the surfaces of the part. Excessive cleaning which would remove the penetrant from discontinuities shall be avoided.
- 5.3 When a wet developer is used, the developer shall be applied to the parts immediately after washing, by immersing the parts in the tank containing the water-suspended powder, or by spraying or flowing the suspension onto the parts. The suspension shall be suitably agitated either during, or immediately prior to application to parts. Immersed parts shall be removed from the wet developer; excess developer shall be allowed to drain off all parts.
- 5.4 When a dry developer or no developer is used, the above operation shall be omitted and the parts dried as in 5.5.
- 5.5 Parts shall be dried as thoroughly as possible by exposure to clean air. Drying of parts may be accomplished by evaporation at room temperature or by placing the parts in a circulating warm air oven or in the air stream of a hot air dryer. Excessive drying time or temperature should be avoided to prevent evaporation of the penetrant.
- 5.6 When a dry developer is used, the developing powder shall be applied uniformly over the areas of the parts to be inspected by either dusting or powder box immersion.
- 5.7 After sufficient time has been allowed to develop indications, parts shall be examined in a darkened enclosure under the "black light" described in 3.4.
- 5.8 When greater sensitivity is desired, the parts may be heated to 150-220 F before immersion in the penetrant and/or before "black light" examination.
- 5.9 Interpretation of the indications revealed by fluorescent penetrant inspection and final disposition of the parts should be the responsibility of only those persons qualified by experience with fluorescent penetrant inspection.
- 5.10 Parts shall be cleaned if necessary, to remove penetrant and developer.

6. DISPOSITION:

- 6.1 Parts containing minor discontinuities which would not be considered detrimental to the part under operating conditions may be approved for acceptance without remedial operations at the discretion of authorized personnel.
- 6.2 If a discontinuity should be of such nature and so located that its removal would not adversely affect the serviceability of the part, although local sections might be outside drawing limits, the correction may be made with the approval of authorized personnel after due consideration of the stress distribution within the part and the function of the part itself. If a discontinuity is removed, the spot shall be well blended in such a manner as to minimize surface flow of the material. Swab etching of the blended area before reinspection is recommended wherever practicable. Etched surface shall be polished after reinspection.
- 6.3 Parts having discontinuities which are considered detrimental to strength or serviceability shall be rejected.

7. MARKING:

- 7.1 Wherever practicable, the character  $\text{P}$  (P with an F backward) shall be marked, by etching or impression stamping, on all parts which have satisfactorily passed the fluorescent penetrant inspection, including those parts actually inspected from a lot accepted on a sampling basis.
- 7.2 Parts accepted on a sampling basis but not actually inspected may be identified by the  $\text{P}$  character enclosed in a circle.
- 7.3 The letter E may be added to indicate use of the post-emulsification procedure.
- 7.4 Where impression stamping or etching is not appropriate because of size, finish, or function of the part, identification may be by dyeing or by tagging; when dyeing is used, a maroon dye shall be used on all parts actually inspected and a yellow dye on parts accepted on a sampling basis but not actually inspected.

8. PRECAUTIONS:

- 8.1 Rinsing in dilute acid during preparation of parts should be avoided or, if used, excess acid on parts shall be neutralized.
- 8.2 Parts should not be in contact with water during washing any longer than is absolutely necessary. When wet developer is applied by immersion, parts should be dipped into the solution and removed at once.
- 8.3 Avoid excessive drying time when using heat. It is only necessary to remove all moisture.
- 8.4 Both the penetrant and the dry developer should be kept as free from moisture and contaminating liquids as possible. Wet developer suspension shall be kept as free from fluorescent contaminating materials as possible.
- 8.5 All parts susceptible to corrosion should be slushed with a corrosion inhibiting oil.