

INTERNATIONAL  
STANDARD

IEC  
CEI

NORME  
INTERNATIONALE

**60034-8**

Third edition  
Troisième édition  
2007-06

---

---

**Rotating electrical machines –**

**Part 8:  
Terminal markings and direction of rotation**

**Machines électriques tournantes –**

**Partie 8:  
Marques d'extrémité et sens de rotation**



Reference number  
Numéro de référence  
IEC/CEI 60034-8:2007



## THIS PUBLICATION IS COPYRIGHT PROTECTED

Copyright © 2007 IEC, Geneva, Switzerland

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either IEC or IEC's member National Committee in the country of the requester.

If you have any questions about IEC copyright or have an enquiry about obtaining additional rights to this publication, please contact the address below or your local IEC member National Committee for further information.

Droits de reproduction réservés. Sauf indication contraire, aucune partie de cette publication ne peut être reproduite ni utilisée sous quelque forme que ce soit et par aucun procédé, électronique ou mécanique, y compris la photocopie et les microfilms, sans l'accord écrit de la CEI ou du Comité national de la CEI du pays du demandeur.

Si vous avez des questions sur le copyright de la CEI ou si vous désirez obtenir des droits supplémentaires sur cette publication, utilisez les coordonnées ci-après ou contactez le Comité national de la CEI de votre pays de résidence.

IEC Central Office  
3, rue de Varembe  
CH-1211 Geneva 20  
Switzerland  
Email: [inmail@iec.ch](mailto:inmail@iec.ch)  
Web: [www.iec.ch](http://www.iec.ch)

## About the IEC

The International Electrotechnical Commission (IEC) is the leading global organization that prepares and publishes International Standards for all electrical, electronic and related technologies.

## About IEC publications

The technical content of IEC publications is kept under constant review by the IEC. Please make sure that you have the latest edition, a corrigenda or an amendment might have been published.

- Catalogue of IEC publications: [www.iec.ch/searchpub](http://www.iec.ch/searchpub)

The IEC on-line Catalogue enables you to search by a variety of criteria (reference number, text, technical committee,...). It also gives information on projects, withdrawn and replaced publications.

- IEC Just Published: [www.iec.ch/online\\_news/justpub](http://www.iec.ch/online_news/justpub)

Stay up to date on all new IEC publications. Just Published details twice a month all new publications released. Available on-line and also by email.

- Customer Service Centre: [www.iec.ch/webstore/custserv](http://www.iec.ch/webstore/custserv)

If you wish to give us your feedback on this publication or need further assistance, please visit the Customer Service Centre FAQ or contact us:

Email: [csc@iec.ch](mailto:csc@iec.ch)  
Tel.: +41 22 919 02 11  
Fax: +41 22 919 03 00

## A propos de la CEI

La Commission Electrotechnique Internationale (CEI) est la première organisation mondiale qui élabore et publie des normes internationales pour tout ce qui a trait à l'électricité, à l'électronique et aux technologies apparentées.

## A propos des publications CEI

Le contenu technique des publications de la CEI est constamment revu. Veuillez vous assurer que vous possédez l'édition la plus récente, un corrigendum ou amendement peut avoir été publié.

- Catalogue des publications de la CEI: [www.iec.ch/searchpub/cur\\_fut-f.htm](http://www.iec.ch/searchpub/cur_fut-f.htm)

Le Catalogue en-ligne de la CEI vous permet d'effectuer des recherches en utilisant différents critères (numéro de référence, texte, comité d'études,...). Il donne aussi des informations sur les projets et les publications retirées ou remplacées.

- Just Published CEI: [www.iec.ch/online\\_news/justpub](http://www.iec.ch/online_news/justpub)

Restez informé sur les nouvelles publications de la CEI. Just Published détaille deux fois par mois les nouvelles publications parues. Disponible en-ligne et aussi par email.

- Service Clients: [www.iec.ch/webstore/custserv/custserv\\_entry-f.htm](http://www.iec.ch/webstore/custserv/custserv_entry-f.htm)

Si vous désirez nous donner des commentaires sur cette publication ou si vous avez des questions, visitez le FAQ du Service clients ou contactez-nous:

Email: [csc@iec.ch](mailto:csc@iec.ch)  
Tél.: +41 22 919 02 11  
Fax: +41 22 919 03 00

INTERNATIONAL  
STANDARD

IEC  
CEI

NORME  
INTERNATIONALE

**60034-8**

Third edition  
Troisième édition  
2007-06

---

---

**Rotating electrical machines –**

**Part 8:  
Terminal markings and direction of rotation**

**Machines électriques tournantes –**

**Partie 8:  
Marques d'extrémité et sens de rotation**



Commission Electrotechnique Internationale  
International Electrotechnical Commission  
Международная Электротехническая Комиссия

PRICE CODE  
CODE PRIX

**V**

*For price, see current catalogue  
Pour prix, voir catalogue en vigueur*

## CONTENTS

|                                                                                                                                                   |    |
|---------------------------------------------------------------------------------------------------------------------------------------------------|----|
| FOREWORD.....                                                                                                                                     | 5  |
| INTRODUCTION.....                                                                                                                                 | 7  |
| 1 Scope.....                                                                                                                                      | 8  |
| 2 Normative references .....                                                                                                                      | 8  |
| 3 Terms and definitions .....                                                                                                                     | 8  |
| 4 Symbols .....                                                                                                                                   | 10 |
| 4.1 General.....                                                                                                                                  | 10 |
| 4.2 DC and single-phase commutator machines .....                                                                                                 | 10 |
| 4.3 AC machines without commutators.....                                                                                                          | 10 |
| 4.4 Auxiliary devices .....                                                                                                                       | 11 |
| 5 Direction of rotation .....                                                                                                                     | 11 |
| 6 Rules for terminal markings .....                                                                                                               | 11 |
| 6.1 General.....                                                                                                                                  | 11 |
| 6.2 Suffixes.....                                                                                                                                 | 12 |
| 6.3 Prefixes.....                                                                                                                                 | 13 |
| 6.4 Winding identification for categories of machines .....                                                                                       | 13 |
| 6.5 Synchronous machines .....                                                                                                                    | 14 |
| 6.6 DC machines.....                                                                                                                              | 14 |
| 6.7 Relation between terminal markings and direction of rotation .....                                                                            | 14 |
| 6.8 Terminal marking figures .....                                                                                                                | 15 |
| 7 Auxiliary terminal marking rules .....                                                                                                          | 20 |
| 7.1 General.....                                                                                                                                  | 20 |
| 7.2 Marking.....                                                                                                                                  | 20 |
| Annex A (normative) Connection diagrams for common applications.....                                                                              | 23 |
| Figure 1 – Single three-phase winding, three elements, open connection, six terminals .....                                                       | 15 |
| Figure 2 – Single three-phase winding, delta connection, three terminals .....                                                                    | 16 |
| Figure 3 – Single three-phase winding, internal star connection with neutral conductor, four terminals.....                                       | 16 |
| Figure 4 – Single three-phase winding, two elements per phase, open connection, twelve terminals.....                                             | 16 |
| Figure 5 – Single three-phase winding, four elements per phase, open connection, twenty-four terminals .....                                      | 16 |
| Figure 6 – Single three-phase winding, two elements per phase with four tapping points per element, open connection, thirty-six terminals .....   | 17 |
| Figure 7 – Two separate three-phase windings with two independent functions, two elements per phase, open connection, twenty-four terminals ..... | 17 |
| Figure 8 – Two elements, internal connection, three terminals .....                                                                               | 17 |
| Figure 9 – Single three-phase winding, star connection, duplicate terminals for alternate connection, six terminals .....                         | 17 |
| Figure 10 – Single three-phase winding, star connection, parallel terminals for shared current, six terminals .....                               | 18 |

|                                                                                                     |    |
|-----------------------------------------------------------------------------------------------------|----|
| Figure 11 – Three-phase wound-rotor, star connections with neutral conductors, eight terminals..... | 18 |
| Figure 12 – Main and auxiliary winding, two elements.....                                           | 18 |
| Figure 13 – Single-phase auxiliary winding, integrally connected capacitor, one element .....       | 18 |
| Figure 14 – Single-phase main winding, integrally connected thermal protector, one element .....    | 18 |
| Figure 15 – Six-phase winding, open connection, six elements .....                                  | 18 |
| Figure 16 – Armature winding, one element .....                                                     | 19 |
| Figure 17 – Commutating winding, one and two elements .....                                         | 19 |
| Figure 18 – Compensating winding, one and two elements .....                                        | 19 |
| Figure 19 – Series winding, one element, two tappings.....                                          | 19 |
| Figure 20 – Shunt excitation winding, one element .....                                             | 19 |
| Figure 21 – Separately excited excitation winding, one and two elements .....                       | 19 |
| Figure 22 – Direct-axis auxiliary winding, one element.....                                         | 19 |
| Figure 23 – Quadrature-axis auxiliary winding, one element .....                                    | 19 |
| Figure 24 – Armature winding with commutating and compensating windings, one element .....          | 19 |
| Figure 25 – Single-phase, single voltage .....                                                      | 20 |
| Figure 26 – Single-phase, dual voltage .....                                                        | 20 |
| Figure 27 – Three-phase, single voltage .....                                                       | 21 |
| Figure 28 – Three-phase, dual voltage.....                                                          | 21 |
| Figure 29 – Two-lead devices (except type R).....                                                   | 21 |
| Figure 30 – Two-lead devices of type R .....                                                        | 21 |
| Figure 31 – Three-lead devices of type R.....                                                       | 22 |
| Figure 32 – Four-lead devices of type R .....                                                       | 22 |
| Figure 33 – Switch connections .....                                                                | 22 |
| Figure A.1 – Delta connection.....                                                                  | 23 |
| Figure A.2 – Star connection – with or without neutral .....                                        | 23 |
| Figure A.3 – Dual voltage, six terminals ( $1:\sqrt{3}$ ).....                                      | 23 |
| Figure A.4 – Star-connected, dual voltage, nine terminals ( $1:2$ ) .....                           | 24 |
| Figure A.5 – Delta-connected, dual voltage, nine terminals ( $1:2$ ).....                           | 24 |
| Figure A.6 – Star-delta, single voltage, six terminals.....                                         | 24 |
| Figure A.7 – Star-delta, dual voltage, twelve terminals ( $1:2$ ) .....                             | 25 |
| Figure A.8 – Part-winding, single voltage, six terminals .....                                      | 25 |
| Figure A.9 – Part-winding, dual voltage, nine terminals ( $1:2$ ).....                              | 26 |
| Figure A.10 – Variable-torque, six terminals .....                                                  | 26 |
| Figure A.11 – Variable-torque, dual-voltage ( $1:\sqrt{3}$ ), nine terminals .....                  | 27 |
| Figure A.12 – Constant-torque, six terminals .....                                                  | 28 |
| Figure A.13 – Constant power, six terminals .....                                                   | 28 |
| Figure A.14 – Variable-torque, six terminals .....                                                  | 29 |
| Figure A.15 – Constant-torque, seven terminals.....                                                 | 29 |
| Figure A.16 – Constant-power, seven terminals .....                                                 | 29 |

|                                                                                                                |    |
|----------------------------------------------------------------------------------------------------------------|----|
| Figure A.17 – Example of three-speed, constant torque motor using two separate windings, ten terminals .....   | 30 |
| Figure A.18 – Example of three-speed motor using three separate windings, ten terminals.....                   | 30 |
| Figure A.19 – Example of four-speed, variable-torque motor using two separate windings, twelve terminals ..... | 31 |
| Figure A.20 – Split-phase or capacitor-start reversible motor .....                                            | 31 |
| Figure A.21 – Reversible capacitor-start motor with four terminals with externally connected capacitor.....    | 32 |
| Figure A.22 – Shunt motor or generator, four terminals.....                                                    | 32 |
| Figure A.23 – Compound-motor or generator with compensating and commutating windings, six terminals.....       | 32 |
| Figure A.24 – Series-wound motor, two terminals .....                                                          | 33 |

IECNORM.COM : Click to view the full PDF of IEC 60034-8:2007

## INTERNATIONAL ELECTROTECHNICAL COMMISSION

**ROTATING ELECTRICAL MACHINES –****Part 8: Terminal markings and direction of rotation**

## FOREWORD

- 1) The International Electrotechnical Commission (IEC) is a worldwide organization for standardization comprising all national electrotechnical committees (IEC National Committees). The object of IEC is to promote international co-operation on all questions concerning standardization in the electrical and electronic fields. To this end and in addition to other activities, IEC publishes International Standards, Technical Specifications, Technical Reports, Publicly Available Specifications (PAS) and Guides (hereafter referred to as "IEC Publication(s)"). Their preparation is entrusted to technical committees; any IEC National Committee interested in the subject dealt with may participate in this preparatory work. International, governmental and non-governmental organizations liaising with the IEC also participate in this preparation. IEC collaborates closely with the International Organization for Standardization (ISO) in accordance with conditions determined by agreement between the two organizations.
- 2) The formal decisions or agreements of IEC on technical matters express, as nearly as possible, an international consensus of opinion on the relevant subjects since each technical committee has representation from all interested IEC National Committees.
- 3) IEC Publications have the form of recommendations for international use and are accepted by IEC National Committees in that sense. While all reasonable efforts are made to ensure that the technical content of IEC Publications is accurate, IEC cannot be held responsible for the way in which they are used or for any misinterpretation by any end user.
- 4) In order to promote international uniformity, IEC National Committees undertake to apply IEC Publications transparently to the maximum extent possible in their national and regional publications. Any divergence between any IEC Publication and the corresponding national or regional publication shall be clearly indicated in the latter.
- 5) IEC provides no marking procedure to indicate its approval and cannot be rendered responsible for any equipment declared to be in conformity with an IEC Publication.
- 6) All users should ensure that they have the latest edition of this publication.
- 7) No liability shall attach to IEC or its directors, employees, servants or agents including individual experts and members of its technical committees and IEC National Committees for any personal injury, property damage or other damage of any nature whatsoever, whether direct or indirect, or for costs (including legal fees) and expenses arising out of the publication, use of, or reliance upon, this IEC Publication or any other IEC Publications.
- 8) Attention is drawn to the Normative references cited in this publication. Use of the referenced publications is indispensable for the correct application of this publication.
- 9) Attention is drawn to the possibility that some of the elements of this IEC Publication may be the subject of patent rights. IEC shall not be held responsible for identifying any or all such patent rights.

International Standard IEC 60034-8 has been prepared by IEC technical committee 2: Rotating machinery.

This third edition of IEC 60034-8 cancels and replaces the second edition published in 2002 and constitutes a technical revision.

The main change with respect to the previous edition is listed below:

- changed terminal markings for d.c. machines in Clause A.4.

The text of this standard is based on the following documents:

|             |                  |
|-------------|------------------|
| FDIS        | Report on voting |
| 2/1434/FDIS | 2/1451/RVD       |

Full information on the voting for the approval of this standard can be found in the report on voting indicated in the above table.

This publication has been drafted in accordance with the ISO/IEC Directives, Part 2.

A list of all the parts of the IEC 60034 series, under the general title *Rotating electrical machines*, can be found on the IEC website.

The committee has decided that the contents of this publication will remain unchanged until the maintenance result date indicated on the IEC web site under "<http://webstore.iec.ch>" in the data related to the specific publication. At this date, the publication will be

- reconfirmed,
- withdrawn,
- replaced by a revised edition, or
- amended.

IECNORM.COM : Click to view the full PDF of IEC 60034-8:2007

## INTRODUCTION

The revision of this part of IEC 60034 provides worldwide uniformity in the electrical connections for rotating electrical machines and applies the recommendations of the basic safety publication IEC 60445 in specifying marking requirements.

These standardized connections will then permit the safe interchange of electric machines with their control and protective devices using standardized terminal markings.

IECNORM.COM : Click to view the full PDF of IEC 60034-8:2007

## ROTATING ELECTRICAL MACHINES –

### Part 8: Terminal markings and direction of rotation

#### 1 Scope

This part of IEC 60034 applies to a.c. and d.c. machines and specifies

- a) rules for the identification of winding connection points;
- b) marking of winding terminals;
- c) direction of rotation;
- d) relationship between terminal markings and direction of rotation;
- e) terminal marking of auxiliary devices;
- f) connection diagrams of machines for common applications.

Turbine-type synchronous machines are excluded from this standard.

#### 2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

IEC 60034-1, *Rotating electrical machines – Part 1: Rating and performance*

IEC 60417-1, *Graphical symbols for use on equipment – Part 1: Overview and application*

IEC 60445, *Basic and safety principles for man-machine interface, marking and identification – Identification of equipment terminals and conductor terminations*

#### 3 Terms and definitions

For the purposes of this document, the terms and definitions given in IEC 60034-1 and the following apply.

##### 3.1

##### **terminal marking**

permanent identification of the external termination of winding leads or auxiliary leads at the disposal of the user for connection of the machine to the supply or apparatus that indicates the function of the termination

##### 3.2

##### **connecting points**

all current transfer points that are used to permanently interconnect winding or winding element ends internally

**3.3****tapping points**

intermediate connections to a portion of a winding element

**3.4****winding leads**

insulated conductors that make the electrical connection between a winding and its termination

**3.5****winding**

assembly of turns or coils having a defined function in an electrical rotating machine

[IEV 411-37-01]

**3.6****winding phase**

one or more winding elements associated with a particular phase

**3.7****winding element**

part of a winding, all the turns or coils in that part being permanently connected together

**3.8****separate windings**

two or more windings, each having a separate function, and not interconnected, used only separately, whether fully or in part

**3.9****multi-speed motor**

motor, which can be operated at any one of two or more definite speeds

**3.10****constant power**

when a multi-speed motor provides approximately constant power over the speed range

**3.11****constant torque**

when a multi-speed motor provides approximately constant torque over the speed range

**3.12****variable torque**

when output torque of a multi-speed motor is proportional to approximately the square of the speeds

**3.13****phase sequence**

order in which the voltages successively reach their maximum positive values between supply conductors

### 3.14

#### D-end

that end of the machine which accommodates the shaft end

[IEV 411-43-36]

NOTE For machines having two shaft ends, the D-end is the end

- a) having the larger diameter;
- b) opposite the external fan when the shaft ends are of the same diameter.

## 4 Symbols

### 4.1 General

|                 |                                                              |
|-----------------|--------------------------------------------------------------|
| L               | Supply conductor                                             |
| PE              | Protective earthing terminal                                 |
| ○ —             | User available terminal, marking mandatory                   |
| — ● —           | Internal connection point                                    |
| (....)          | Internal terminal marking (showing element symbol), optional |
| [ .... , .... ] | Grouping of user joined terminals                            |
| ;               | Separation of terminals or groups of terminals               |

### 4.2 DC and single-phase commutator machines

|   |                                   |
|---|-----------------------------------|
| A | Armature winding                  |
| B | Commutating winding               |
| C | Compensating winding              |
| D | Series excitation winding         |
| E | Shunt excitation winding          |
| F | Separately excited winding        |
| H | Direct-axis auxiliary winding     |
| J | Quadrature-axis auxiliary winding |

### 4.3 AC machines without commutator

|   |                                                       |
|---|-------------------------------------------------------|
| F | DC excitation winding                                 |
| K | Secondary winding                                     |
| L | Secondary winding                                     |
| M | Secondary winding                                     |
| N | Star point (neutral conductor) of the primary winding |
| Q | Star point (neutral conductor) of a secondary winding |
| U | Primary winding                                       |
| V | Primary winding                                       |
| W | Primary winding                                       |
| Z | Auxiliary windings                                    |

NOTE The primary and secondary symbol allocations are irrespective of whether the primary winding is located in the stator or rotor.

#### 4.4 Auxiliary devices

|    |                                                |
|----|------------------------------------------------|
| BA | AC brakes                                      |
| BD | DC brakes                                      |
| BW | Brush-wear detector                            |
| CA | Capacitors                                     |
| CT | Current transformer                            |
| HE | Heaters                                        |
| LA | Lightning arrestor                             |
| PT | Potential transformer                          |
| R  | Resistance thermometers                        |
| SC | Surge capacitor                                |
| SP | Surge protectors                               |
| S  | Switches including plugging switches           |
| TB | Thermostats opening on increase of temperature |
| TC | Thermocouples                                  |
| TM | Thermostats closing on increase of temperature |
| TN | Thermistors, negative temperature coefficient  |
| TP | Thermistors, positive temperature coefficient  |

NOTE This table standardizes the most commonly used auxiliary devices. The designation of other devices may be chosen by the manufacturer.

#### 5 Direction of rotation

The direction of rotation shall be that of the shaft observed when facing the D-end.

Machines with terminal markings according to this standard shall have a clockwise direction of rotation.

For other configurations, including unidirectional machines, an arrow located on the enclosure shall show the direction of rotation.

#### 6 Rules for terminal markings

##### 6.1 General

##### 6.1.1 Application

A terminal marking shall identify all winding and auxiliary device terminations accessible to the user.

NOTE External line connections and winding arrangements used for common applications are shown in Annex A.

##### 6.1.2 Marking instructions

All three-phase a.c. machines with more than three terminals and all other machines (and auxiliary devices) with more than two terminals shall have connecting instructions consistent with this standard.

### 6.1.3 Alphanumeric marking notation

The terminal marking comprises upper-case Latin characters and Arabic numerals. The characters shall be arranged without spaces.

Each winding, winding phase or auxiliary circuit shall be assigned a letter symbol(s) in accordance with Clause 4.

To prevent confusion with the numerals 1 and 0, the letters “I” and “O” shall not be used.

### 6.1.4 Duplicate winding terminals

Several leads of a machine can have the same marking only if each of them is capable of completely fulfilling the same electrical function, so that either one of them can be used for the connection. See Figure 9.

### 6.1.5 Shared terminals

When several leads or conductors are provided to share the current, the terminal markings shall be identified by an additional numerical suffix separated by a hyphen. See Figure 10.

Some multi-speed motors having two or more independent windings may produce circulating currents in the de-energized winding. In this case, the terminal markings for the open delta connection shall be identified by an additional numerical suffix separated by a hyphen. See Figure A.15.

### 6.1.6 Omissions

Numerical suffixes and/or prefixes may be omitted if there is no risk of confusion. See Figure 2.

When two or more elements are connected to the same terminal its marking shall be determined from one of the elements. The order of precedence shall be determined by the lower suffix. See Figure 8.

When two or more functionally different elements are connected internally, the combination of elements shall be considered a single element and the terminal marking shall have the alpha notation of the primary element function. See Figure 24.

### 6.1.7 Earthing terminal

The termination for the protective earthing conductor shall be marked with the letters PE according to IEC 60445 (or marked with symbol IEC 60417-5019:2006-08). No other terminals shall be so marked.

## 6.2 Suffixes

### 6.2.1 Winding elements

The ends of each winding element are distinguished by a numerical suffix, in accordance with IEC 60445, as follows (see Figure 5):

- 1 and 2 for the first winding element (see Figure 1),
- 3 and 4 for the second winding element,
- 5 and 6 for the third winding element,
- 7 and 8 for the fourth winding element.

In all winding elements, the end closer to the supply connection shall be marked with the lower of the two numbers.

### 6.2.2 Internal connections

When several ends of winding elements are joined, the terminal marking shall use the lower suffix; see Figure 8.

### 6.2.3 Tapping points

Tapping points of a winding element shall be marked in the sequence in which they occur in the winding element, as follows (see Figure 6):

- 11, 12, 13, etc. for the first winding element,
- 31, 32, 33, etc. for the second winding element,
- 51, 52, 53, etc. for the third winding element,
- 71, 72, 73, etc. for the fourth winding element.

The tap closest to the beginning of the winding shall be marked with the lowest suffix.

## 6.3 Prefixes

Winding elements that are separate (or belong to different current systems), but have a similar, but independent, function, shall be marked with the same letter, but distinguished by a numerical prefix.

Each of the terminals shall be marked with a numerical prefix corresponding to the separate winding (or current system) to which it belongs, as follows (see Figure 7):

|                |   |
|----------------|---|
| first winding  | 1 |
| second winding | 2 |
| third winding  | 3 |
| fourth winding | 4 |
| and so on...   |   |

With multi-speed machines, the sequence of the prefixes corresponds to the sequence of increasing speeds. See Figure A.19.

## 6.4 Winding identification for categories of machines

### 6.4.1 Three-phase machines

The letter symbols shall be U, V, and W for the first, second and third primary winding phase respectively and N when a neutral conductor is used (see Figure 3) and K, L, and M and Q when a secondary winding is used. See Figure 11.

### 6.4.2 Two-phase machines

The terminal markings of a two-phase machine shall be derived from the markings for three-phase machines, with the letter symbols W and M omitted.

### 6.4.3 Single-phase machines

The letter symbols assigned shall be U for the primary winding and Z for the auxiliary winding. See Figure 12.

If the winding ends of a main and an auxiliary winding are connected to a common terminal, the terminal shall be marked according to the rule for the main phase.

#### **6.4.4 Multiple three-phase group (for example, six-phase) machines**

Each phase group shall be differentiated by a prefix according to 6.3. See Figure 15.

The numerical order of the prefix shall increase according to the order in which the U phase of each phase group reaches its maximum.

#### **6.5 Field winding of synchronous machines**

Terminal markings of the d.c. separately excited field windings shall be F1 and F2.

#### **6.6 DC machines**

The letter symbols assigned to winding elements shall be as listed in 4.2 with terminal markings as shown in Figures 16 to 24.

#### **6.7 Relation between terminal markings and direction of rotation**

##### **6.7.1 Multi-phase machines**

The terminal markings shall be so arranged that clockwise rotation is obtained when the alphabetical sequence of the letters (for example, U1, V1, W1) corresponds to the time sequence of the system phase voltages. The phase sequence of a secondary winding (for example, K, L, M) shall correspond to the phase sequence of the primary winding (for example, U, V, W).

For counter-clockwise rotation, the time sequence of the system phase voltages shall be reversed by rearrangement of the supply cables (for example, L2 and L3 in the case of 3-phase).

The requirement in this clause applies to machines of any rated output and voltage even if clockwise rotation is impracticable.

When machines are suitable for operation in only one direction of rotation, an arrow shall indicate the direction of rotation. This arrow need not be on the rating plate, but it shall be permanently attached and easily visible.

##### **6.7.2 Multi-phase, multi-speed machines**

With multi-speed machines incorporating a pole-changing winding, such as a Dahlander or PAM (pole-amplitude-modulated) winding, the markings of the terminals for the lower speed of these winding(s), which are to be connected to the supply (for example, 1U and 1W) shall be interchanged, when necessary, in order to obtain the same direction of rotation for both speeds.

##### **6.7.3 Single-phase machines**

Clockwise rotation shall be obtained when the supply is connected to U1 and U2 and the auxiliary winding is connected as Z1 with U1 and Z2 with U2. To reverse the direction of rotation, terminals Z1 shall be connected to U2 and Z2 to U1.

#### 6.7.4 Multiple three-phase group (for example, six-phase) machines

The terminal markings shall be so arranged that clockwise rotation is obtained when the alphabetical sequence of the letters in each phase group corresponds to the time sequence of the system phase voltages connected to this group. The order of prefixes of the groups corresponds to the sequence in which the first phase of each phase group reaches its maximum value.

For counter-clockwise rotation, the time sequence of the system phase voltages shall be reversed by the rearrangement of the supply cables within each group and by reversing the order of connecting the groups of the supply voltages to the phase groups of the windings.

#### 6.7.5 DC machines

The terminal markings shall be so arranged that clockwise rotation is obtained when the line polarities L+ and L– correspond to the polarities of the terminals A1 and A2. When the machine is provided with a separately-excited field winding, the terminal markings shall be so arranged that clockwise rotation is obtained when the line polarities L+ and L– correspond to the polarities of both the terminals A1 and A2 and the terminals F1 and F2.

For counter-clockwise rotation, the polarity of the supply connection to either the armature or the field shall be reversed taking into account 6.7.6.

#### 6.7.6 Relation between direction of current and magnetic field (d.c. machines)


**6.7.6.1** Two excitation windings generate fields having the same direction if the excitation current in both windings flows from the terminal with the lower (higher) numerical suffix to the terminal with the higher (lower) suffix.

**6.7.6.2** The magnetic fields of commutating and compensating windings shall be of correct polarity with respect to each other and to the magnetic field of the armature winding if, in all the windings, current flows from the terminal with the lower (higher) numerical suffix to the terminal with the higher (lower) suffix.


### 6.8 Terminal marking figures

Connection diagrams for common applications are shown in Annex A.


#### 6.8.1 Three-phase asynchronous machines

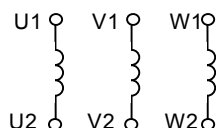


**Figure 1 – Single three-phase winding, three elements, open connection, six terminals**

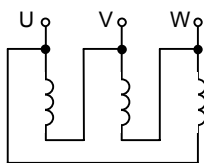


**Figure 2 – Single three-phase winding, delta connection, three terminals**

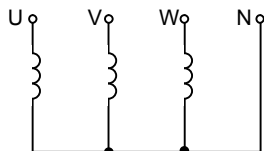


**Figure 3 – Single three-phase winding, internal star connection with neutral conductor, four terminals**

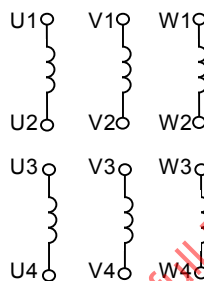


**Figure 4 – Single three-phase winding, two elements per phase, open connection, twelve terminals**

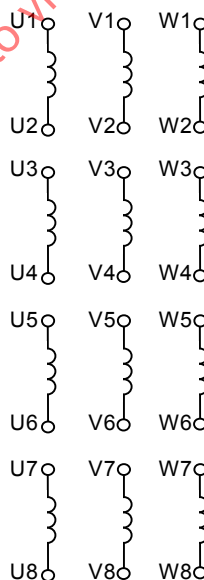


**Figure 5 – Single three-phase winding, four elements per phase, open connection, twenty-four terminals**

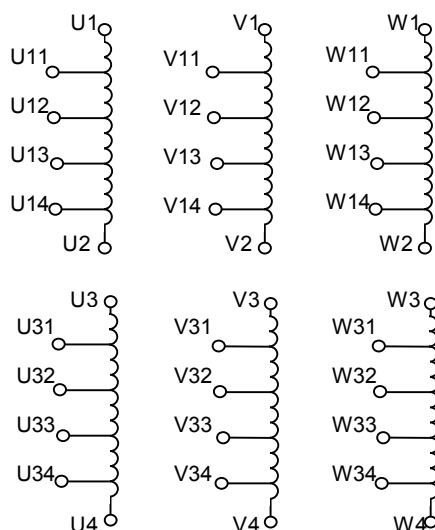


**Figure 6 – Single three-phase winding, two elements per phase with four tapping points per element, open connection, thirty-six terminals**

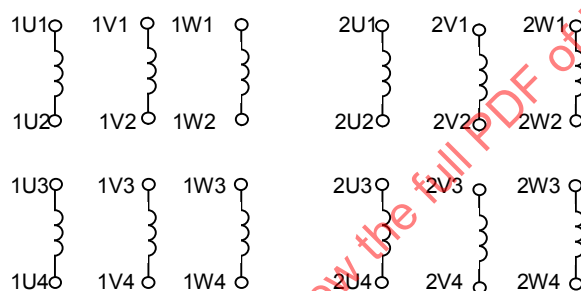


**Figure 7 – Two separate three-phase windings with two independent functions, two elements per phase, open connection, twenty-four terminals**




**Figure 8 – Two elements, internal connection, three terminals**

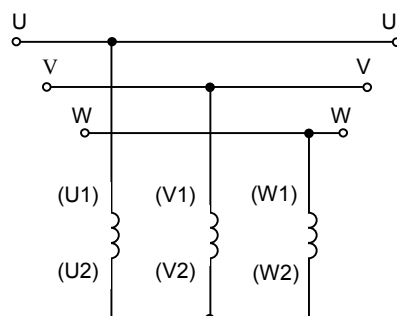

**Figure 9 – Single three-phase winding, star connection, duplicate terminals for alternate connection, six terminals**

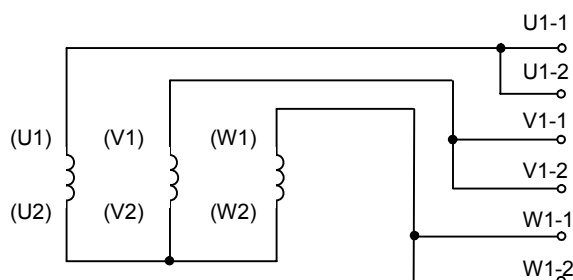

**Figure 10 – Single three-phase winding, star connection, parallel terminals for shared current, six terminals**

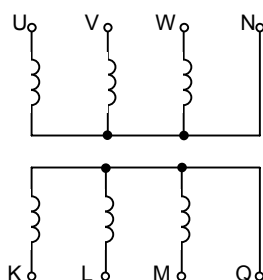


**Figure 11 – Three-phase wound-rotor, star connections with neutral conductors, eight terminals**


## 6.8.2 Single-phase asynchronous machines



**Figure 12 – Main and auxiliary winding, two elements**




**Figure 13 – Single-phase auxiliary winding, integrally connected capacitor, one element**



**Figure 14 – Single-phase main winding, integrally connected thermal protector, one element**

## 6.8.3 Multiple three-phase group (six-phase) machines

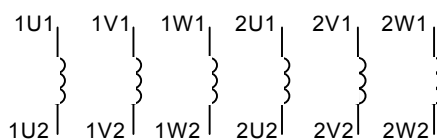

**Figure 15 – Six-phase winding, open connection, six elements**

## 6.8.4 DC machines




Figure 16 – Armature winding, one element




Figure 17 – Commutating winding, one and two elements




Figure 18 – Compensating winding, one and two elements




Figure 19 – Series winding, one element, two tappings



Figure 20 – Shunt excitation winding, one element




Figure 21 – Separately excited excitation winding, one and two elements



Figure 22 – Direct-axis auxiliary winding, one element



Figure 23 – Quadrature-axis auxiliary winding, one element




Figure 24 – Armature winding with commutating and compensating windings, one element

## 7 Auxiliary terminal marking rules

### 7.1 General

The marking of auxiliary terminals shall be according to 6.1.3, with 4.4 identifying the type of auxiliary device together with:

- a numerical prefix identifying the individual circuit or device;
- a numerical suffix identifying the lead function.

The addition of letters and/or numbers to the auxiliary symbol shall, wherever possible, be based on the rules given in Clause 6.

When there is a large number of terminals for a given type of device (for example, thermocouples), the leads may be grouped by device code and the terminals identified by a prefix (1-99) and followed by a single digit suffix (1-9).

The manufacturer should identify the function of these devices in the written instructions.

When only one device of a certain type exists, the prefix may be omitted.

### 7.2 Marking

#### 7.2.1 Power-related devices

Devices BA, BD, BW, CA, HE, LA, SC and SP shall be marked and connected in accordance with 7.2.1.1 to 7.2.1.4 where:

\*\* indicates the device coding and  represents the device.

NOTE This symbol should be changed according to IEC 60617 for schematic diagrams.

##### 7.2.1.1 Single-phase, single voltage


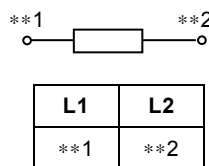


Figure 25 – Single-phase, single voltage

##### 7.2.1.2 Single-phase, dual voltage



| Voltage | L1  | L2  | Join       | Isolate |
|---------|-----|-----|------------|---------|
| High    | **1 | **4 | -          | **2     |
| Low     | **1 | **2 | [**1, **4] | -       |

Figure 26 – Single-phase dual voltage

7.2.1.3 Three-phase, single voltage

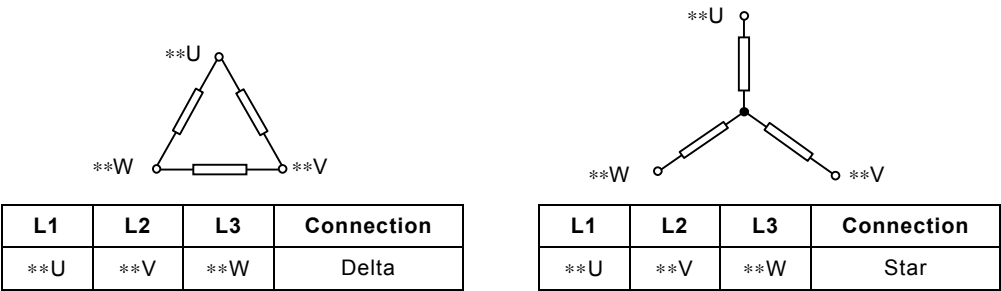


Figure 27 – Three-phase, single voltage

7.2.1.4 Three-phase, dual voltage

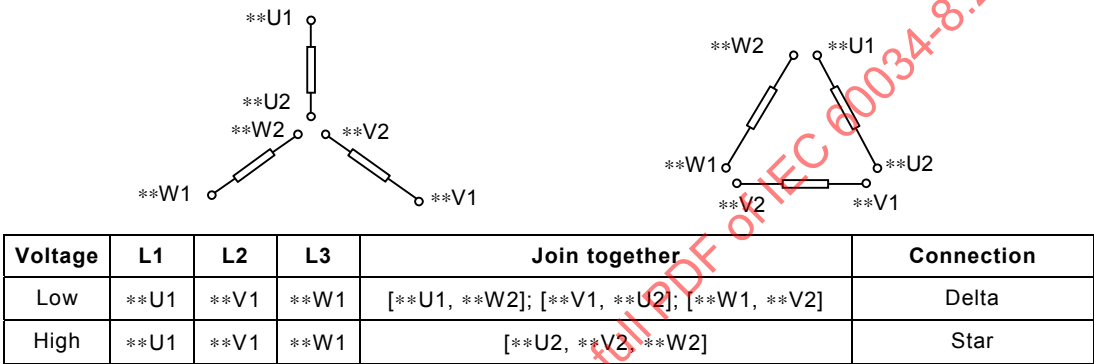


Figure 28 – Three-phase dual voltage

7.2.2 Thermal and measurement devices

Devices CT, PT, R, TB, TC, TN, TM and TP shall be marked and connected in accordance with 7.2.2.1 to 7.2.2.4 where:

\*\* indicates the device coding and  represents the device.

NOTE 1 For TC devices, the leads are colour coded by the manufacturer to denote polarity.

NOTE 2 For resistance thermometers, the last character indicates the circuit number.

NOTE 3 This symbol should be changed according to IEC 60617 for schematic diagrams.

7.2.2.1 Two-lead devices of types TB, TC, TM, TN and TP



Figure 29 – Two-lead devices (except type R)

L1 and L2 should be connected according to written instructions or lead colour identification.

7.2.2.2 Two-lead devices of type R



Figure 30 – Two-lead devices of type R

### 7.2.2.3 Three-lead devices of type R



Figure 31 – Three-lead devices of type R

### 7.2.2.4 Four-lead devices of type R



Figure 32 – Four-lead devices of type R

## 7.2.3 Switches

Switches shall be marked and connected as shown in Figure 33 where \* denotes the switch number.

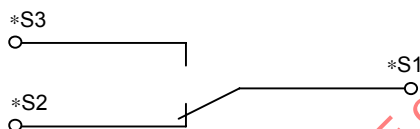


Figure 33 – Switch connections

IECNORM.COM : Click to view the full PDF of IEC 60034-8:2007

**Annex A**  
(normative)

**Connection diagrams for common applications**

**A.1 General**

Annex A provides connections for terminal markings that shall be used for common applications. The layout of figures is for information and may take other forms.


Applications not shown shall be derived from the rules of Clause 6.

NOTE Additions of other common applications may be made to this annex upon request.

**A.2 Three-phase machines**


**A.2.1 Single-speed stator windings**

**A.2.1.1 Single voltage**

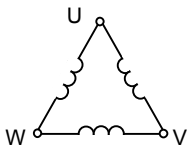

| L1 | L2 | L3 | Connection |
|----|----|----|------------|
| U  | V  | W  | Delta      |



**Figure A.1 – Delta connection**

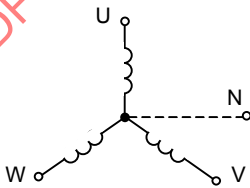

| L1 | L2 | L3 | Connection |
|----|----|----|------------|
| U  | V  | W  | Star       |


**Figure A.2 – Star connection – with or without neutral**

**A.2.1.2 Dual voltage**

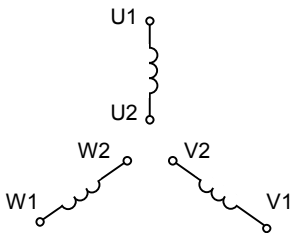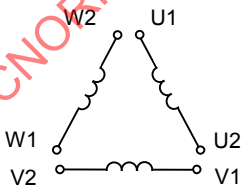


| Voltage | L1 | L2 | L3 | Join together                | Winding connection |
|---------|----|----|----|------------------------------|--------------------|
| Low     | U1 | V1 | W1 | [U1, W2]; [U2, V1]; [V2, W1] | Delta              |
| High    | U1 | V1 | W1 | [U2, V2, W2]                 | Star               |

**Figure A.3 – Dual voltage, six terminals ( $1:\sqrt{3}$ )**

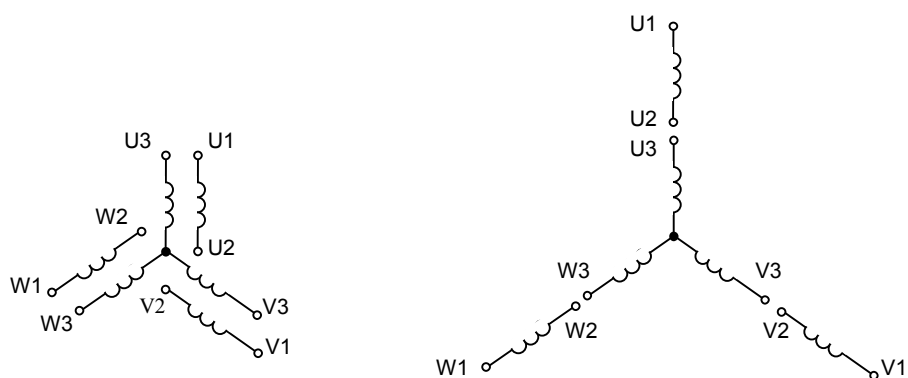

| Voltage | L1 | L2 | L3 | Join together                              | Winding connection |
|---------|----|----|----|--------------------------------------------|--------------------|
| Low     | U1 | V1 | W1 | [U1, U3]; [V1, V3]; [W1, W3]; [U2, V2, W2] | Parallel star      |
| High    | U1 | V1 | W1 | [U2, U3]; [V2, V3]; [W2, W3]               | Series star        |

Figure A.4 – Star-connected, dual voltage, nine terminals (1:2)

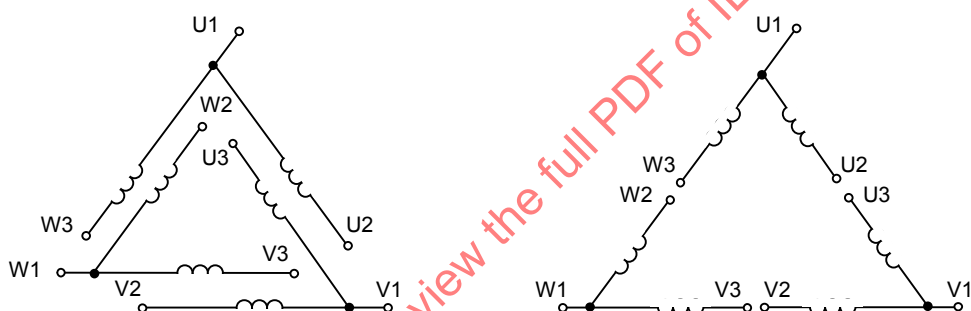

| Voltage | L1 | L2 | L3 | Join together                            | Winding connection |
|---------|----|----|----|------------------------------------------|--------------------|
| Low     | U1 | V1 | W1 | [U1, U3, W2]; [V1, V3, U2]; [W1, W3, V2] | Parallel delta     |
| High    | U1 | V1 | W1 | [U2, U3]; [V2, V3]; [W2, W3]             | Series delta       |


Figure A.5 – Delta-connected, dual voltage, nine terminals (1:2)

### A.2.1.3 Starting windings



|       | L1 | L2 | L3 | Join together                | Winding connection |
|-------|----|----|----|------------------------------|--------------------|
| Start | U1 | V1 | W1 | [U2, V2, W2]                 | Star               |
| Run   | U1 | V1 | W1 | [U1, W2]; [V1, U2]; [W1, V2] | Delta              |

Figure A.6 – Star-delta, single voltage, six terminals

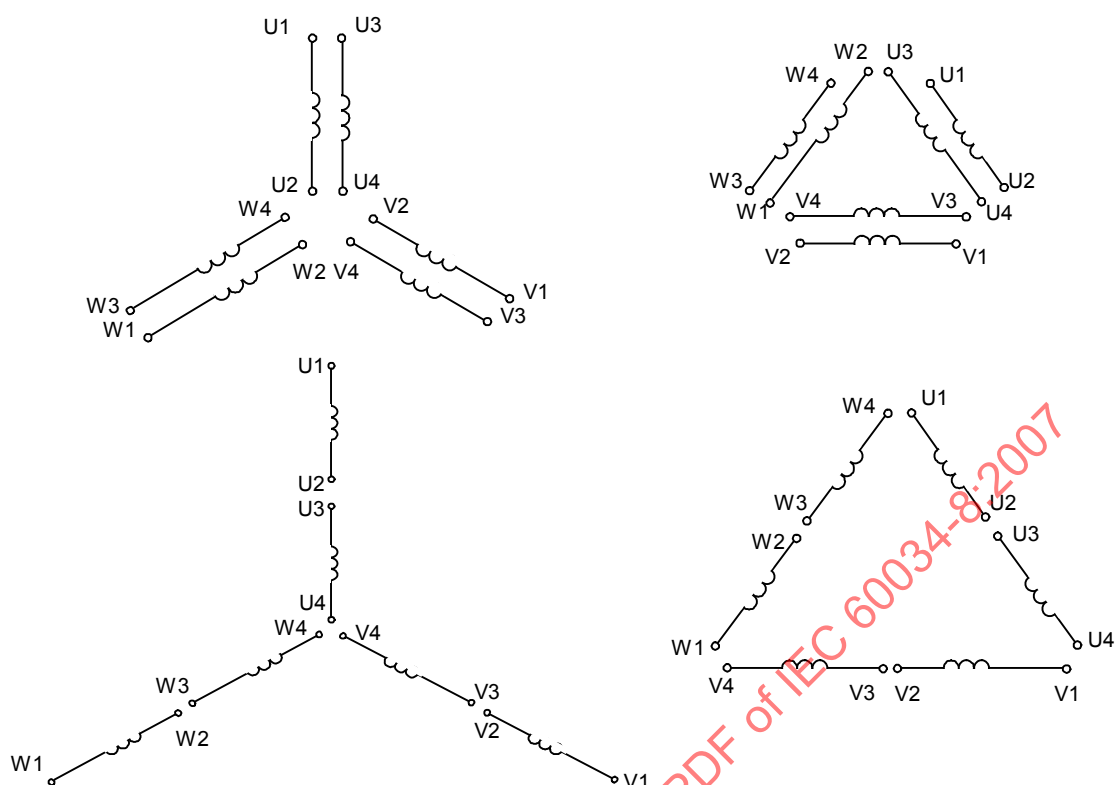

| Voltage |       | L1 | L2 | L3 | Join together                                                 | Winding connection |
|---------|-------|----|----|----|---------------------------------------------------------------|--------------------|
| Low     | Start | U1 | V1 | W1 | [U1, U3]; [V1, V3]; [W1, W3];<br>[U2, V2, W2]; [U4, V4, W4]   | Parallel star      |
| Low     | Run   | U1 | V1 | W1 | [U1, W2, U3, W4];<br>[V1, U2, V3, U4];<br>[W1, V2, W3, V4]    | Parallel delta     |
| High    | Start | U1 | V1 | W1 | [U2, U3]; [V2, V3];<br>[W2, W3]; [U4, V4, W4]                 | Series star        |
| High    | Run   | U1 | V1 | W1 | [U1, W4]; [V1, U4]; [W1, V4];<br>[U2, U3]; [V2, V3]; [W2, W3] | Series delta       |

Figure A.7 – Star-delta, dual voltage, twelve terminals (1:2)

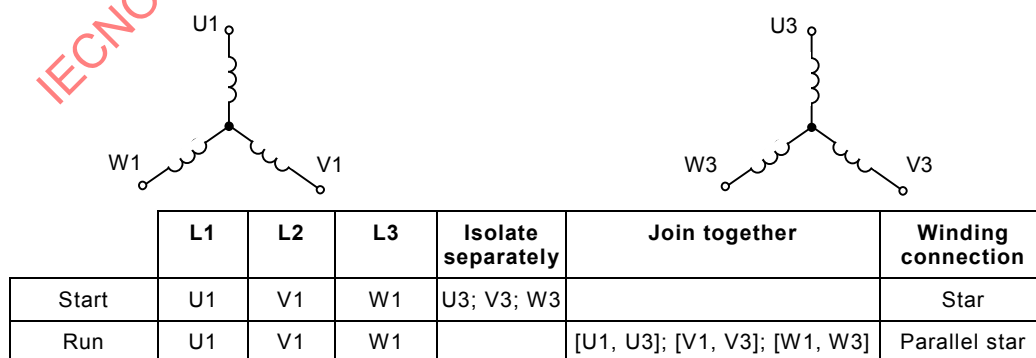


Figure A.8 – Part-winding, single voltage, six terminals

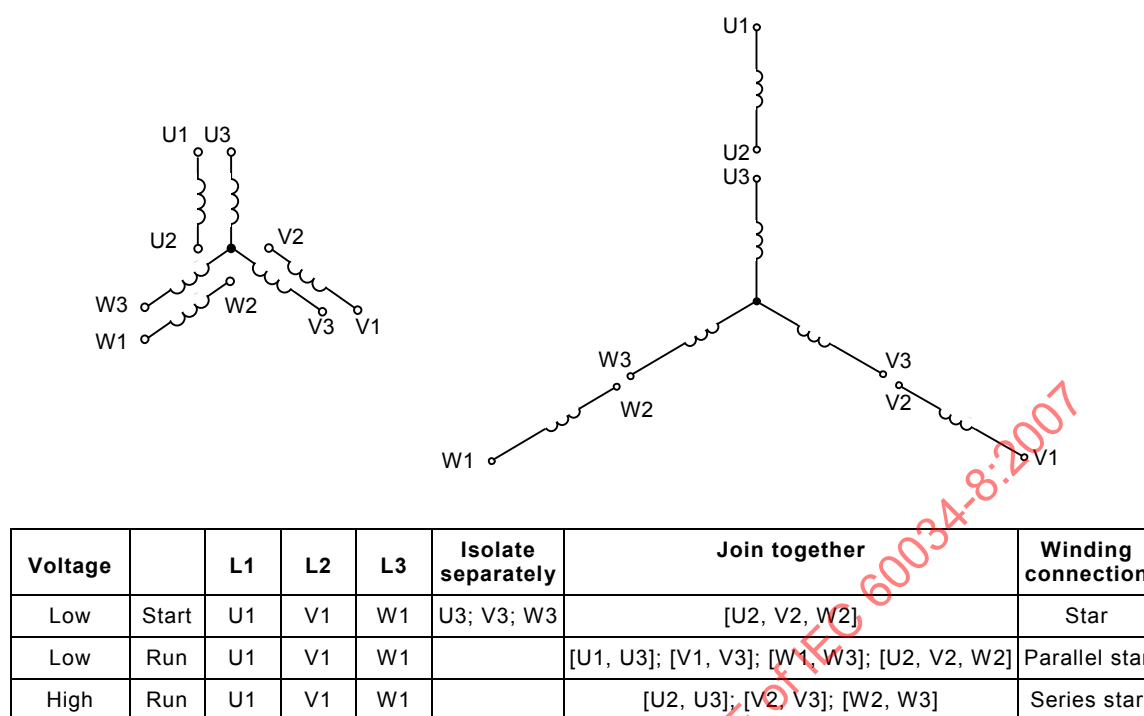


Figure A.9 – Part-winding, dual voltage, nine terminals (1:2)

## A.2.2 Multi-speed stator windings

### A.2.2.1 Two-speed (1:2), single-winding


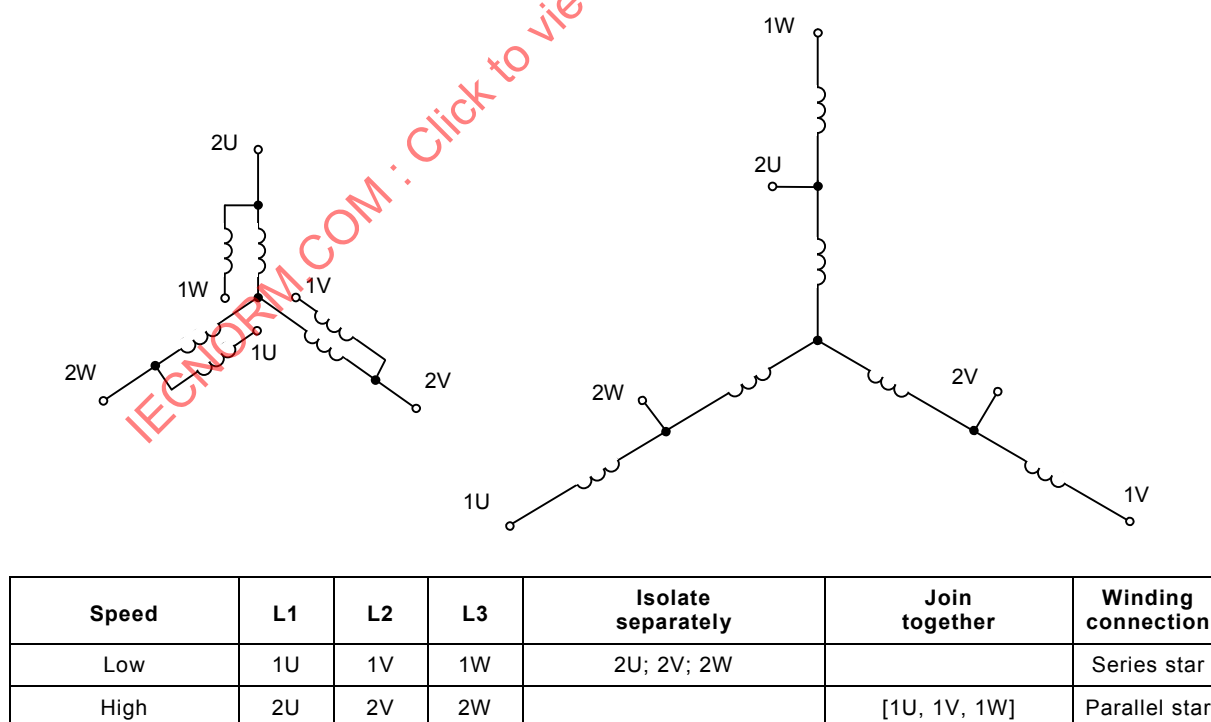


Figure A.10 – Variable-torque, six terminals

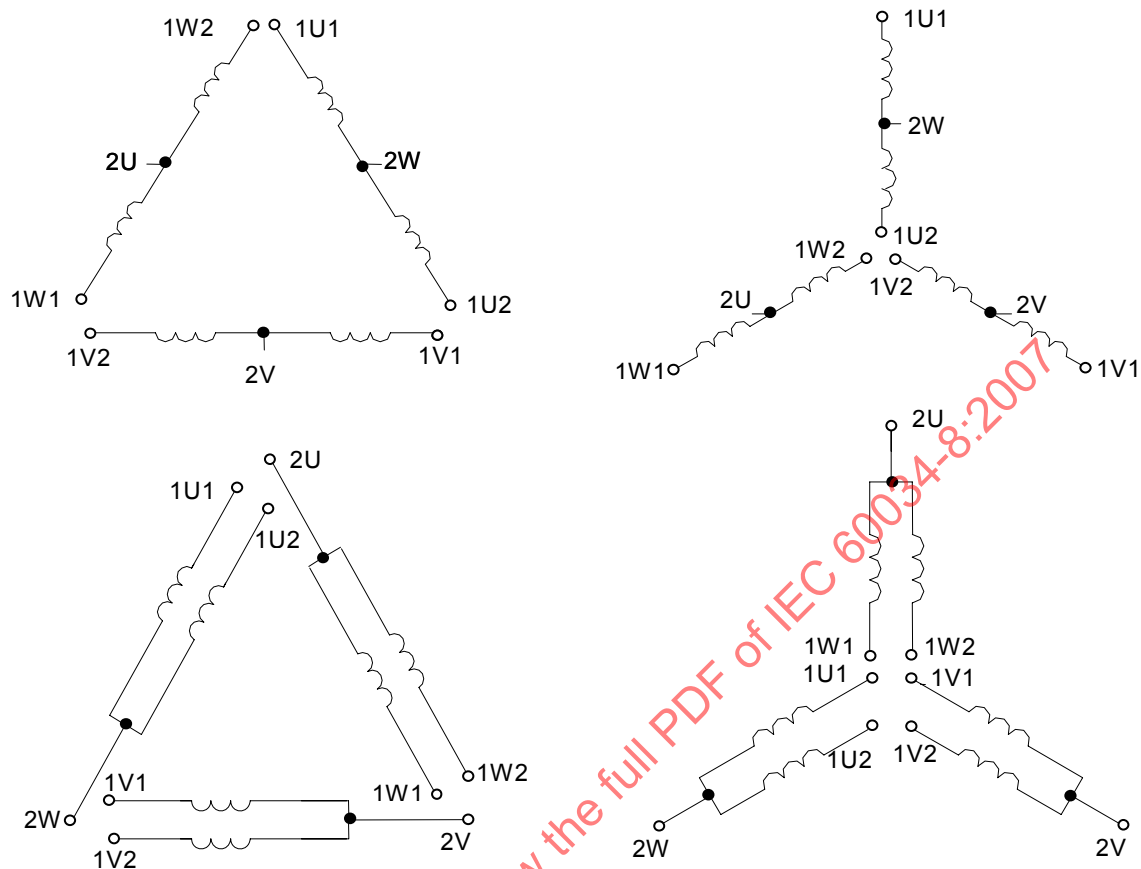

| Speed | L1  | L2  | L3  | Isolate separately | Join together                                  | Winding connection |
|-------|-----|-----|-----|--------------------|------------------------------------------------|--------------------|
| Low   | 1U1 | 1V1 | 1W1 | 2U; 2V; 2W         | [1U1, 1W2]; [1V1, 1U2]; [1W1, 1V2]             | Series delta       |
| Low   | 1U1 | 1V1 | 1W1 | 2U; 2V; 2W         | [1U2, 1V2, 1W2]                                | Series star        |
| High  | 2U  | 2V  | 2W  |                    | [2U, 1U1, 1U2]; [2V, 1W1, 1W2]; [2W, 1V1, 1V2] | Parallel delta     |
| High  | 2U  | 2V  | 2W  |                    | [1U1, 1V1, 1W1, 1U2, 1V2, 1W2]                 | Parallel star      |

**Figure A.11 – Variable-torque, dual-voltage ( $1:\sqrt{3}$ ), nine terminals**

This connection diagram is also applicable for star-delta starting on the low speed by omitting the high-speed, parallel-delta connection.

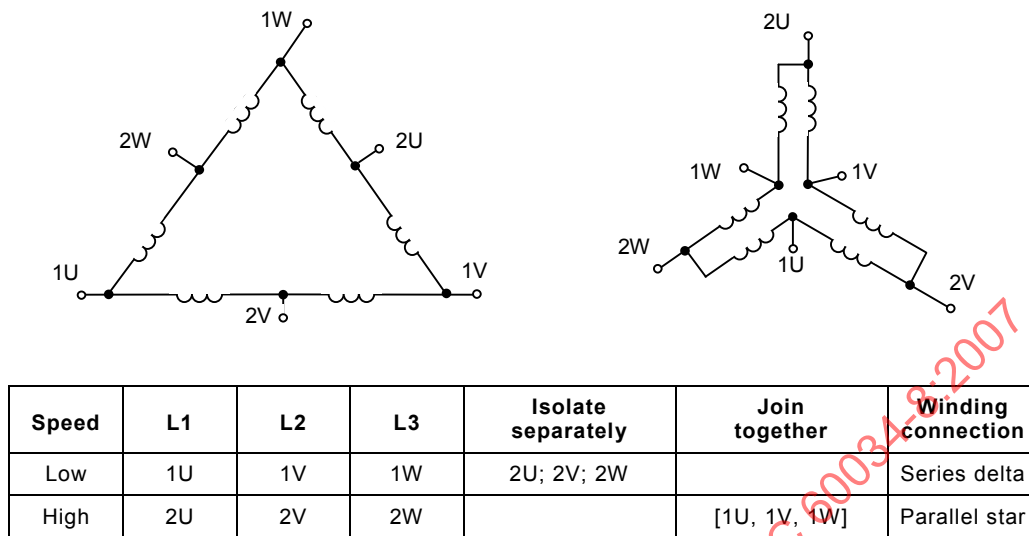


Figure A.12 – Constant-torque, six terminals

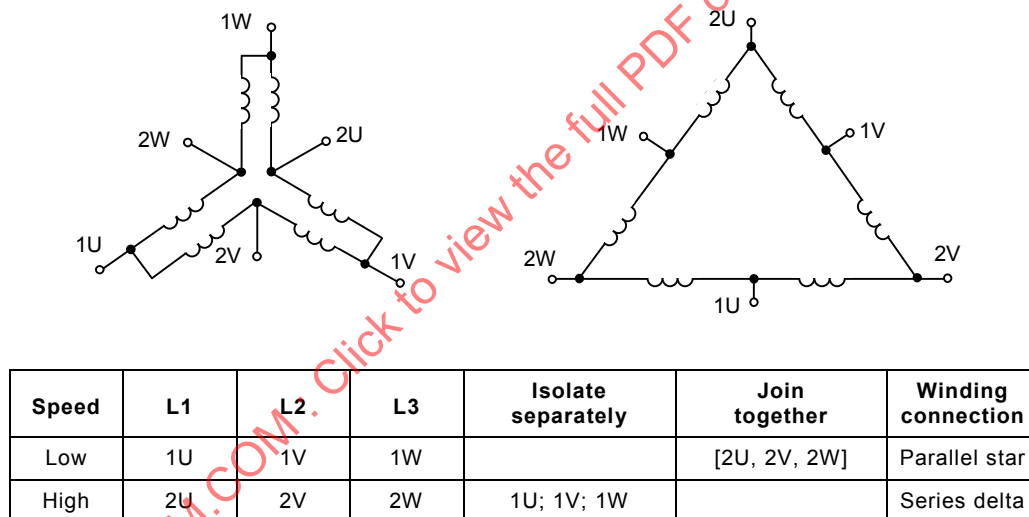


Figure A.13 – Constant power, six terminals

#### A.2.2.2 Multi-speed, with two or more independent windings


Figures A.10, A.11, A.12 and A.13 are generally utilized as one of the windings in a three or four speed motor.

Many motor designs do not produce circulating currents. In these cases, the motor manufacturer will permanently join terminals (1W-1, 1W-2) and (2W-1, 2W-2) in Figures A.15 and A.16, respectively, and delete the -1 and -2 suffixes.



| Speed | L1 | L2 | L3 | Isolate separately | Winding connection |
|-------|----|----|----|--------------------|--------------------|
| Low   | 1U | 1V | 1W | 2U; 2V; 2W         | Star               |
| High  | 2U | 2V | 2W | 1U; 1V; 1W         | Star               |

Figure A.14 – Variable-torque, six terminals

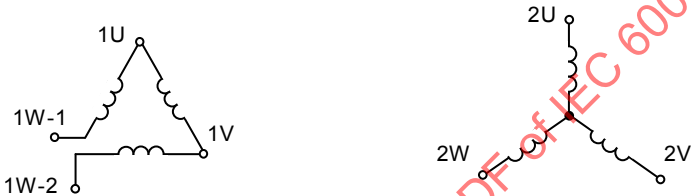

| Speed | L1 | L2 | L3           | Isolate separately | Winding connection |
|-------|----|----|--------------|--------------------|--------------------|
| Low   | 1U | 1V | [1W-1, 1W-2] | 2U; 2V; 2W         | Open delta         |
| High  | 2U | 2V | 2W           | 1U; 1V; 1W-1; 1W-2 | Star               |

Figure A.15 – Constant-torque, seven terminals




| Speed | L1 | L2 | L3           | Isolate separately | Winding connection |
|-------|----|----|--------------|--------------------|--------------------|
| Low   | 1U | 1V | 1W           | 2U; 2V; 2W-1; 2W-2 | Star               |
| High  | 2U | 2V | [2W-1, 2W-2] | 1U; 1V; 1W         | Open delta         |

Figure A.16 – Constant-power, seven terminals


### A.2.2.3 Three-speed

Combinations of windings shall be selected from Figures A.1, A.2, A.10, A.11, A.12 and A.13 and the prefixes then adjusted.

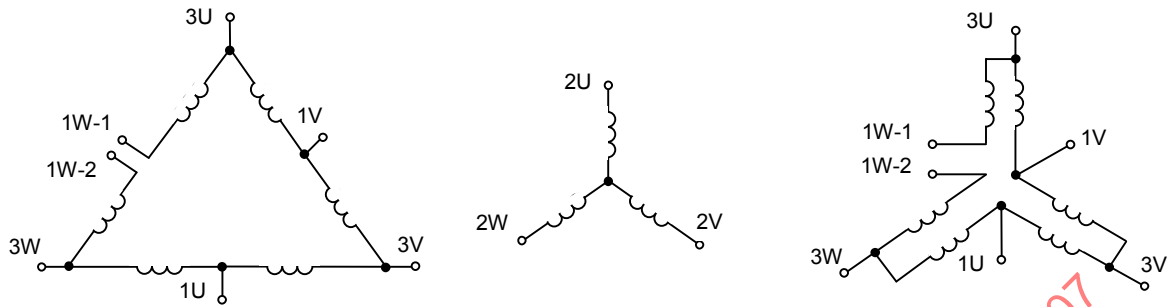

| Speed  | L1 | L2 | L3   | Isolate separately             | Join together        | Winding connection |
|--------|----|----|------|--------------------------------|----------------------|--------------------|
| Low    | 1U | 1V | 1W-1 | 2U; 2V; 2W; 3U; 3V; 3W         | [1W-1, 1W-2]         | Open series delta  |
| Middle | 2U | 2V | 2W   | 1W-1; 1W-2; 1V; 1U; 3U; 3V; 3W |                      | Star               |
| High   | 3U | 3V | 3W   | 2U; 2V; 2W                     | [1W-1, 1W-2, 1V, 1U] | Open parallel star |

Figure A.17 – Example of three-speed, constant torque motor using two separate windings, ten terminals

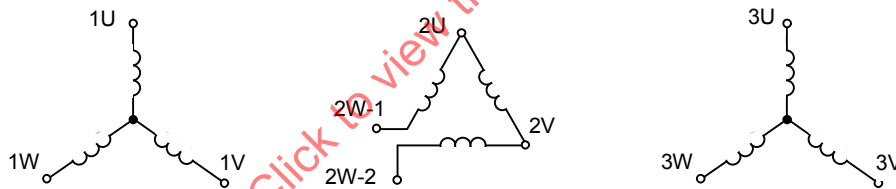


| Speed  | L1 | L2 | L3   | Isolate separately             | Join together | Winding connection |
|--------|----|----|------|--------------------------------|---------------|--------------------|
| Low    | 1U | 1V | 1W   | 2U; 2V; 2W-1; 2W-2; 3U; 3V; 3W | ---           | Star               |
| Middle | 2U | 2V | 2W-1 | 1U; 1V; 1W; 3U; 3V; 3W         | [2W-1, 2W-2]  | Open delta         |
| High   | 3U | 3V | 3W   | 1U; 1V; 1W; 2U; 2V; 2W-1; 2W-2 | ---           | Star               |

Figure A.18 – Example of three-speed motor using three separate windings, ten terminals

#### A.2.2.4 Four-speed

Combinations of windings shall be selected from Figures A.1, A.2, A.10, A.11, A.12 and A.13 and the prefixes adjusted.

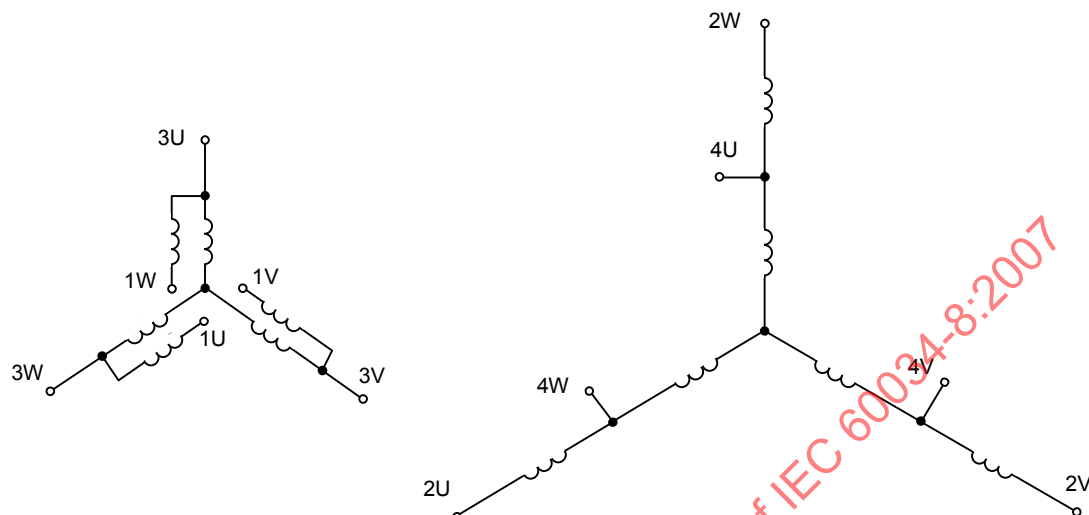


| Speed  | L1 | L2 | L3 | Isolate separately                 | Join together | Winding connection |
|--------|----|----|----|------------------------------------|---------------|--------------------|
| Low    | 1U | 1V | 1W | 2U; 2V; 2W; 3U; 3V; 3W; 4U; 4V; 4W | ---           | Series star        |
| Second | 2U | 2V | 2W | 1U; 1V; 1W; 3U; 3V; 3W; 4U; 4V; 4W | ---           | Series star        |
| Third  | 3U | 3V | 3W | 2U; 2V; 2W; 4U; 4V; 4W             | [1U, 1V, 1W]  | Parallel star      |
| High   | 4U | 4V | 4W | 1U; 1V; 1W; 3U; 3V; 3W             | [2U, 2V, 2W]  | Parallel star      |

**Figure A.19 – Example of four-speed, variable-torque motor using two separate windings, twelve terminals**


### A.3 Single-phase asynchronous machines

The terminal markings of single-phase, single voltage motor windings shall be as follows.

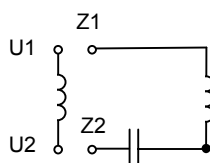

| Direction of Rotation | L1 | L2 | Join together      |
|-----------------------|----|----|--------------------|
| Clockwise             | U1 | U2 | [U1, Z1]; [U2, Z2] |
| Counter-clockwise     | U1 | U2 | [U1, Z2]; [U2, Z1] |


**Figure A.20 – Split-phase or capacitor-start reversible motor**

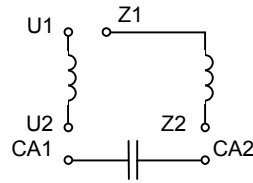

| Direction of Rotation | L1 | L2 | Join together                  |
|-----------------------|----|----|--------------------------------|
| Clockwise             | U1 | U2 | [U1, Z1]; [U2, CA1]; [CA2, Z2] |
| Counter-clockwise     | U1 | U2 | [U2, Z1]; [U1, CA1]; [CA2, Z2] |


**Figure A.21 – Reversible capacitor-start motor with four terminals with externally connected capacitor**

#### A.4 DC machines

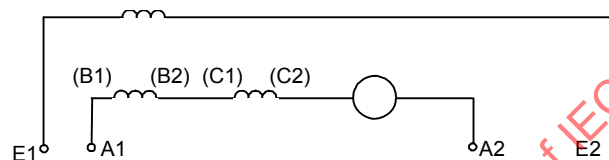

| Direction of Rotation | L+       | L–       |
|-----------------------|----------|----------|
| Clockwise             | [E1, A1] | [E2, A2] |
| Counter-clockwise     | [E1, A2] | [E2, A1] |


**Figure A.22 – Shunt motor or generator, four terminals**

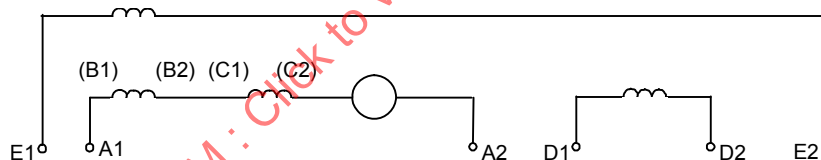

| Direction of rotation | L+       | L–       | Join together |
|-----------------------|----------|----------|---------------|
| Clockwise             | [E1, A1] | [E2, D2] | [A2, D1]      |
| Counter-clockwise     | [E1, A2] | [E2, D2] | [A1, D1]      |

**Figure A.23 – Compound-motor or generator with compensating and commutating windings, six terminals**

NOTE The proposed connection results in a compounding condition which will strengthen the magnetic field during motor operation and will weaken it during generator operation. If the opposite effect is desired, the connection of terminals D1 and D2 should change their positions.



| Direction of rotation | L+ | L– |
|-----------------------|----|----|
| Clockwise             | A1 | A2 |
| Clockwise             | A2 | A1 |

**Figure A.24 – Series-wound motor, two terminals**

In Figure A.24, the direction of rotation is independent of the polarity of A1 and A2. An arrow on the enclosure shall always be used to indicate the direction of rotation.

NOTE Clockwise rotation is shown in Figure A.24. Counter-clockwise rotation can only be achieved by the motor manufacturer changing the internal connection (that is, by reversing the series-winding connecting points (D1) and (D2) and then marking (D1) as A2).

IECNORM.COM : Click to view the full PDF of IEC 60034-8:2007

## SOMMAIRE

|                                                                                                                                                                  |    |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------|----|
| AVANT-PROPOS .....                                                                                                                                               | 37 |
| INTRODUCTION .....                                                                                                                                               | 39 |
| 1 Domaine d'application .....                                                                                                                                    | 40 |
| 2 Références normatives .....                                                                                                                                    | 40 |
| 3 Termes et définitions .....                                                                                                                                    | 40 |
| 4 Symboles .....                                                                                                                                                 | 42 |
| 4.1 Généralités .....                                                                                                                                            | 42 |
| 4.2 Machines monophasées à courant continu avec collecteur .....                                                                                                 | 42 |
| 4.3 Machines à courant alternatif sans collecteur .....                                                                                                          | 42 |
| 4.4 Appareils auxiliaires .....                                                                                                                                  | 43 |
| 5 Sens de rotation .....                                                                                                                                         | 43 |
| 6 Règles pour le marquage des extrémités .....                                                                                                                   | 43 |
| 6.1 Généralités .....                                                                                                                                            | 43 |
| 6.2 Suffixes .....                                                                                                                                               | 44 |
| 6.3 Préfixes .....                                                                                                                                               | 45 |
| 6.4 Identification d'enroulement pour les catégories de machines .....                                                                                           | 45 |
| 6.5 Enroulement de champ des machines synchrones .....                                                                                                           | 46 |
| 6.6 Machines à courant continu .....                                                                                                                             | 46 |
| 6.7 Relation entre les marquages d'extrémité et le sens de rotation .....                                                                                        | 46 |
| 6.8 Chiffres pour le marquage des extrémités .....                                                                                                               | 47 |
| 7 Règles de marquage d'extrémités auxiliaires .....                                                                                                              | 52 |
| 7.1 Généralités .....                                                                                                                                            | 52 |
| 7.2 Marquage .....                                                                                                                                               | 52 |
| Annexe A (normative) Schémas de connexion pour applications communes .....                                                                                       | 55 |
| Figure 1 – Enroulement unique triphasé, trois éléments, connexion ouverte, six extrémités .....                                                                  | 47 |
| Figure 2 – Enroulement unique triphasé, connexion en triangle, trois extrémités .....                                                                            | 48 |
| Figure 3 – Enroulement unique triphasé, connexion en étoile interne avec conducteur neutre, quatre extrémités .....                                              | 48 |
| Figure 4 – Enroulement unique triphasé, deux éléments par phase, connexion ouverte, douze extrémités .....                                                       | 48 |
| Figure 5 – Enroulement unique triphasé, quatre éléments par phase, connexion ouverte, vingt-quatre extrémités .....                                              | 48 |
| Figure 6 – Enroulement unique triphasé, deux éléments par phase avec quatre points de prises par élément, connexion ouverte, trente-six extrémités .....         | 49 |
| Figure 7 – Deux enroulements triphasés indépendants avec deux fonctions indépendantes, deux éléments par phase, connexion ouverte, vingt-quatre extrémités ..... | 49 |
| Figure 8 – Deux éléments, connexion interne, trois extrémités .....                                                                                              | 49 |
| Figure 9 – Enroulement unique triphasé, connexion en étoile, extrémités doublées pour connexion alternée, six extrémités .....                                   | 49 |
| Figure 10 – Enroulement unique triphasé, connexion en étoile, extrémités parallèles pour courant partagé, six extrémités .....                                   | 50 |

|                                                                                                          |    |
|----------------------------------------------------------------------------------------------------------|----|
| Figure 11 – Rotor bobiné triphasé, connexions en étoile avec conducteurs neutres, huit extrémités .....  | 50 |
| Figure 12 – Enroulement principal et auxiliaire, deux éléments .....                                     | 50 |
| Figure 13 – Enroulement auxiliaire monophasé, condensateur complètement connecté, un élément.....        | 50 |
| Figure 14 – Enroulement principal monophasé, protecteur thermique complètement connecté, un élément..... | 50 |
| Figure 15 – Enroulement six phases, connexion ouverte, six éléments .....                                | 50 |
| Figure 16 – Enroulement d'induit, un élément .....                                                       | 51 |
| Figure 17 – Enroulement de commutation, un et deux éléments.....                                         | 51 |
| Figure 18 – Enroulement de compensation, un et deux éléments.....                                        | 51 |
| Figure 19 – Enroulement de série, un élément, deux prises .....                                          | 51 |
| Figure 20 – Enroulement d'excitation en parallèle, un élément.....                                       | 51 |
| Figure 21 – Enroulement d'excitation excité séparément, un et deux éléments .....                        | 51 |
| Figure 22 – Enroulement auxiliaire longitudinal, un élément.....                                         | 51 |
| Figure 23 – Enroulement auxiliaire transversal, un élément .....                                         | 51 |
| Figure 24 – Enroulement d'induit avec enroulements de commutation et de compensation, un élément .....   | 51 |
| Figure 25 – Monophasé, tension unique.....                                                               | 52 |
| Figure 26 – Monophasé, deux tensions.....                                                                | 52 |
| Figure 27 – Triphasé, tension unique .....                                                               | 53 |
| Figure 28 – Triphasé, deux tensions .....                                                                | 53 |
| Figure 29 – Appareils à deux conducteurs (à l'exception du type R).....                                  | 53 |
| Figure 30 – Appareils à deux conducteurs de type R .....                                                 | 53 |
| Figure 31 – Appareils à trois conducteurs de type R .....                                                | 54 |
| Figure 32 – Appareils à quatre conducteurs de type R .....                                               | 54 |
| Figure 33 – Connexions d'interrupteur .....                                                              | 54 |
| Figure A.1 – Connexion triangle.....                                                                     | 55 |
| Figure A.2 – Connexion étoile – avec ou sans neutre.....                                                 | 55 |
| Figure A.3 – Deux tensions, six extrémités ( $1:\sqrt{3}$ ) .....                                        | 55 |
| Figure A.4 – Couplage en étoile, deux tensions, neuf extrémités ( $1:2$ ) .....                          | 56 |
| Figure A.5 – Couplage en triangle, deux tensions, neuf extrémités ( $1:2$ ) .....                        | 56 |
| Figure A.6 – Etoile-triangle, tension unique, six extrémités .....                                       | 56 |
| Figure A.7 – Etoile-triangle, deux tensions, douze extrémités ( $1:2$ ) .....                            | 57 |
| Figure A.8 – Enroulement partiel, tension unique, six extrémités .....                                   | 57 |
| Figure A.9 – Enroulement partiel, deux tensions, neuf extrémités ( $1:2$ ).....                          | 58 |
| Figure A.10 – Couple variable, six extrémités .....                                                      | 58 |
| Figure A.11 – Couple variable, bitension ( $1:\sqrt{3}$ ), neuf extrémités.....                          | 59 |
| Figure A.12 – Couple constant, six extrémités .....                                                      | 60 |
| Figure A.13 – Puissance constante, six extrémités .....                                                  | 60 |
| Figure A.14 – Couple variable, six extrémités .....                                                      | 61 |
| Figure A.15 – Couple constant, sept extrémités .....                                                     | 61 |
| Figure A.16 – Puissance constante, sept extrémités .....                                                 | 61 |

|                                                                                                                                       |    |
|---------------------------------------------------------------------------------------------------------------------------------------|----|
| Figure A.17 – Exemple de moteur à trois vitesses, à couple constant utilisant deux enroulements séparés, dix extrémités .....         | 62 |
| Figure A.18 – Exemple de moteur à trois vitesses utilisant trois enroulements indépendants, dix extrémités .....                      | 62 |
| Figure A.19 – Exemple de moteur à quatre vitesses, couple variable utilisant deux enroulements indépendants, douze extrémités.....    | 63 |
| Figure A.20 – Moteur réversible à phase auxiliaire ou condensateur de démarrage .....                                                 | 63 |
| Figure A.21 – Moteur réversible à condensateur de démarrage avec quatre extrémités avec condensateur connecté de manière externe..... | 64 |
| Figure A.22 – Moteur en dérivation ou générateur, quatre extrémités .....                                                             | 64 |
| Figure A.23 – Moteur en dérivation ou générateur compound avec enroulements de série et de commutations, six extrémités .....         | 64 |
| Figure A.24 – Moteur bobiné en série, deux extrémités.....                                                                            | 65 |

IECNORM.COM : Click to view the full PDF of IEC 60034-8:2007

## COMMISSION ÉLECTROTECHNIQUE INTERNATIONALE

### MACHINES ÉLECTRIQUES TOURNANTES –

#### Partie 8: Marques d'extrémité et sens de rotation

##### AVANT-PROPOS

- 1) La Commission Electrotechnique Internationale (CEI) est une organisation mondiale de normalisation composée de l'ensemble des comités électrotechniques nationaux (Comités nationaux de la CEI). La CEI a pour objet de favoriser la coopération internationale pour toutes les questions de normalisation dans les domaines de l'électricité et de l'électronique. A cet effet, la CEI – entre autres activités – publie des Normes internationales, des Spécifications techniques, des Rapports techniques, des Spécifications accessibles au public (PAS) et des Guides (ci-après dénommés "Publication(s) de la CEI"). Leur élaboration est confiée à des comités d'études, aux travaux desquels tout Comité national intéressé par le sujet traité peut participer. Les organisations internationales, gouvernementales et non gouvernementales, en liaison avec la CEI, participent également aux travaux. La CEI collabore étroitement avec l'Organisation Internationale de Normalisation (ISO), selon des conditions fixées par accord entre les deux organisations.
- 2) Les décisions ou accords officiels de la CEI concernant les questions techniques représentent, dans la mesure du possible, un accord international sur les sujets étudiés, étant donné que les Comités nationaux intéressés sont représentés dans chaque comité d'études.
- 3) Les Publications de la CEI se présentent sous la forme de recommandations internationales et sont agréées comme telles par les Comités nationaux de la CEI. Tous les efforts raisonnables sont entrepris afin que la CEI s'assure de l'exactitude du contenu technique de ses publications; la CEI ne peut pas être tenue responsable de l'éventuelle mauvaise utilisation ou interprétation qui en est faite par un quelconque utilisateur final.
- 4) Dans le but d'encourager l'unification internationale, les Comités nationaux de la CEI s'engagent à appliquer de façon transparente, dans toute la mesure possible, les normes internationales de la CEI dans leurs normes nationales et régionales. Toutes divergences entre toutes Publications de la CEI et toutes publications nationales ou régionales correspondantes doivent être indiquées en termes clairs dans ces dernières.
- 5) La CEI n'a prévu aucune procédure de marquage valant indication d'approbation et n'engage pas sa responsabilité pour les équipements déclarés conformes à une de ses Publications.
- 6) Tous les utilisateurs doivent s'assurer qu'ils sont en possession de la dernière édition de cette publication.
- 7) Aucune responsabilité ne doit être imputée à la CEI, à ses administrateurs, employés, auxiliaires ou mandataires, y compris ses experts particuliers et les membres de ses comités d'études et des Comités nationaux de la CEI, pour tout préjudice causé en cas de dommages corporels et matériels, ou de tout autre dommage de quelque nature que ce soit, directe ou indirecte, ou pour supporter les coûts (y compris les frais de justice) et les dépenses découlant de la publication ou de l'utilisation de cette Publication de la CEI ou de toute autre Publication de la CEI, ou au crédit qui lui est accordé.
- 8) L'attention est attirée sur les références normatives citées dans cette publication. L'utilisation de publications référencées est obligatoire pour une application correcte de la présente publication.
- 9) L'attention est attirée sur le fait que certains des éléments de la présente Publication de la CEI peuvent faire l'objet de droits de propriété intellectuelle ou de droits analogues. La CEI ne saurait être tenue pour responsable de ne pas avoir identifié de tels droits de propriété et de ne pas avoir signalé leur existence.

La Norme internationale CEI 60034-8 a été établie par le comité d'études 2 de la CEI: Machines tournantes.

Cette troisième édition de la CEI 60034-8 annule et remplace la seconde édition publiée en 2002 dont elle constitue une révision technique.

La modification principale par rapport à l'édition précédente est la suivante:

- marquage des extrémités modifié pour les machines à courant continu à l'Article A.4.

Le texte de cette norme est issu des documents suivants:

| FDIS        | Rapport de vote |
|-------------|-----------------|
| 2/1434/FDIS | 2/1451/RVD      |

Le rapport de vote indiqué dans le tableau ci-dessus donne toute information sur le vote ayant abouti à l'approbation de cette norme.

Cette publication a été rédigée selon les Directives ISO/CEI, Partie 2.

Une liste de toutes les parties de la série CEI 60034, présentées sous le titre général *Machines électriques tournantes*, peut être consultée sur le site web de la CEI.

Le comité a décidé que le contenu de cette publication ne sera pas modifié avant la prochaine date de maintenance indiquée sur le site de la CEI "<http://www.iec.ch>" dans les données relatives à cette publication. A cette date, la publication sera

- reconduite,
- supprimée,
- remplacée par une édition révisée, ou
- amendée.

IECNORM.COM : Click to view the full PDF of IEC 60034-8:2007

## INTRODUCTION

La révision de la présente partie de la CEI 60034 fournit des spécifications uniformes au niveau mondial pour les connexions électriques des machines électriques tournantes et applique les recommandations de la publication fondamentale de sécurité CEI 60445 en spécifiant les exigences de marquage.

Ces connexions normalisées permettront les échanges en toute sécurité de machines électriques avec leurs dispositifs de commande et de protection en utilisant les marques d'extrémité normalisées.

IECNORM.COM : Click to view the full PDF of IEC 60034-8:2007

## MACHINES ÉLECTRIQUES TOURNANTES –

### Partie 8: Marques d'extrémité et sens de rotation

#### 1 Domaine d'application

La présente partie de la CEI 60034 s'applique aux machines à courant continu et à courant alternatif et spécifie

- a) les règles d'identification des points de couplage;
- b) le marquage des bornes d'enroulement;
- c) le sens de rotation;
- d) la relation entre les marques d'extrémité et le sens de rotation;
- e) les marques d'extrémité des appareils auxiliaires;
- f) les schémas de connexion des machines pour applications communes.

Les machines synchrones de type à turbine sont exclues du domaine d'application de la présente norme.

#### 2 Références normatives

Les documents de référence suivants sont indispensables pour l'application du présent document. Pour les références datées, seule l'édition citée s'applique. Pour les références non datées, c'est l'édition la plus récente du document référencé (y compris tous ses amendements) qui s'applique.

CEI 60034-1, *Machines électriques tournantes – Partie 1: Caractéristiques assignées et caractéristiques de fonctionnement*

CEI 60417, *Symboles graphiques utilisables sur le matériel*

CEI 60445, *Principes fondamentaux et de sécurité pour les interfaces homme-machines, le marquage et l'identification – Identification des bornes de matériels et des extrémités de conducteurs*

#### 3 Termes et définitions

Pour les besoins du présent document, les termes et définitions de la CEI 60034-1 s'appliquent ainsi que les termes suivants.

##### 3.1

##### **marquage d'extrémité**

identification permanente de la connexion de sortie externe des conducteurs d'enroulement ou des conducteurs auxiliaires à la disposition de l'utilisateur pour relier la machine à son alimentation ou à l'appareil qui indique la fonction de la connexion externe

##### 3.2

##### **points de connexion**

tous les points de transfert de courant qui sont utilisés pour connecter en permanence les extrémités d'enroulement ou d'éléments d'enroulement en interne

**3.3****points de prise**

connexions intermédiaires vers une partie d'un élément d'enroulement

**3.4****conducteurs d'enroulement**

conducteurs isolés qui réalisent la connexion électrique entre un enroulement et sa connexion de sortie

**3.5****enroulement**

ensemble de spires ou de bobines ayant une fonction déterminée dans une machine électrique tournante

[VEI 411-37-01]

**3.6****phase d'enroulement**

un ou plusieurs éléments d'enroulement associés à une phase particulière

**3.7****élément d'enroulement**

partie d'un enroulement, toutes les spires et bobines de cette partie étant connectées ensemble de manière permanente

**3.8****enroulements indépendants**

deux ou plus de deux enroulements, chacun ayant une fonction séparée, non interconnectés, utilisés seulement de manière séparée, soit complètement soit en partie

**3.9****moteur à plusieurs vitesses**

moteur qui peut fonctionner à une ou plus d'une vitesse déterminée

**3.10****puissance constante**

situation dans laquelle un moteur à plusieurs vitesses fournit à peu près une puissance constante sur la plage de vitesses

**3.11****couple constant**

situation dans laquelle un moteur à plusieurs vitesses fournit à peu près un couple constant sur la plage de vitesses

**3.12****couple variable**

situation dans laquelle le couple de sortie d'un moteur à plusieurs vitesses est approximativement proportionnel au carré des vitesses

**3.13****séquence de phase**

ordre dans lequel les tensions atteignent successivement leurs valeurs positives maximales entre les conducteurs d'alimentation

### 3.14

#### côté D/côté entraînement d'une machine

côté de la machine où est situé le bout d'arbre d'entraînement

[VEI 411-43-36]

NOTE Pour les machines qui possèdent deux bouts d'arbre d'entraînement, le côté D est celui

- a) qui a le plus grand diamètre;
- b) qui fait face au ventilateur externe lorsque les bouts d'arbre d'entraînement sont du même diamètre.

## 4 Symboles

### 4.1 Généralités

|         |                                                                               |
|---------|-------------------------------------------------------------------------------|
| L       | Conducteur d'alimentation                                                     |
| PE      | Borne de mise à la terre de protection                                        |
| ○       | Extrémité disponible pour l'utilisateur, marquage obligatoire                 |
| ●       | Point de connexion interne                                                    |
| (....)  | Marquage d'extrémité interne (illustrant le symbole de l'élément), facultatif |
| [.....] | Groupement d'extrémités jointes d'utilisateurs                                |
| ;       | Séparation des extrémités ou des groupes d'extrémités                         |

### 4.2 Machines monophasées à courant continu avec collecteur

|   |                                       |
|---|---------------------------------------|
| A | Enroulement d'induit                  |
| B | Enroulement de commutation            |
| C | Enroulement de compensation           |
| D | Enroulement d'excitation en série     |
| E | Enroulement d'excitation en parallèle |
| F | Enroulement excité séparément         |
| H | Enroulement auxiliaire longitudinal   |
| J | Enroulement auxiliaire transversal    |

### 4.3 Machines à courant alternatif sans collecteur

|   |                                                              |
|---|--------------------------------------------------------------|
| F | Enroulement d'excitation à courant continu                   |
| K | Enroulement secondaire                                       |
| L | Enroulement secondaire                                       |
| M | Enroulement secondaire                                       |
| N | Point en étoile (conducteur neutre) d'enroulement primaire   |
| Q | Point en étoile (conducteur neutre) d'enroulement secondaire |
| U | Enroulement primaire                                         |
| V | Enroulement primaire                                         |
| W | Enroulement primaire                                         |
| Z | Enroulements auxiliaires                                     |

NOTE Les attributions de symboles primaire et secondaire ne sont pas liées au fait que l'enroulement primaire soit situé sur le stator ou le rotor.

#### 4.4 Appareils auxiliaires

|    |                                                            |
|----|------------------------------------------------------------|
| BA | Freins en courant alternatif                               |
| BD | Freins en courant continu                                  |
| BW | Détecteur d'équipement de balais                           |
| CA | Condensateurs                                              |
| CT | Transformateur de courant                                  |
| HE | Appareils chauffants                                       |
| LA | Parafoudre                                                 |
| PT | Transformateur de potentiel                                |
| R  | Thermomètres à résistance électrique                       |
| SC | Condensateurs contre les pointes d'énergie                 |
| SP | Protecteurs contre les pointes d'énergie                   |
| S  | Interrupteurs y compris les interrupteurs à enfichage      |
| TB | Thermostats qui s'ouvrent lorsque la température augmente  |
| TC | Thermocouples                                              |
| TM | Thermostats qui se ferment lorsque la température augmente |
| TN | Thermistances, coefficient de température négatif          |
| TP | Thermistances, coefficient de température positif          |

NOTE Ce tableau normalise les dispositifs auxiliaires les plus couramment employés. La désignation des autres dispositifs peut être choisie par le fabricant.

#### 5 Sens de rotation

Le sens de rotation doit être celui de l'arbre observé lorsqu'on est face au côté D.

Les machines dont le marquage d'extrémité est conforme à la présente norme doivent avoir un sens de rotation suivant le sens des aiguilles d'une montre.

Pour les autres configurations, y compris les machines unidirectionnelles, le sens de rotation doit être indiqué par une flèche située sur l'enveloppe.

#### 6 Règles pour le marquage des extrémités

##### 6.1 Généralités

##### 6.1.1 Application

Un marquage d'extrémité doit identifier toutes les connexions d'enroulement et d'appareils auxiliaires accessibles pour l'utilisateur.

NOTE Les connexions de lignes extérieures et les montages d'enroulement utilisés pour les applications communes sont donnés à l'Annexe A.

##### 6.1.2 Instructions pour le marquage

Toutes les machines triphasées à courant alternatif avec plus de trois extrémités sorties et toutes les autres machines (et appareils auxiliaires) avec plus de deux extrémités sorties doivent avoir des instructions de connexion correspondant à la présente norme.

### 6.1.3 Notation alphanumérique du marquage

Le marquage d'extrémité comprend des lettres latines en majuscule et des chiffres arabes. Les caractères ne doivent pas être séparés par des espaces.

Chaque enroulement, phase d'enroulement ou circuit auxiliaire doit se voir attribuer une ou des lettres symboles conformément à l'Article 4.

Afin d'éviter toute confusion avec les chiffres 1 et 0, on ne doit pas utiliser les lettres «I» et «O».

### 6.1.4 Extrémités d'enroulement doubles

Plusieurs conducteurs d'une machine peuvent avoir le même marquage uniquement si chacun d'entre eux est capable de remplir complètement la même fonction électrique, de telle manière que n'importe lequel d'entre eux peut être utilisé pour la connexion. Voir la Figure 9.

### 6.1.5 Extrémités partagées

Lorsque plusieurs connecteurs ou conducteurs sont prévus pour partager le courant, les marquages d'extrémité doivent être identifiés au moyen d'un suffixe numérique complémentaire séparé par un tiret. Voir la Figure 10.

Certains moteurs à plusieurs vitesses qui ont deux ou plus de deux enroulements indépendants peuvent produire des courants circulant dans l'enroulement hors tension. Dans ce cas, les marquages d'extrémité pour la connexion en triangle ouvert doivent être identifiés par un suffixe numérique complémentaire séparé par un trait d'union. Voir la Figure A.15.

### 6.1.6 Omissions

Les suffixes et/ou préfixes numériques peuvent être omis s'il n'y a pas de risque de confusion. Voir la Figure 2.

Lorsque deux ou plus de deux éléments sont connectés à la même extrémité, son marquage doit être déterminé par l'un des éléments. L'ordre de priorité doit être déterminé par le suffixe le moins élevé. Voir la Figure 8.

Lorsque deux ou plus de deux éléments de fonction différente sont connectés à l'intérieur, la combinaison des éléments doit être considérée comme un élément unique et le marquage d'extrémité doit avoir la notation alphanumérique de la fonction de l'élément primaire. Voir la Figure 24.

### 6.1.7 Extrémité de mise à la terre

La connexion pour le conducteur de terre de protection doit être marquée avec les lettres PE conformément à la CEI 60445 (ou marquée du symbole CEI 60417-5019(2006-08)). Aucune autre extrémité ne doit être marquée de cette façon.

## 6.2 Suffixes

### 6.2.1 Éléments d'enroulement

Les extrémités de chaque élément d'enroulement sont repérées par un suffixe numérique, conforme à la CEI 60445, comme suit (voir la Figure 5):

- 1 et 2 pour le premier élément d'enroulement (voir la Figure 1),
- 3 et 4 pour le deuxième élément d'enroulement,
- 5 et 6 pour le troisième élément d'enroulement,
- 7 et 8 pour le quatrième élément d'enroulement.

Dans tous les éléments d'enroulements, l'extrémité la plus proche de la connexion d'alimentation doit être marquée avec le chiffre le plus faible des deux.

### 6.2.2 Connexions internes

Lorsque plusieurs extrémités d'éléments d'enroulement sont rassemblées, le marquage d'extrémité doit utiliser le suffixe le plus faible; voir la Figure 8.

### 6.2.3 Points de prises

Les points de prise d'un élément d'enroulement doivent être marqués dans l'ordre dans lequel ils apparaissent dans l'élément d'enroulement, comme suit (voir la Figure 6):

- 11, 12, 13, etc. pour le premier élément d'enroulement,
- 31, 32, 33, etc. pour le deuxième élément d'enroulement,
- 51, 52, 53, etc. pour le troisième élément d'enroulement,
- 71, 72, 73, etc. pour le quatrième élément d'enroulement.

La prise la plus proche du début de l'enroulement doit être marquée du suffixe le plus faible.

## 6.3 Préfixes

Les éléments d'enroulement qui sont séparés (ou qui appartiennent à des systèmes différents), mais qui ont une fonction similaire mais indépendante doivent être marqués avec la même lettre, mais on doit les distinguer avec un préfixe numérique.

Chacune des extrémités sorties doit être marquée avec un préfixe numérique correspondant à l'enroulement indépendant (ou au système) auquel elle appartient, comme suit: (voir la Figure 7)

|                       |   |
|-----------------------|---|
| premier enroulement   | 1 |
| deuxième enroulement  | 2 |
| troisième enroulement | 3 |
| quatrième enroulement | 4 |
| etc.                  |   |

Pour les machines à plusieurs vitesses, l'ordre des préfixes correspond à l'ordre des vitesses dans le sens croissant. Voir la Figure A.19.

## 6.4 Identification d'enroulement pour les catégories de machines

### 6.4.1 Machines triphasées

Les lettres symboles doivent être U, V et W pour la première, la deuxième et la troisième phase d'enroulement primaire respectivement et N lorsqu'un conducteur neutre est utilisé (voir la Figure 3) et K, L et M et Q lorsqu'un enroulement secondaire est utilisé. Voir la Figure 11.

### 6.4.2 Machines biphasées

Les marquages d'extrémité des machines biphasées doivent être dérivés des marquages des machines triphasées, sans les lettres W et M.

### 6.4.3 Machines monophasées

Les lettres symboles attribuées doivent être U pour l'enroulement primaire et Z pour l'enroulement auxiliaire. Voir la Figure 12.

Si les extrémités d'enroulement d'un enroulement principal et d'un enroulement auxiliaire sont connectées sur une extrémité commune, cette extrémité doit être marquée selon la règle applicable à la phase principale.

#### **6.4.4 Machines de groupes triphasées multiples (par exemple, six phases)**

Chaque groupe de phase doit être différencié par un préfixe selon 6.3. Voir la Figure 15.

L'ordre numérique du préfixe doit augmenter en suivant l'ordre dans lequel la phase U de chaque groupe de phase atteint son maximum.

### **6.5 Enroulement de champ des machines synchrones**

Les marquages d'extrémité des enroulements en courant continu de champs excités séparément doivent être F1 et F2.

### **6.6 Machines à courant continu**

Les lettres symboles attribuées aux éléments d'enroulement doivent être celles dont la liste est donnée en 4.2 avec les marquages d'extrémité comme représenté aux Figures 16 à 24.

### **6.7 Relation entre les marquages d'extrémité et le sens de rotation**

#### **6.7.1 Machines multiphasées**

Les marquages d'extrémité doivent être disposés de manière à obtenir une rotation dans le sens des aiguilles d'une montre lorsque l'ordre alphabétique des lettres (par exemple U1, V1, W1) correspond à l'ordre de succession des tensions de phase du système. La séquence de phase d'un enroulement secondaire (par exemple K, L, M) doit correspondre à la séquence de phase de l'enroulement primaire (par exemple U, V, W).

Pour la rotation dans le sens inverse des aiguilles d'une montre, l'ordre de succession des tensions de phase du système doit être inversé en redisant les câbles d'alimentation (par exemple L2 et L3 dans le cas de 3 phases).

L'exigence de cet article s'applique aux machines de toute puissance de sortie et tension assignées, même si la rotation dans le sens des aiguilles d'une montre n'est pas réalisable en pratique.

Lorsque les machines ne sont adaptées qu'à un fonctionnement dans un seul sens de rotation, une flèche doit indiquer ce sens de rotation. Cette flèche ne doit pas être nécessairement sur la plaque signalétique mais elle doit être fixée de manière permanente et facilement visible.

#### **6.7.2 Machines multiphasées à plusieurs vitesses**

Pour les machines à plusieurs vitesses incorporant un enroulement à nombre de pôles variable, comme un enroulement Dahlander ou un PAM (modulation d'amplitude de pôles), les marquages des extrémités pour la vitesse la plus faible de ces enroulements, qui doivent être connectés à l'alimentation (par exemple 1U et 1W), doivent être interchangés, le cas échéant, pour obtenir le même sens de rotation pour les deux vitesses.

#### **6.7.3 Machines monophasées**

La rotation dans le sens des aiguilles d'une montre doit être obtenue lorsque l'alimentation est connectée à U1 et U2 et que l'enroulement auxiliaire est connecté comme Z1 avec U1 et Z2 avec U2. Pour inverser le sens de rotation, on doit connecter les extrémités Z1 à U2 et Z2 à U1.

#### 6.7.4 Machines de groupes triphasées multiples (par exemple, six phases)

Les marquages d'extrémité doivent être disposés de manière à obtenir une rotation dans le sens des aiguilles d'une montre lorsque l'ordre alphabétique des lettres dans chaque groupe de phase correspond à l'ordre de succession des tensions de phase du système connecté à ce groupe. L'ordre des préfixes des groupes correspond à l'ordre dans lequel la première phase de chaque groupe de phase atteint sa valeur maximale.

Pour la rotation dans le sens inverse des aiguilles d'une montre, l'ordre de succession des tensions de phase du système doit être inversé en redisant les câbles d'alimentation dans chaque groupe et en inversant l'ordre de connexion des groupes des tensions d'alimentation aux groupes de phase des enroulements.

#### 6.7.5 Machines à courant continu

Les marquages d'extrémité doivent être disposés de telle manière que la rotation dans le sens des aiguilles d'une montre soit obtenue lorsque les polarités de ligne L+ et L– correspondent aux polarités des extrémités A1 et A2. Quand la machine est alimentée par un enroulement de champ à excitation indépendante, les marquages d'extrémité doivent être disposés de manière à obtenir une rotation dans le sens des aiguilles d'une montre lorsque les polarités de ligne L+ et L– correspondent à la fois aux extrémités A1 et A2 et aux extrémités F1 et F2.

Pour la rotation dans le sens inverse des aiguilles d'une montre, la polarité de la connexion d'alimentation soit avec l'induit soit avec le champ doit être inversée en tenant compte de 6.7.6.

#### 6.7.6 Relation entre le sens du courant et le champ magnétique (machines à courant continu)


**6.7.6.1** Deux enroulements d'excitation génèrent des champs de même direction si le courant d'excitation dans les deux flux d'enroulement provient de l'extrémité avec le suffixe numérique le plus faible (le plus élevé) et va vers l'extrémité avec le suffixe le plus élevé (le plus faible).

**6.7.6.2** Les champs magnétiques des enroulements de commutation et de compensation doivent être de polarité correcte l'un par rapport à l'autre et par rapport au champ magnétique de l'enroulement d'induit si, dans tous les enroulements, du courant va de l'extrémité avec le suffixe numérique le plus faible (le plus élevé) vers l'extrémité avec le suffixe le plus élevé (le plus faible).


#### 6.8 Chiffres pour le marquage des extrémités

Les schémas de connexion pour les applications communes sont représentés à l'Annexe A.


##### 6.8.1 Machines triphasées asynchrones

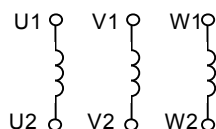


**Figure 1 – Enroulement unique triphasé, trois éléments, connexion ouverte, six extrémités**

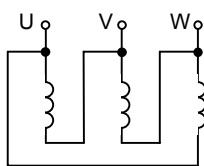


**Figure 2 – Enroulement unique triphasé, connexion en triangle, trois extrémités**

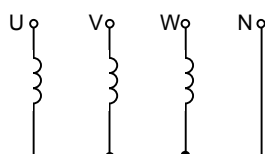


**Figure 3 – Enroulement unique triphasé, connexion en étoile interne avec conducteur neutre, quatre extrémités**

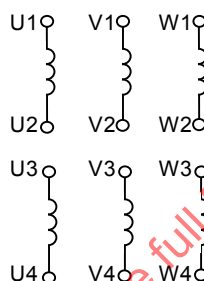


**Figure 4 – Enroulement unique triphasé, deux éléments par phase, connexion ouverte, douze extrémités**

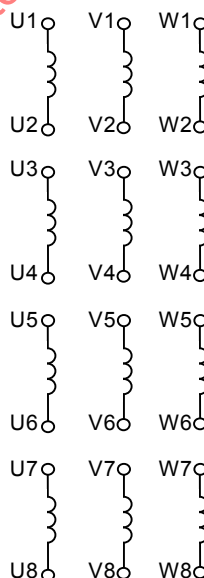


**Figure 5 – Enroulement unique triphasé, quatre éléments par phase, connexion ouverte, vingt-quatre extrémités**

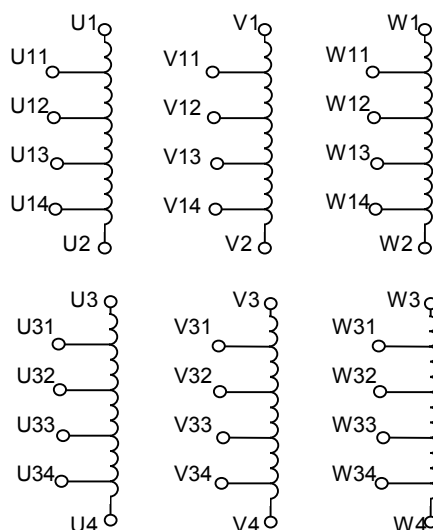


**Figure 6 – Enroulement unique triphasé, deux éléments par phase avec quatre points de prises par élément, connexion ouverte, trente-six extrémités**

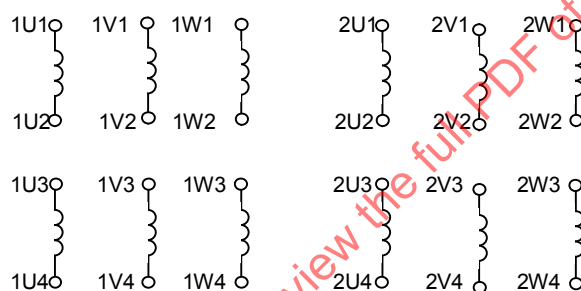


**Figure 7 – Deux enroulements triphasés indépendants avec deux fonctions indépendantes, deux éléments par phase, connexion ouverte, vingt-quatre extrémités**




**Figure 8 – Deux éléments, connexion interne, trois extrémités**

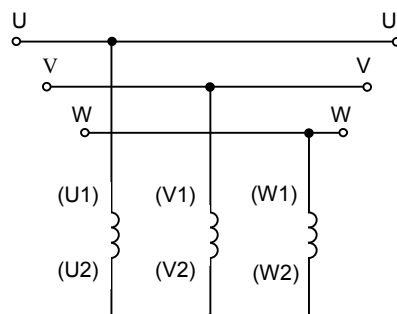

**Figure 9 – Enroulement unique triphasé, connexion en étoile, extrémités doublées pour connexion alternée, six extrémités**

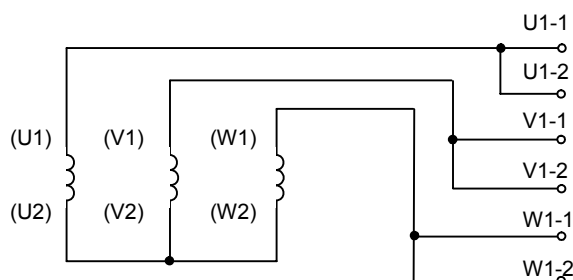

**Figure 10 – Enroulement unique triphasé, connexion en étoile, extrémités parallèles pour courant partagé, six extrémités**

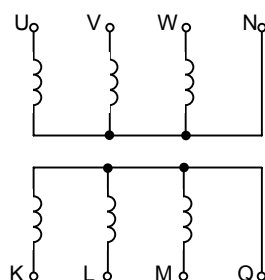


**Figure 11 – Rotor bobiné triphasé, connexions en étoile avec conducteurs neutres, huit extrémités**


#### 6.8.2 Machines monophasées asynchrones



**Figure 12 – Enroulement principal et auxiliaire, deux éléments**




**Figure 13 – Enroulement auxiliaire monophasé, condensateur complètement connecté, un élément**



**Figure 14 – Enroulement principal monophasé, protecteur thermique complètement connecté, un élément**

#### 6.8.3 Machines de groupes triphasées multiples (six phases)

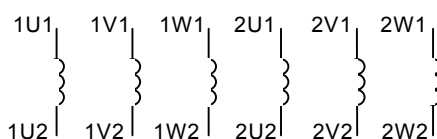

**Figure 15 – Enroulement six phases, connexion ouverte, six éléments**

#### 6.8.4 Machines à courant continu




Figure 16 – Enroulement d'induit, un élément




Figure 17 – Enroulement de commutation, un et deux éléments




Figure 18 – Enroulement de compensation, un et deux éléments




Figure 19 – Enroulement de série, un élément, deux prises



Figure 20 – Enroulement d'excitation en parallèle, un élément




Figure 21 – Enroulement d'excitation excité séparément, un et deux éléments



Figure 22 – Enroulement auxiliaire longitudinal, un élément



Figure 23 – Enroulement auxiliaire transversal, un élément




Figure 24 – Enroulement d'induit avec enroulements de commutation et de compensation, un élément

## 7 Règles de marquage d'extrémités auxiliaires

### 7.1 Généralités

Le marquage des extrémités auxiliaires doit être conforme à 6.1.3, le paragraphe 4.4 identifiant le type de dispositif auxiliaire avec:

- un préfixe numérique identifiant le circuit ou le dispositif individuellement;
- un suffixe numérique identifiant la fonction du conducteur.

L'ajout de lettres ou de chiffres au symbole auxiliaire doit se fonder dans la mesure du possible sur les règles données à l'Article 6.

Lorsqu'il existe un grand nombre d'extrémités pour un type particulier d'appareil (par exemple les thermocouples), les conducteurs peuvent être regroupés par code d'appareil et les extrémités identifiées par un préfixe (1-99) et suivies d'un suffixe à un seul chiffre (1-9).

Il convient que le constructeur identifie la fonction de ces appareils dans des instructions écrites.

Quand un seul dispositif d'un certain type existe, le préfixe peut être omis.

### 7.2 Marquage

#### 7.2.1 Appareils relatifs à la puissance

Les appareils BA, BD, BW, CA, HE, LA, SC et SP doivent être marqués et connectés conformément aux paragraphes 7.2.1.1 à 7.2.1.4 où:

\*\* indique le codage de l'appareil et  représente l'appareil.

NOTE Il convient que ce symbole soit modifié conformément à la CEI 60617 pour les schémas.

##### 7.2.1.1 Monophasé, tension unique


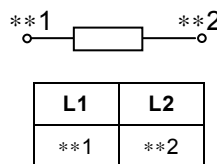


Figure 25 – Monophasé, tension unique

##### 7.2.1.2 Monophasé, deux tensions



| Tension | L1  | L2  | Rassemblées | Isolées |
|---------|-----|-----|-------------|---------|
| Elevée  | **1 | **4 | -           | **2     |
| Faible  | **1 | **2 | [**1, **4]  | -       |

Figure 26 – Monophasé, deux tensions