
International Standard



2787

INTERNATIONAL ORGANIZATION FOR STANDARDIZATION • МЕЖДУНАРОДНАЯ ОРГАНИЗАЦИЯ ПО СТАНДАРТИЗАЦИИ • ORGANISATION INTERNATIONALE DE NORMALISATION

Rotary and percussive pneumatic tools — Performance tests

Machines pneumatiques rotatives, percutantes et roto-percutantes — Essais de fonctionnement

Second edition — 1984-01-15

STANDARDSISO.COM : Click to view the full PDF of ISO 2787:1984

UDC 621.542

Ref. No. ISO 2787-1984 (E)

Descriptors : tools, pneumatic tools, performance tests, definitions, classification, specifications, test results.

Price based on 15 pages

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of developing International Standards is carried out through ISO technical committees. Every member body interested in a subject for which a technical committee has been authorized has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work.

Draft International Standards adopted by the technical committees are circulated to the member bodies for approval before their acceptance as International Standards by the ISO Council.

International Standard ISO 2787 was developed by Technical Committee ISO/TC 118, *Compressors, pneumatic tools and pneumatic machines*, and was circulated to the member bodies in September 1982.

It has been approved by the member bodies of the following countries :

Austria	Germany, F. R.	Spain
Belgium	India	United Kingdom
Czechoslovakia	Mexico	USA
Egypt, Arab Rep. of	Netherlands	
France	Poland	

No member body expressed disapproval of the document.

This second edition cancels and replaces the first edition (i.e. ISO 2787-1974).

Contents

	Page
0 Introduction	1
1 Scope and field of application	1
2 References	1
3 Definitions	2
3.1 Definitions of some general physical terms	2
3.2 Definitions concerning rotary air motor torque performance	2
4 Letter symbols and units	2
4.1 General rules for letter symbols	2
4.2 Symbols and units	3
4.3 Subscripts	3
5 Classification of pneumatic tools	3
5.1 Description of the pneumatic tools	3
5.2 Tool performance data	4
5.3 Data to be given for different types of tools	4
6 Methods for measurement of tool performance data	5
6.1 General rules for performance tests on pneumatic tools	5
6.2 Pressure	5
6.3 Torque	6
6.4 Shaft speed	6
6.5 Impact energy	6
6.6 Blow rate	7
6.7 Power output	7
6.8 Air consumption	7

Annexes

A	Format for pneumatic tools test report — Rotary tool	8
B	Format for pneumatic tools test report — Percussive tool	10
C	Procedure for measurement of impact energy by the strain gauge method	12

STANDARDSISO.COM : Click to view the full PDF of ISO 2787:1984

Rotary and percussive pneumatic tools — Performance tests

0 Introduction

This International Standard shows how information on hand-held pneumatic rotary tools, percussive tools and percussive tools with rotation should be obtained and presented.

Such information is valuable for the following purposes :

- a) to enable manufacturers of pneumatic rotary and percussive tools to offer their products under similar technical specifications;
- b) to help users to compare different tools and to select the right type and size for a specific task;
- c) to instruct test personnel about how performance tests shall be carried out, according to specified conditions described in this International Standard.

1 Scope and field of application

This International Standard specifies a method of performance tests and technical conditions for the supply of pneumatic tools and gives detailed instructions on the measurement of power output and air consumption and means of adjusting the measured values to specified conditions.

2 References

- ISO 31, *Quantities, units and symbols*.
- ISO 1000, *SI units and recommendations for the use of their multiples and of certain other units*.
- ISO 1180, *Shanks for pneumatic tools and fitting dimensions of chuck bushings*.¹⁾
- ISO 2944, *Fluid power systems and components — Nominal pressures*.
- ISO 3857/1, *Compressors, pneumatic tools and machines — Vocabulary — Part 1 : General*.
- ISO 3857/3, *Compressors, pneumatic tools and machines — Vocabulary — Part 3 : Pneumatic tools and machines*.
- ISO 5167, *Measurement of fluid flow by means of orifice plates, nozzles and Venturi tubes inserted in circular cross-section conduits running full*.
- ISO 5391, *Compressors, pneumatic tools and machines — Classification*.²⁾
- ISO 5393, *Rotary pneumatic tools for threaded fasteners — Performance test*.
- ISO 6544, *Hand-held pneumatic assembly tools for installing threaded fasteners — Reaction torque and torque impulse measurements*.

1) At present at the stage of draft. (Revision of ISO/R 1180-1970.)

2) At present at the stage of draft.

3 Definitions

3.1 Definitions of some general physical terms

3.1.1 total pressure : The pressure measured on the stagnation point when a moving gas stream is brought to rest and its kinetic energy is converted by an isentropic compression from the flow condition to the stagnation condition. It is the pressure usually measured by a Pitot tube. In a stationary body of gas the static and the total pressures are numerically equal.

3.1.2 static pressure : The pressure measured in a gas in such a manner that no effect on measurement is produced by the gas velocity.

3.1.3 dynamic (velocity) pressure : The total pressure minus the static pressure.

3.1.4 atmospheric pressure : The absolute pressure of the atmosphere measured at the test place.

3.1.5 gauge (effective) pressure : The pressure measured above the atmospheric pressure.

3.1.6 absolute pressure : The pressure measured from absolute zero, i.e. from an absolute vacuum. It equals the algebraic sum of atmospheric pressure and gauge pressure.

3.1.7 free air : Air at the atmospheric conditions of the site.

3.1.8 total temperature : The temperature which would be measured at the stagnation point if a gas stream were brought to rest and its kinetic energy converted by an isentropic compression from the flow condition to the stagnation condition.

The temperature rise at stagnation of the gas stream can be neglected if the gas velocity around the measuring point is lower than 30 m/s.

3.2 Definitions concerning rotary air motor torque performance

3.2.1 static starting torque : The torque that continues to be developed by the motor in response to an application of fluid pressure when the torque load is sufficient to prevent rotation.

NOTE — The value may depend upon the angular position of the motor shaft. The maximum static starting torque is the value obtained when the angular position of the motor shaft is in the most advantageous location. The minimum static starting torque is the value obtained when the angular position of the motor shaft is in the least advantageous location.

3.2.2 dynamic starting torque : The peak torque delivered by the output shaft of the motor in response to an application of fluid pressure when the torque load is sufficient to prevent rotation.

NOTE — The dynamic starting torque will often be in excess of the static starting torque where lost motion exists between the motor shaft and the load, allowing rotation and momentum to develop prior to application of the load.

3.2.3 brake loaded torque : The continuous torque delivered at a constant speed.

3.2.4 maximum brake loaded torque : The maximum continuous torque that can be delivered at a constant speed.

3.2.5 static stall torque : The torque that continues to be developed after a load has stalled the motor.

NOTE — The value may depend upon the angular position of the motor shaft in the stalled position. The maximum static stall torque is the value obtained when the angular position of the motor shaft is in the most advantageous location. The minimum static stall torque is the value obtained when the angular position of the motor shaft is in the least advantageous location.

3.2.6 dynamic stall torque : The peak torque delivered by the output shaft when a load is applied that stalls the motor.

NOTE — The peak torque will vary, depending upon the rate of deceleration caused by the load.

4 Symbols and units

These are in accordance with ISO 31 and ISO 1000.

4.1 General rules for letter symbols

The use of the letter symbols given in 4.2 and 4.3 is recommended. The list is formulated in line with the following seven principles :

- a) the same symbols shall be used for the same quantities regardless of the system of units;
- b) for any one quantity a single symbol shall be used with subscripts to indicate readings other than the primary one;
- c) the same symbols shall be used for a given concept regardless of the number of special values which occur;
- d) letter subscripts shall be used to denote values under special conditions;
- e) numerical subscripts shall be used to denote values at different points of a cycle;
- f) symbols shall be confined if possible to roman letters;
- g) where possible, capital letters shall be used for absolute quantities.

4.2 Letter symbols and units

Symbol	Quantity	Unit
<i>D</i>	Piston diameter	mm
<i>d</i>	Pipe or hose internal diameter	mm
<i>e</i>	Impact	J
<i>F</i>	Force	N
<i>L</i>	Length	m or mm
<i>M</i>	Torque	Nm
<i>m</i>	Mass	kg
<i>P</i>	Power	kW
<i>N</i>	Number of tools	—
<i>n</i>	Shaft speed	min ⁻¹
<i>f</i>	Blow rate	Hz
<i>p</i>	Absolute pressure	bar*
<i>p_e</i>	Gauge pressure (effective pressure) — $p_e = p - p_b$	bar
<i>p_b</i>	Atmospheric pressure	bar
<i>q_V</i>	Volume flow rate	l/s
<i>s</i>	Standard deviation	—
<i>S</i>	Stroke	mm

4.3 Subscripts

0	Ambient conditions
av	Average value
max	Maximum value
min	Minimum value
s	Starting conditions (<i>n</i> or <i>f</i> = 0)
i	No-load conditions
<i>P</i>	Conditions at stated power output

5 Classification of pneumatic tools

5.1 Description of the pneumatic tools

	Symbol	Explanatory comments
5.1.1 Type of pneumatic tool		Manufacturer's type designation
5.1.2 Standard equipment		Pneumatic tool including tool holder as well as all devices for the prevention of accidents and noise but without working tools, coupling hose fitting, hose and support
5.1.3 Mass of the pneumatic tool	<i>m</i>	Mass of the normally equipped tool defined as in 5.1.2
5.1.4 Dimensions of the pneumatic tool		In all cases the overall length of the pneumatic tool will be shown together with such other dimensions as are appropriate to the particular type of pneumatic tool
5.1.5 Piston diameter and mass	<i>D</i> <i>m_p</i>	Dimension of the striking piston at its largest outside diameter and its mass
5.1.6 Theoretical piston stroke	<i>S</i>	Possible axial movement of the piston in the working chamber with the tool shank fully inserted
5.1.7 Recommended hose, inner diameter and length	<i>d</i> <i>L_h</i>	Smallest inside diameter and length of the supply hose and of the necessary fittings
Explanatory comments		
5.1.8 Type and dimensions of the working tool		According to ISO 1180
5.1.9 Tool shank and chuck bushing		According to ISO 1180
5.1.10 Tool retainer		
5.1.11 Special and optional features		Flushing, dry suction, etc.

* 1 bar = 10⁵ Pa.

5.2 Tool performance data

	Symbol
5.2.1 Compressed air pressure for which test data are valid (recommended compressed air pressure)	p
5.2.2 Power output	P
5.2.3 Air consumption at given power output	q_{VP}
5.2.4 Air consumption, no-load	q_{Vi}
5.2.5 Rotational speed at given power output	n_P
5.2.6 Torque at given power output	M_P
5.2.7 Starting torque	
maximum	M_{smax}
minimum	M_{smin}

NOTE — It should be clearly stated which starting torque is referred to according to 3.2.

5.2.8 Rotational speed under no-load or blow rate under no-load	n_i f_i
5.2.9 Impact energy	e
5.2.10 Blow rate	f
5.2.11 Maximum tightening torque	M_e

5.3 Data to be given for different types of tool

In principle, all data in accordance with 5.1 and 5.2 which are applicable to the pneumatic tool under consideration shall be given in the description of the tool.

5.3.1 Percussive pneumatic tools without rotation

- Type of pneumatic tool (5.1.1)
- Standard equipment (5.1.2)
- Mass of the pneumatic tool (5.1.3)
- Dimensions of the pneumatic tool (5.1.4)
- Piston diameter and mass (5.1.5)
- Theoretical piston stroke (5.1.6)
- Recommended hose, inner diameter and length (5.1.7)
- Type and dimensions of the working tool (5.1.8)
- Tool holder (5.1.9)
- Tool retainer (5.1.10)
- Recommended compressed air pressure (5.2.1)

- Air consumption under load (5.2.3)
- Impact energy (5.2.9)
- Blow rate (5.2.10)

5.3.2 Percussive pneumatic tools with rotating device
(for example, rock drills)

- Type of pneumatic tool (5.1.1)
- Standard equipment (5.1.2)
- Mass of the pneumatic tool (5.1.3)
- Dimensions of the pneumatic tool (5.1.4)
- Piston diameter and mass (5.1.5)
- Theoretical piston stroke (5.1.6)
- Recommended hose, inner diameter and length (5.1.7)
- Type and dimensions of the working tool (5.1.8)
- Tool holder (5.1.9)
- Tool retainer (5.1.10)
- Special and optional features (5.1.11)
- Recommended compressed air pressure (5.2.1)
- Air consumption under load (5.2.3)
- Impact energy (5.2.9)
- Blow rate (5.2.10)
- Rotational frequency (5.2.10)

5.3.3 Rotary pneumatic tools

- Type of pneumatic tool (5.1.1)
- Standard equipment (5.1.2)
- Mass of the pneumatic tool (5.1.3)
- Dimensions of the pneumatic tool (5.1.4)
- Type and dimensions of the working tool (5.1.8)
- Tool holder (5.1.9)
- Tool retainer (5.1.10)
- Special and optional features (5.1.11)
- Recommended compressed air pressure (5.2.1)
- Power output, maximum (5.2.2)
- Air consumption under load (5.2.3)

- Air consumption at no-load (5.2.4)
- Rotational speed under load (5.2.5)
- Rotational speed at no-load (5.2.8)

5.3.4 Pneumatic screwdrivers and nutrunners

- Type of pneumatic tool (5.1.1)
- Standard equipment (5.1.2)
- Mass of the pneumatic tool (5.1.3)
- Dimensions of the pneumatic tool (5.1.4)
- Type and dimensions of the working tool (5.1.8)
- Tool holder (5.1.9)
- Tool retainer (5.1.10)
- Special and optional features (5.1.11)
- Recommended compressed air pressure (5.2.1)
- Power output, maximum (5.2.2)
- Air consumption at no-load (5.2.4)
- Maximum starting torque (5.2.7)
- Rotational speed at no-load (5.2.8)

6 Methods for measurement of tool performance data

6.1 General rules for performance test on pneumatic tools

6.1.1 All measurements carried out in compliance with this International Standard shall be performed by competent persons and with accurate instrumentation which is calibrated against existing standards or standard methods.

6.1.2 The performance of pneumatic tools is affected by different ambient conditions such as atmospheric pressure and temperature. Moreover, the temperature of the compressed air influences the behaviour of the tool. Test conditions should be in the range of values given below :

- Atmospheric pressure 960 ± 100 mbar
- Ambient temperature 20 ± 2 °C
- Compressed air temperature 20 ± 5 °C

During the test run with the tool, the temperature shall be kept as close as possible to the test conditions. Any deviation shall be stated in the test report. Tests shall be avoided if the atmospheric pressure deviates from the given conditions.

6.1.3 In general pneumatic tools shall be tested at an effective (gauge) air pressure of $6,3 \pm 0,15$ bar. If the tool has been designed for a different pressure (for example 4 bar) this may be used and shall be stated in the test report. The working pressure shall be maintained under all test conditions.

6.1.4 The point of pressure measurement (see also 6.2.4) depends on the type of tool used.

6.1.4.1 Rotary tools

The compressed air working pressure shall be measured immediately upstream of the tool.

6.1.4.2 Percussion tools

With regard to pulsating air flow during performance tests, the length of the connecting hose from the point of pressure measurement to the tool shall be at least 3 m and preferably close to this figure. Hose diameter shall be stated in the test report.

6.1.5 All performance data concerning pressure, number of revolutions and blows, power output and blow energy etc., shall refer to the same running conditions unless stated otherwise.

6.1.6 During the test run of the tool, the quality and quantity of lubricant recommended by the manufacturer shall be used.

6.1.7 Due to manufacturing tolerances, even tools of the same type give different performance data. To obtain performance data for the type, it is necessary to test a number of tools (minimum five) and state the arithmetical average value.

6.2 Pressure

6.2.1 Accurate measurement of the compressed air pressure to the pneumatic tool is of very great importance since the tool performance is strongly influenced by this factor.

6.2.2 For measurement of air pressure, gauges of any suitable type could be used. The gauges selected shall be of such size and quality that 0,5 % pressure difference of full scale reading can be read easily. The pressures to be read shall fall between one-fourth and three-fourths of full scale reading. The pressure gauge shall be checked and calibrated as often as necessary to make certain that sufficient accuracy is attained. For the calibration, dead-weight gauges can be used.

6.2.3 The compressed air pressure to the tool shall be measured as total pressure at the inlet of the tool hose as specified in the description of the tool, 5.1.7. This means that the air shall be at rest without any velocity or have a velocity small enough to give a negligible dynamic pressure. This means, in turn, that the velocity of the air at the point of the supply line where the pressure is to be measured shall not be higher than 15 m/s at $7,3 \pm 0,15$ bar absolute pressure. In order to avoid the effect of pressure drop due to supply line losses, pressure measurements shall be carried out with the tool running.

6.2.4 A low air velocity at the point of pressure measurement is achieved by fitting an air receiver between the supply line and the inlet of the tool. The receiver will also damp the pulsations in the air stream to ensure a correct air flow measurement. A suitable arrangement is shown in figure 1.

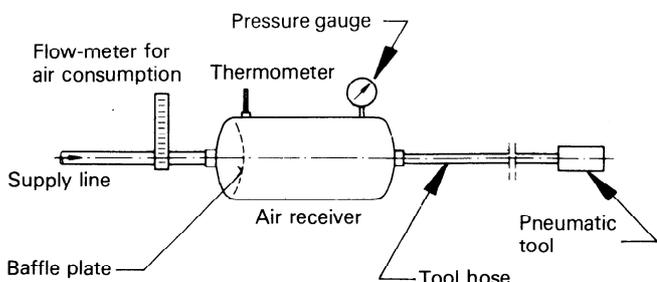


Figure 1 — Use of air receiver

The receiver shall have a cross-section, A , expressed in square metres, perpendicular to the direction of the air stream of at least

$$A > 7 \times 10^{-5} \times \frac{q_{V_{\max}}}{p}$$

where

$q_{V_{\max}}$ is the maximum air flow for which the device is intended, expressed in litres per second of free air;

p is the absolute pressure in the supply line in bars.

This corresponds to an air velocity of 15 m/s.

When testing percussive tools, the volume of the receiver shall be at least 100 times the swept volume of the tool. The inlet to the receiver and the pressure tapping for the gauge shall be located relative to each other so that the incoming air stream does not impinge directly on the pressure tapping. In many cases the insertion of a baffle plate in front of the inlet as shown in figure 1 is advantageous.

A thermometer shall be inserted to check the temperature of the compressed air in the receiver and at the air flow measuring device.

6.2.5 Before the set-up is used for testing pneumatic tools, it shall be made certain that the desired effect on the pressure measurements is obtained. This shall be controlled by increasing the air flow slowly to the maximum flow for which the device is intended. At the same time the pressure gauge is observed and its reading shall not change more than 0,5 % during this procedure. This also indicates that the supply line has sufficient capacity.

6.2.6 It shall also be checked that there are no pressure pulsations in the supply line, for example from the compressors. Such pulsations might introduce errors in the pressure measurement and the measurement of the air consumption.

If noticeable pulsations are present, they shall be damped before the air stream reaches the measuring device. This can be done by inserting another suitable receiver into the line between the compressors and the measuring device.

6.2.7 Tests carried out in accordance with 6.2.4 to 6.2.6 and with a properly calibrated pressure gauge will keep the operating pressure within ± 2 % of the desired value.

6.3 Torque

The measurement of the torque of a pneumatic rotary tool shall be made according to generally accepted test codes or procedures.

In such a case, reference to the test code shall be made in the report.

6.3.1 The torque shall be measured by swinging arm dynamometers, torquemeters or brakes.

6.3.2 Swinging arm dynamometers shall not be used below one-tenth of their rated torque capacity.

6.3.3 A correctly performed torque measurement will give a result which deviates less than ± 3 % from the true value.

6.4 Shaft speed

6.4.1 Shaft speeds shall be measured with good, accurate instruments which shall be checked with sufficient frequency to ensure proper calibration. If possible, the total number of revolutions during a certain time period should be measured using a revolution counter free from slip.

6.4.2 If the shaft speed is measured according to 6.4.1 an accuracy of ± 2 % in shaft speed measurement can be expected.

6.5 Impact energy

The measurement of impact energy from percussive tools is a difficult problem for which many different methods have been proposed. Few of them, however, give a true measure of the actual impact energy. In this International Standard, one method has been adopted and is regarded as being suitable if properly handled and checked.

6.5.1 When the hammer piston in the pneumatic tool hits the working tool, for example drill steel, chisel, etc., a strain wave (strain pulse) is generated in it and travels along it down to the bit end. The strain pulse can be recorded with suitable apparatus. The strain pulse carries a part of the impact energy of the piston, and the maximum stress level of the pulse is a function of the impact velocity of the piston and hence the energy of the piston at impact. By suitable calibration the relation between the impact energy of the piston and maximum stress level can be determined. For details of this test see annex C.

6.5.2 For percussive tools with rotation driven by the motion of the hammer piston, the rotation mechanism shall be run without any torque applied to the working tool during the testing of impact energy.

6.5.3 If the impact energy is measured as described in annex C, the measurement accuracy may be estimated at $\pm 10\%$.

6.6 Blow rate

6.6.1 The measurement of the blow rate can be made with the help of any signal which is clearly related to the number of blows of the tool, for example movements of the working tool or number of stress pulses in the same, pressure fluctuations in the compressed air line in the neighbourhood of the inlet of the tool or movements of the working piston or the valve. These different pulses can be recorded by means of suitable pick-ups and recorders with a time marker. By counting the number of signal pulses during a certain time period the blow rate can be calculated.

6.6.2 Since the blow rate of a percussive tool is dependent upon the reflections of the impact wave at the bit end, the measurement of the blow rate shall be made under normal working conditions for the tool. For example, for a rock drill the blow rate measurements shall be performed during actual drilling in rock.

6.6.3 The accuracy of a properly performed blow rate measurement can be expected to be better than $\pm 2\%$.

6.7 Power output

6.7.1 Rotary pneumatic tools

In the case of a pneumatic rotary tool the power output is calculated from shaft speed and corresponding torque measured in the brake. The power output is :

$$P = \frac{M \times \omega}{1\,000}$$

where

P is the power, in kilowatts;

M is the torque, in newton metres;

ω is the angular velocity, in radians per second.

The power is calculated for each pair of values of torques and shaft speed. A diagram of power versus shaft speed is drawn. From this diagram the shaft speed at maximum power can be estimated. At this speed the power is accurately measured.

In the test report the measured maximum power and the corresponding shaft speed shall be stated.

The accuracy of the calculated power output for the pneumatic tool depends upon the accuracy of shaft speed and torque measurement. With the accuracy mentioned in 6.3.3 and 6.4.2 the accuracy of the calculated power output value can be estimated to be better than $\pm 5\%$.

6.7.2 Percussive pneumatic tools

In the case of a pneumatic percussive tool the power output of the tool is calculated by multiplying blow rate and impact energy per blow according to the following formula :

$$P = 10^{-3} e f$$

where

P is the power, in kilowatts;

e is the impact energy, in joules;

f is the blow rate, in hertz.

In the test report the calculated power output of the percussive tool shall be stated.

The accuracy of the calculated power output of the pneumatic percussive tool depends upon the accuracy of impact energy and blow rate according to 6.5.3 and 6.6.3 respectively. The accuracy of the power output can thus be estimated to be better than $\pm 12\%$.

6.8 Air consumption

6.8.1 The air consumption or volume rate of flow when measured at the inlet to the tool remains constant when the tool is equally loaded regardless of the inlet temperature or small changes in inlet pressure. The air consumption of a tool is generally quoted in cubic metres per minute or litres per second of free air and is calculated from the measured inlet flow to the tool converted to a free air at a reference atmosphere of :

- pressure : 1 bar;
- temperature : 20 °C;
- humidity : 65 %.

The quoted air consumption can be compared with compressor capacity provided the temperature at the tool inlet is the same as the compressor inlet.

6.8.2 The air consumption of the pneumatic tools shall be measured on the inlet side of the tool i.e. in the compressed air line to the tool.

6.8.3 The measurements can be carried out using flow nozzles, other pressure differential devices, turbine flow meters etc., the accuracy and calibration of which is known. The measurements shall be corrected if the conditions in the flow meter deviate from those for which it was calibrated.

6.8.4 With a properly performed measurement of the air consumption, the result of the measurement can be assumed to have maximum deviation $\pm 5\%$ from the true value.

Annex A

Format for pneumatic tools test report Rotary tool

The following test has been made in accordance with International Standard ISO 2787.

A.1 Subject

Manufacturer

Type of machine Model

Serial No.

A.2 Operating conditions

Maximum load/no-load. Effective air pressure in inlet bar

Shaft rotational frequency min⁻¹

Compressed air temperature °C

Type of lubricant

A.3 Test conditions

Atmospheric pressure (absolute) bar Ambient temperature °C

Tool air inlet effective (gauge) pressure bar Tool air inlet temperature °C

A.4 Instrumentation

.....

.....


.....

A.5 Test results

A.5.1 Air consumption measured l/s Corrected l/s

A.5.2 Reciprocal minutes/torque measurement

Shaft reciprocal frequency (min ⁻¹)						
Torque (Nm)						
Calculated power output (kW)						

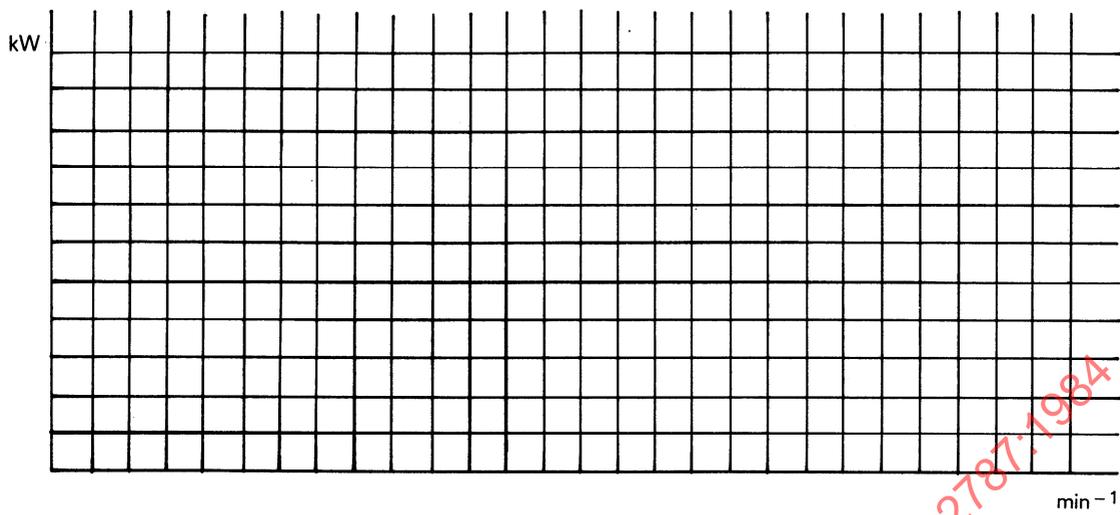

A.5.3 Shaft rotational frequency at maximum power : min⁻¹

A.5.4 Torque measured at shaft rotational frequency at maximum power	Nm					
Calculated power output	kW					

A.6 Test remarks

.....

Reported by : Date

Approved by : Date

STANDARDSISO.COM : Click to view the full PDF of ISO 2787:1984

Annex B

Format for pneumatic tools test report Percussive tool (with or without rotation)

The following test has been made in accordance with International Standard ISO 2787.

B.1 Subject

Manufacturer

Type of machine Model

Serial No.

B.2 Operating conditions

Effective air pressure in inlet : bar

Compressed air temperature °C

Length of hose : m Lubricant

B.3 Test conditions

Atmospheric pressure bar Ambient temperature °C

Humidity %

B.4 Instrumentation (special attention shall be paid to description of energy-absorbing means)

.....

.....

.....

B.5 Test results

B.5.1 Air consumption measured l/s Corrected l/s

Information according to manufacturer's technical specification concerning air consumption

B.5.2 Result

Blow rate (Hz)					
Impact energy per blow (J) (mean value)					
Rate of rotation at no-load (min ⁻¹) or minimum torque					

B.6 Test remarks

B.6.1 Length of measuring rod mm

B.6.2 Diameter of measuring rod mm

B.6.3 Length of striking piston mm

B.6.4 Load applied to machine tested N

B.6.5 Information about drop test
.....
.....
.....

B.6.6 Sketch showing measuring rod with positions of strain gauges

B.6.7 Further test remarks
.....
.....
.....

Reported by : Date :

Approved by : Date :

STANDARDSISO.COM : Click to view the full PDF of ISO 2787:1984