
INTERNATIONAL STANDARD



3015

INTERNATIONAL ORGANIZATION FOR STANDARDIZATION • МЕЖДУНАРОДНАЯ ОРГАНИЗАЦИЯ ПО СТАНДАРТИЗАЦИИ • ORGANISATION INTERNATIONALE DE NORMALISATION

Petroleum oils — Determination of cloud point

Huiles de pétrole — Détermination du point de trouble

First edition — 1974-05-01

STANDARDSISO.COM : Click to view the full PDF of ISO 3015:1974

UDC 665.7.035.2

Ref. No. ISO 3015-1974 (E)

Descriptors : petroleum products, oils, tests, low temperature tests, cloud point, determination, test equipment.

FOREWORD

ISO (the International Organization for Standardization) is a worldwide federation of national standards institutes (ISO Member Bodies). The work of developing International Standards is carried out through ISO Technical Committees. Every Member Body interested in a subject for which a Technical Committee has been set up has the right to be represented on that Committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work.

Draft International Standards adopted by the Technical Committees are circulated to the Member Bodies for approval before their acceptance as International Standards by the ISO Council.

International Standard ISO 3015 was drawn up by Technical Committee ISO/TC 28, *Petroleum products*, and circulated to the Member Bodies in March 1973.

It has been approved by the Member Bodies of the following countries :

| | | |
|---------------------|-------------|-----------------------|
| Australia | Germany | Portugal |
| Austria | Hungary | Romania |
| Belgium | India | South Africa, Rep. of |
| Brazil | Iran | Spain |
| Bulgaria | Israel | Sweden |
| Canada | Mexico | Thailand |
| Chile | Netherlands | Turkey |
| Czechoslovakia | New Zealand | United Kingdom |
| Egypt, Arab Rep. of | Norway | U.S.A. |
| France | Poland | U.S.S.R. |

No Member Body expressed disapproval of the document.

Petroleum oils – Determination of cloud point

1 SCOPE AND FIELD OF APPLICATION

This International Standard specifies a method for the determination of the cloud point of petroleum oils which are transparent in layers 40 mm in thickness, and have a cloud point below 49 °C.

2 DEFINITION

cloud point: The temperature at which a clear liquid product becomes hazy or cloudy due to the appearance of wax crystals when the test is conducted under standardized conditions.

3 PRINCIPLE

The sample is cooled at a specified rate and examined periodically. The temperature at which haziness is first observed at the bottom of the test jar is recorded as the cloud point.

4 APPARATUS (see figure)

4.1 Test jar, cylindrical, of clear glass, flat bottomed, 30 to 33,5 mm in inside diameter and 115 to 125 mm in height. The jar should be marked with a line to indicate a sample volume of 45 ml. Jars marked with upper and lower permitted levels, ± 3 mm of the sample volume line, are allowed.

Dimensions in millimetres

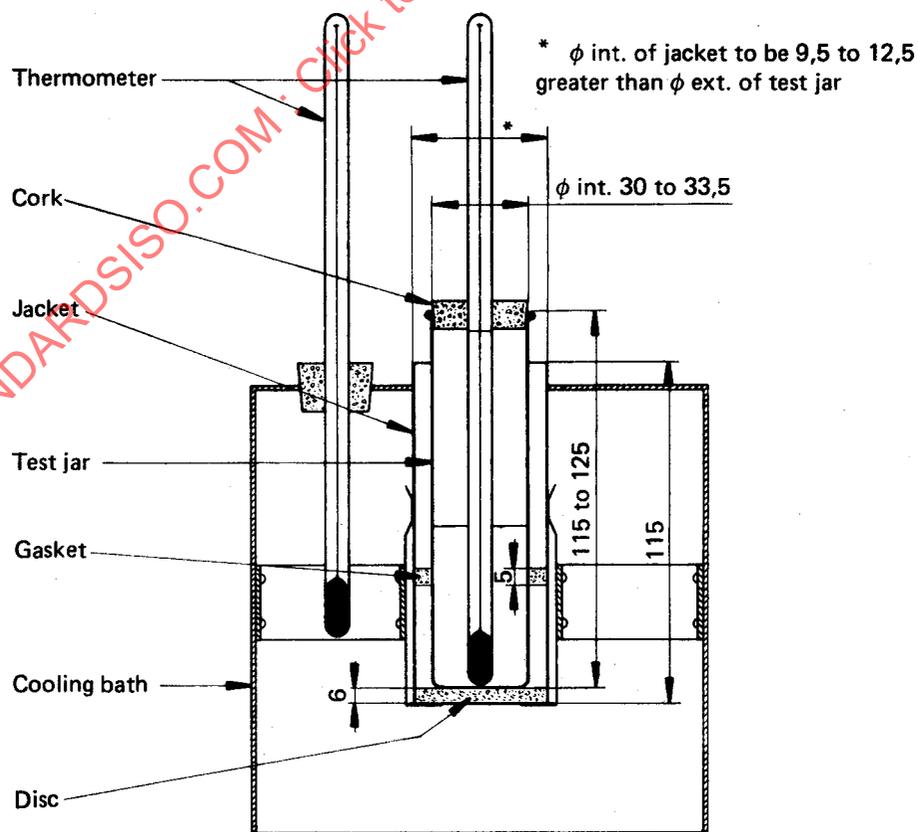


FIGURE – Apparatus for cloud point test

4.2 Thermometers, partial immersion type conforming to the following specifications :

| Specification | High cloud and pour | Low cloud and pour |
|---|----------------------------|---|
| Range | -38 to + 50 °C | -80 to + 20 °C |
| Immersion | 108 mm | 76 mm |
| Graduation at each | 1 °C | 1 °C |
| Longer lines at each | 5 °C | 5 °C |
| Figured at each | 10 °C | 10 °C |
| Scale error not to exceed | 0,5 °C | 1 °C down to - 33 °C, 2 °C below - 33 °C |
| Expansion chamber permitting heating to | 100 °C | 60 °C |
| Overall length | 231 ± 5 mm | 232 ± 5 mm |
| Stem diameter | 7 to 8 mm | 7 to 8 mm |
| Bulb length | 7,0 to 9,5 mm | 8,0 to 9,5 mm |
| Bulb diameter | 5,5 to 7,0 mm | 5,0 to 6,5 mm |
| Distance from bottom of bulb to line at | - 38 °C : 120 to 130 mm | - 57 °C : 120 to 130 mm |
| Distance from bottom of bulb to line at | 49 °C : 195 to 205 mm | 20 °C : 182 to 196 mm |

4.3 Cork, to fit the test jar, bored centrally to take the test thermometer.

4.4 Jacket, watertight, cylindrical, of glass or metal, flat-bottomed, about 115 mm in depth, with inside diameter 9,5 to 12,5 mm greater than the outside diameter of the test jar.

4.5 Disc, of cork or felt, 6 mm in thickness and of the same diameter as the inside of the jacket.

4.6 Gasket, ring form, about 5 mm in thickness, to fit snugly around the outside of the test jar and loosely inside the jacket. This gasket may be made of cork, felt, or other suitable material, elastic enough to cling to the test jar and hard enough to hold its shape. The purpose of the ring gasket is to prevent the test jar from touching the jacket.

4.7 Cooling bath, of a type suitable for obtaining the required temperatures. The size and shape of the bath are optional, but a support to hold the jacket firmly in a vertical position is essential. For the determination of cloud

points below 10 °C two or more baths are needed. The required bath temperatures may be maintained by refrigeration or by suitable freezing mixtures.

NOTE — The freezing mixtures commonly used are as follows :

For temperatures down to

- 10 °C : ice and water
- 12 °C : crushed ice and sodium chloride crystals
- 26 °C : crushed ice and calcium chloride crystals
- 57 °C : solid carbon dioxide and acetone or petroleum naphtha¹⁾

5 PROCEDURE

5.1 Bring the oil to be tested to a temperature at least 14 °C above the approximate cloud point. Remove any moisture present by any suitable method, such as by filtration through dry lintless filter paper, until the oil is perfectly clear, but make such filtration at a temperature of at least 14 °C above the approximate cloud point.

5.2 Pour the clear oil into the test jar to the level mark, or to a level between the two etched lines according to type.

5.3 Close the test jar tightly by the cork carrying the test thermometer (see note). Use the high cloud and pour thermometer if the expected cloud point is above - 38 °C and the low cloud and pour thermometer if the expected cloud point is below - 38 °C. Adjust the position of the cork and the thermometer so that the cork fits tightly, the thermometer and the jar are coaxial, and the thermometer bulb is resting on the bottom of the jar.

NOTE — Since separation of the mercury or toluene thread of cloud and pour thermometers occasionally occurs, and since such separation may otherwise escape immediate detection, it is suggested that the ice points of the thermometers be checked immediately prior to the test. Any thermometer that shows an ice point differing from 0 °C by more than 1 °C should be further examined or recalibrated, or both, before use.

5.4 Place the disc in the bottom of the jacket. Place the ring gasket around the test jar, 25 mm from the bottom. The disc, gasket, and inside and outside of the jacket shall be clean and dry. Insert the test jar in the jacket.

5.5 Maintain the temperature of the cooling bath at - 1 to + 2 °C. Support the jacket containing the test jar firmly in a vertical position in the cooling bath so that not more than 25 mm of the jacket projects out of the cooling medium.

1) This mixture may be made as follows : in a covered metal beaker chill a suitable amount of acetone or petroleum naphtha to - 12 °C, or lower, by means of an ice-salt mixture. Then add enough solid carbon dioxide to the chilled acetone or petroleum naphtha to give the desired temperature. Solid carbon dioxide is commercially available in many areas. If necessary, it may be prepared as follows : invert a cylinder of liquid carbon dioxide and draw off carefully into a chamois skin bag the desired amount of carbon dioxide which, through rapid evaporation, becomes solid.