
**Rubber, vulcanized — Determination of
temperature rise and resistance to fatigue
in flexometer testing —**

Part 1:
Basic principles

*Caoutchouc vulcanisé — Détermination de l'élévation de température et
de la résistance à la fatigue dans les essais aux flexomètres —*

Partie 1: Principes fondamentaux

STANDARDSISO.COM : Click to view the full PDF of ISO 4666-1:2010



PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 4666-1:2010



COPYRIGHT PROTECTED DOCUMENT

© ISO 2010

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

Contents

Page

| | |
|--|----|
| Foreword | iv |
| Introduction..... | v |
| 1 Scope | 1 |
| 2 Normative references | 1 |
| 3 Terms and definitions | 1 |
| 4 Test conditions | 3 |
| 5 Test pieces | 3 |
| 5.1 Form and dimensions | 3 |
| 5.2 Preparation..... | 3 |
| 5.3 Time interval between vulcanization and testing..... | 4 |
| 5.4 Conditioning | 4 |
| 5.5 Number | 4 |
| 6 Apparatus | 4 |
| 6.1 General | 4 |
| 6.2 Temperature-controlled cabinet | 4 |
| 6.3 Measurement of temperature | 4 |
| 7 Procedure..... | 5 |
| 7.1 General | 5 |
| 7.2 Temperature of test..... | 5 |
| 7.3 Measurement of temperature rise..... | 5 |
| 7.4 Determination of fatigue life..... | 5 |
| 7.5 Determination of limiting fatigue deformability and limiting fatigue stress..... | 5 |
| 7.6 Determination of creep | 6 |
| 7.7 Determination of set..... | 6 |
| 8 Test report..... | 6 |
| Annex A (informative) Explanatory notes..... | 7 |
| Bibliography..... | 9 |

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 4666-1 was prepared by Technical Committee ISO/TC 45, *Rubber and rubber products*, Subcommittee SC 2, *Testing and analysis*.

This second edition cancels and replaces the first edition (ISO 4666-1:1982), which has been technically revised.

ISO 4666 consists of the following parts, under the general title *Rubber, vulcanized — Determination of temperature rise and resistance to fatigue in flexometer testing*:

- *Part 1: Basic principles*
- *Part 2: Rotary flexometer*
- *Part 3: Compression flexometer (constant-strain type)*
- *Part 4: Constant-stress flexometer*

Introduction

All rubbers show viscoelastic behaviour. When subjected to cyclic deformation, they absorb a part of the deformation energy and convert this into heat. The heat generated leads to a temperature rise, which can be considerable in the interior of relatively thick components because of the low thermal conductivity of rubbers. In cases where the cyclic deformation is large or the temperature reaches high values, it is possible for damage to the rubber to occur through fatigue-initiated breakdown. The breakdown begins in the interior of the rubber, spreads outwards, and can finally lead to the complete breakdown of the component.

The tests specified in the various parts of this International Standard yield either temperature rise data or the fatigue life of the rubber under given test conditions. Measurement of fatigue life over a range of conditions can be used to determine the limiting fatigue deformability or limiting fatigue stress of the rubber. The instruments used, commonly called flexometers, subject test pieces to cycles of either constant-stress amplitude or constant-strain amplitude.

A distinction should be made between flexometer tests and fatigue tests conducted on thin test pieces undergoing tensile deformation or bending. In the fatigue tests, the temperature rise is generally negligible owing to the rapid dissipation of heat generated, and failure results from the initiation and growth of cracks which ultimately sever the test piece. ISO 132^[1] specifies tests for the determination of flex cracking and cut growth using the De Mattia-type machine. The determination of resistance to tension fatigue is specified in ISO 6943^[3].

STANDARDSISO.COM : Click to view the full PDF of ISO 4666-1:2010

[STANDARDSISO.COM](https://standardsiso.com) : Click to view the full PDF of ISO 4666-1:2010

Rubber, vulcanized — Determination of temperature rise and resistance to fatigue in flexometer testing —

Part 1: Basic principles

1 Scope

This part of ISO 4666 establishes general principles for flexometer testing and defines the terms used.

Flexometer testing makes possible predictions regarding the durability of rubbers in finished articles subject to dynamic flexing in service such as tyres, bearings, supports, V-belts, and cable-pulley insert rings. However, owing to the wide variations in service conditions, no simple correlation between the accelerated tests specified in the various parts of this International Standard and service performance can be assumed.

2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 4664-1:—¹⁾, *Rubber, vulcanized or thermoplastic — Determination of dynamic properties — Part 1: General guidance*

ISO 23529, *Rubber — General procedures for preparing and conditioning test pieces for physical test methods*

3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 4664-1 and the following apply.

3.1

loading

subjection of the test piece to a predetermined stress or strain, either static or cyclic

3.2

pre-stress

σ_p

constant static stress to which the test piece is subjected during the test

NOTE 1 Pre-stress is expressed in pascals.

NOTE 2 Pre-stress can be used to simulate product requirements or simply to hold the test piece in the apparatus.

NOTE 3 The term “mean stress” (ISO 4664-1:—) is equivalent or near equivalent to “pre-stress”.

1) To be published. (Revision of ISO 4664-1:2005)

3.3

pre-strain

ε_p
constant static strain to which the test piece is subjected during the test

NOTE 1 Pre-strain can be used to simulate product requirements or simply to hold the test piece in the apparatus.

NOTE 2 The term “mean strain” (ISO 4664-1:—) is equivalent or near equivalent to “pre-strain”.

3.4

cyclic stress amplitude

σ_a
 τ_a
ratio of the force amplitude (cyclic force) superimposed upon the pre-strain or pre-stress to the appropriate cross-sectional area of the unstressed test piece

NOTE 1 Cyclic stress amplitude is expressed in pascals.

NOTE 2 The term “maximum stress amplitude” (ISO 4664-1:—) is equivalent or near equivalent to “cyclic stress amplitude”.

3.5

cyclic strain amplitude

ε_a
 γ_a
deformation amplitude (cyclic deformation) superimposed upon the pre-strain or pre-stress

NOTE 1 For certain flexometers, the cyclic strain is smaller than the pre-strain.

NOTE 2 In a compression flexometer, the pre-stress, σ_p , acts in the same direction as the cyclic strain amplitude, ε_a . In a rotary flexometer, a cyclic shear strain, γ_a , or cyclic shear stress, τ_a , acts at right angles to an axial compression pre-strain, ε_p , or axial compression pre-stress, σ_p .

NOTE 3 The term “maximum strain amplitude” (ISO 4664-1:—) is equivalent or near equivalent to “cyclic strain amplitude”.

3.6

heat generation

total heat generated in the test piece by energy absorption during the test

NOTE “Heat generation” should be distinguished from the deprecated, but sometimes used, expression “heat build-up”, which is normally associated with the temperature rise in the test piece.

3.7

temperature rise

increase in temperature of the test piece

NOTE The temperature rise is taken as the difference between the temperature measured at a given point in the test piece at a given time during the test and either the temperature at the beginning of the test or the ambient temperature.

3.8

fatigue breakdown

change in chemical structure, physical structure or composition of the test piece under the simultaneous action of stress and temperature

3.9

fatigue life

N
number of cycles required to produce failure or breakdown under a given static and cyclic loading

3.10**fatigue deformability**

cyclic strain amplitude corresponding to a given fatigue life

3.11**fatigue stress**

cyclic stress amplitude corresponding to a given fatigue life

3.12**limiting fatigue deformability**
 ε_{∞}
 γ_{∞}

cyclic strain amplitude at which the fatigue life curve becomes essentially parallel to the log N axis

See Figure 1.

3.13**limiting fatigue stress**
 σ_{∞}
 τ_{∞}

cyclic stress amplitude at which the fatigue life curve becomes essentially parallel to the log N axis

See Figure 1.

4 Test conditions

The relative ratings of rubbers having different moduli depend upon the type of loading used to evaluate them:

- a) σ_p and σ_a or τ_a constant;
- b) σ_p and ε_a or γ_a constant;
- c) ε_p and σ_a or τ_a constant;
- d) ε_p and ε_a or γ_a constant.

Both the type and magnitude of loading should be governed by the intended use of the rubber. In tests for heat generation, the magnitude should be high enough to generate a temperature rise that is sufficient to be discriminating, but not high enough to cause breakdown.

In tests for fatigue life, choose the loading that yields results capable of discriminating between materials.

NOTE It is also possible to conduct tests under constant-strain energy conditions.

5 Test pieces**5.1 Form and dimensions**

Test pieces for flexometer testing shall be cylindrical. Dimensions differ according to the test method used.

5.2 Preparation

Test pieces shall be prepared and stored in accordance with ISO 23529. Test pieces may be prepared by vulcanization in moulds, or from slabs or finished parts by cutting, boring, and buffing. If test pieces are cut from a finished part, this shall be mentioned in the test report.

5.3 Time interval between vulcanization and testing

See ISO 23529.

For all test purposes, the minimum time between vulcanization and testing shall be 16 h.

For non-product tests, the maximum time between vulcanization and testing shall be 4 weeks and for evaluations intended to be comparable, the tests, as far as possible, should be carried out after the same time interval.

For product tests, whenever possible, the time between vulcanization and testing should not exceed 3 months. In other cases, tests shall be made within 2 months of the date of receipt of the product by the customer.

5.4 Conditioning

Before testing, test pieces shall be conditioned for at least 3 h at one of the standard laboratory temperatures specified in ISO 23529.

5.5 Number

Two test pieces of each rubber shall be used for measurement of either the temperature rise under a specified loading or the fatigue life under a specified loading. More test pieces are needed if confidence limits are to be established. For plotting fatigue life curves, at least five and preferably 10 test pieces should be provided.

6 Apparatus

6.1 General

Only general requirements for test machines (flexometers) are considered here. Typical machines are described in ISO 4666-2, ISO 4666-3 and ISO 4666-4, but other machines may be used provided that they fulfil the basic requirements of this part of ISO 4666 and provided that all comparative tests are carried out on the same type of machine.

Construction shall be sturdy and precise. The imposed test conditions shall be constant for any single test series, but adjustments shall be possible from one series to the next.

Readings or recordings, whether by mechanical, optical or electrical means, shall have adequate sensitivity.

6.2 Temperature-controlled cabinet

For tests conducted at elevated temperature, an adequately thermostated enclosure meeting the requirements of ISO 23529 shall be provided.

6.3 Measurement of temperature

For measurement of the temperature rise, heat losses by conduction into the test apparatus should be kept low, e.g. by insulation of the surfaces in contact with the test pieces.

Two methods of measuring the temperature of the test piece are available. The permissible error in the temperature measurement is ± 1 °C. The method to be used is specified in the relevant part of this International Standard.

The temperature in the interior of the test piece may be measured. Temperature can be measured by the insertion of a fine needle probe temperature sensor, or the probe may be inserted at particular times during the test when the test piece is free from stress so that the temperature sensor is closely surrounded by the rubber. It may also be embedded continuously in the test piece.

Alternatively, the temperature may be measured at the test piece surface (or on a surface in contact with the test piece).

These two methods of temperature measurement differ fundamentally in that the thermal conductivity and surface emissivity of the rubber enter into the measured values in a different manner.

7 Procedure

7.1 General

The exact procedures depend on the particular test method used: the rotary flexometer is described in ISO 4666-2; the compression flexometer is described in ISO 4666-3; and the constant-stress flexometer is described in ISO 4666-4. The basic principles in 7.2 to 7.7 are applicable to all test methods.

7.2 Temperature of test

The tests shall normally be carried out at one of the temperatures specified in ISO 23529.

7.3 Measurement of temperature rise

The initial temperature of all test pieces to be compared shall be the test temperature. The temperature rise of a specific point in the test piece shall be determined after a running time that is long enough to produce thermal equilibrium.

7.4 Determination of fatigue life

Test pieces shall be subjected to the type and magnitude of loading specified (see Clause 4) and the number of cycles to breakdown shall be recorded in each case. A suitable means of assessing the onset of breakdown shall be used and shall be the same for all comparative tests. In all cases, after the termination of the test, a check shall be made by a visual examination of the sectioned test pieces to ensure that the level of damage is comparable.

Test conditions shall not be altered during the course of the test and shall be the same when comparing several rubbers. If fatigue life is to be determined under one set of test conditions only, the imposed cyclic strain amplitude or stress amplitude shall normally be greater than the limiting fatigue deformability or limiting fatigue stress of the rubber.

7.5 Determination of limiting fatigue deformability and limiting fatigue stress

For the estimation of the limiting fatigue deformability or limiting fatigue stress of the rubber, the fatigue life shall be determined over a range of cyclic strain amplitudes or cyclic stress amplitudes, including that region in which it becomes very long and virtually indefinite. To accomplish this, several test pieces shall be subjected to suitably spaced loadings and the corresponding numbers of cycles to breakdown shall be measured.

The fatigue lives so obtained shall be plotted as a function of the cyclic strain amplitude, ϵ_a , or cyclic stress amplitude, σ_a (see Figure 1). The limiting fatigue deformability and the limiting fatigue stress shall be taken as, respectively, the cyclic strain amplitude and the cyclic stress amplitude at which the fatigue life curve becomes essentially parallel to the fatigue life axis.

If required, a plot of fatigue life against cyclic strain amplitude or cyclic stress amplitude can be used to calculate the fatigue deformability or fatigue stress for a given fatigue life. In this case, it is not necessary to undertake tests at cyclic strain amplitudes or cyclic stress amplitudes where the fatigue life approaches infinity.

7.6 Determination of creep


When it is appropriate and when it is required, creep shall be measured or registered by a recorder as the change in height of the test piece or the movement of a contact platen during the test, recorded at suitable intervals of time. The creep is calculated relative to the initial height of the undeformed or unstressed test piece.

7.7 Determination of set

When it is appropriate and when it is required, set shall be calculated from the difference between the initial height of the test piece in the undeformed or unstressed condition and the height of the test piece at the end of the test after a specified recovery period; it shall be reported as a percentage of the initial height. The recovery period chosen shall be sufficiently long for the recovery to reach substantially its asymptotic value.

8 Test report

The results shall be reported as specified in the relevant part of this International Standard.

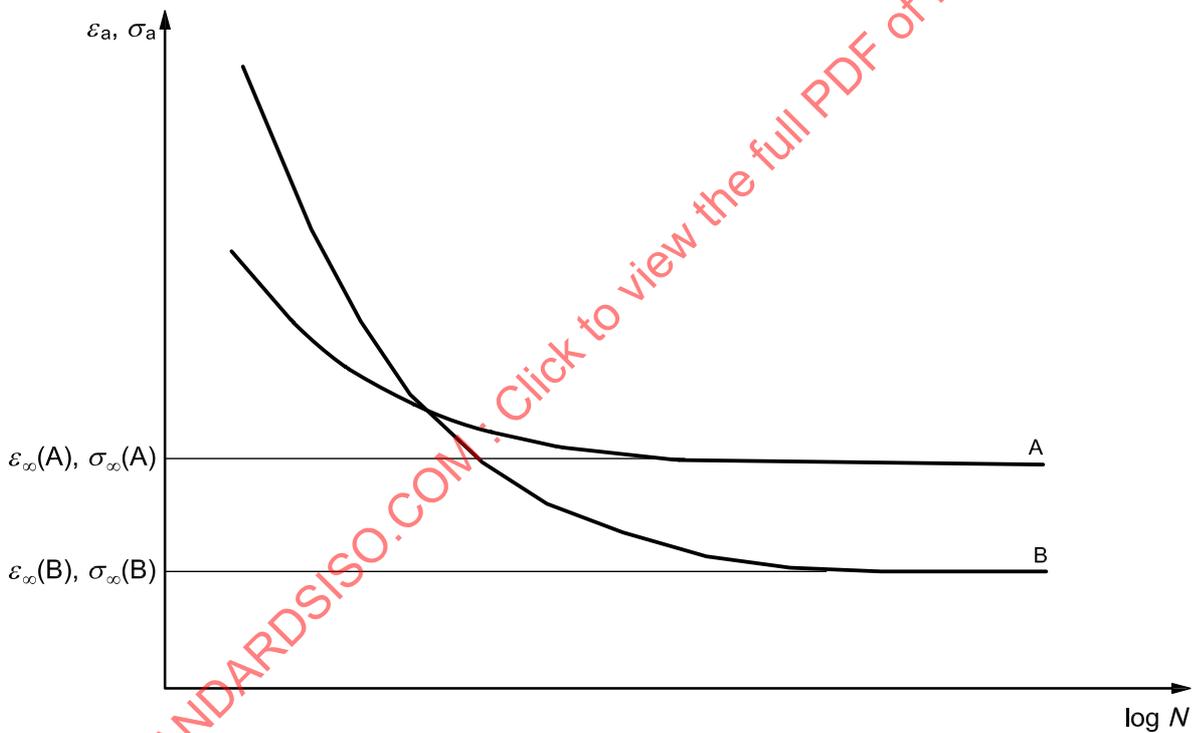

Key

- | | | | |
|----------------------|--|--------------------|-------------------------------------|
| ϵ_a | limiting fatigue deformability | σ_a | limiting fatigue stress |
| $\epsilon_\infty(A)$ | limiting fatigue deformability of rubber A | $\sigma_\infty(A)$ | limiting fatigue stress of rubber A |
| $\epsilon_\infty(B)$ | limiting fatigue deformability of rubber B | $\sigma_\infty(B)$ | limiting fatigue stress of rubber B |
| A | rubber A | B | rubber B |
| N | fatigue life | | |

Figure 1 — Fatigue life curves for two rubbers, A and B