

INTERNATIONAL STANDARD

ISO 9017

First edition
2001-04-01

Destructive tests on welds in metallic materials — Fracture test

*Essais destructifs des soudures sur matériaux métalliques — Essai de
texture*

STANDARDSISO.COM : Click to view the full PDF of ISO 9017:2001



Reference number
ISO 9017:2001(E)

© ISO 2001

PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 9017:2001

© ISO 2001

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.ch
Web www.iso.ch

Printed in Switzerland

Contents

	Page
Foreword.....	iv
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Principle.....	2
5 Symbols and abbreviated terms	2
6 Dimensions of test pieces	4
7 Removal of test specimens	6
7.1 General.....	6
7.2 Marking	6
7.3 Extraction	6
7.4 Preparation.....	6
8 Test procedure.....	9
8.1 Butt welds.....	9
8.2 Fillet welds.....	11
8.3 Special recommendations for ductile weld metals	11
9 Test result.....	12
10 Test report.....	12
Annex A (informative) Example of a test report.....	13

STANDARDSISO.COM : Click to view the full PDF of ISO 9017:2001

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 3.

Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this International Standard may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

International Standard ISO 9017 was prepared by Technical Committee ISO/TC 44, *Welding and allied processes*, Subcommittee SC 5, *Testing and inspection of welds*.

Annex A of this International Standard is for information only.

STANDARDSISO.COM : Click to view the full PDF of ISO 9017:2001

Destructive tests on welds in metallic materials — Fracture test

1 Scope

This International standard specifies the sizes of test specimen and the procedures for carrying out fracture tests in order to obtain information about types, sizes and distribution of internal imperfections such as porosities, cracks, lack of fusion, lack of penetration and solid inclusions on the fracture surface.

This International Standard applies to metallic materials in all forms of product with joints made by any fusion welding process with a thickness greater or equal to 2 mm.

2 Normative references

The following normative documents contain provisions which, through reference in this text, constitute provisions of this International Standard. For dated references, subsequent amendments to, or revisions of, any of these publications do not apply. However, parties to agreements based on this International Standard are encouraged to investigate the possibility of applying the most recent editions of the normative documents indicated below. For undated references, the latest edition of the normative document referred to applies. Members of ISO and IEC maintain registers of currently valid International Standards.

ISO 5817:—¹, *Welding — Fusion-welded joints in steel, nickel, titanium and their alloys (beam welding excluded) — Quality levels for imperfections.*

ISO 10042, *Arc-welded joints in aluminium and its weldable alloys — Guidance on quality levels for imperfections.*

EN 970, *Non-destructive examination of fusion welds — Visual examination.*

3 Terms and definitions

For the purposes of this International Standard, the following terms and definitions apply.

3.1 examination length

L_f
length of the test specimen measured along the weld axis between any side notches

See Figure 6.

3.2 total examination length

ΣL_f
sum of the lengths of all the test specimens comprising the test piece, measured along the weld axis, of the fracture faces between the side notches of the test specimens

See Figure 6.

1) To be published. (Revision of ISO 5817:1992)

**3.3
examination thickness**

a_f
thickness of the fracture area for each test specimen

See Figures 7 and 8.

**3.4
examination area**

A_f
product of the examination length and the examination thickness for each test specimen

**3.5
total examination area**

ΣA_f
sum of all examination areas

4 Principle

Fracture the joint through the weld metal in order to examine the fracture surface. The fracture can be induced by bending or tension, static or dynamic loading. Furthermore, notch dimensions and temperature can be varied to induce the fracture.

Unless otherwise specified, the test shall be carried out at ambient temperature (23 ± 5) °C.

5 Symbols and abbreviated terms

The symbols and abbreviated terms to be used for fracture tests are specified in Table 1 and represented in Figures 5 to 8.

Normally, it is sufficient to give the basic denomination, but for special applications, additional denominations about the notching and test method can be requested.

EXAMPLE 1 Test specimen taken from a fillet weld with an examination length of 40 mm and examination thickness of 10 mm.

Without any requirement about notching and test method:

Basic denomination: $FW/(L_f a_f)$

i.e. for this example:

$FW/(40 \times 10)$

With additional requirement (square face notching and test method):

Comprehensive denomination: $FW/(L_f a_f)/Fq$

See Figure 8

i.e. for this example:

$FW/(40 \times 10)/Fq$

See Figure 8

EXAMPLE 2 Test specimen taken from a butt weld with an examination length of 40 mm and examination thickness of 10 mm.

Without any requirement about notching and test method:

Basic denomination: BW/($L_f a_f$)

i.e. for this example:

BW/(40 × 10)

With additional requirement (round side notching and test method):

Comprehensive denomination: BW/($L_f a_f$)/Sr

See Figure 6

i.e. for this example:

BW/(40 × 10)/Sr

See Figure 6

Table 1 — Symbols and abbreviated terms

Denomination	Symbol or abbreviated term	Unit
Butt weld Fillet weld	BW FW	— —
Thickness of test piece Length of test piece Outside diameter of tube	t, t_1, t_2 l_1, l_2 D	mm mm mm
Test specimen and test piece examination length examination thickness examination area area of imperfections	L_f a_f A_f A_i	mm mm mm ² mm ²
Side notch square (q) round (r) sharp (s)	S Sq Sr Ss	— — — —
Longitudinal notch Face notch square (q) round (r) sharp (s) Root notch square (q) round (r) sharp (s)	F Fq Fr Fs R Rq Rr Rs	— — — — — — — —

6 Dimensions of test pieces

Unless otherwise specified by the application standard or by agreement between the contracting parties, test piece dimensions shall be in accordance with Figures 1 to 4. The test piece shall provide sufficient test specimens for the required total examination length (ΣL_f) and area (ΣA_f).

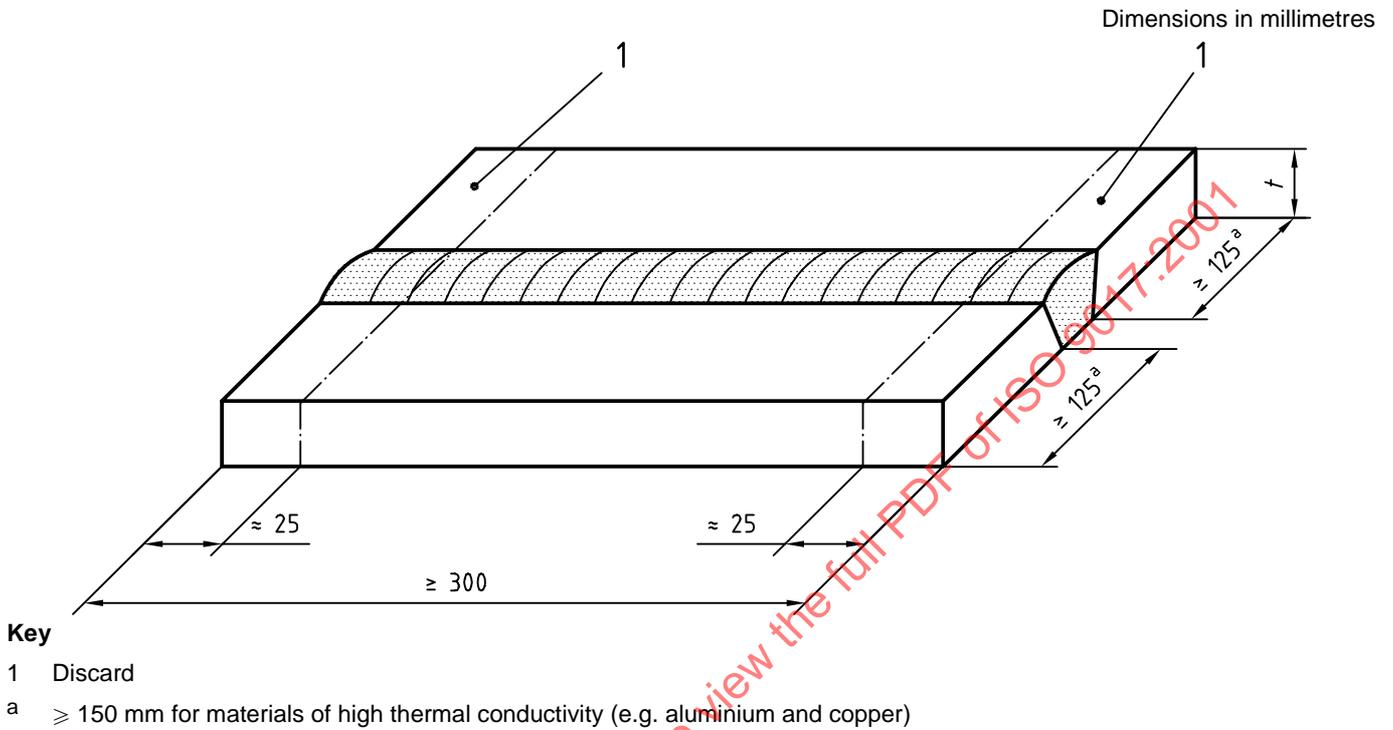


Figure 1 — Test piece for butt welds in plate


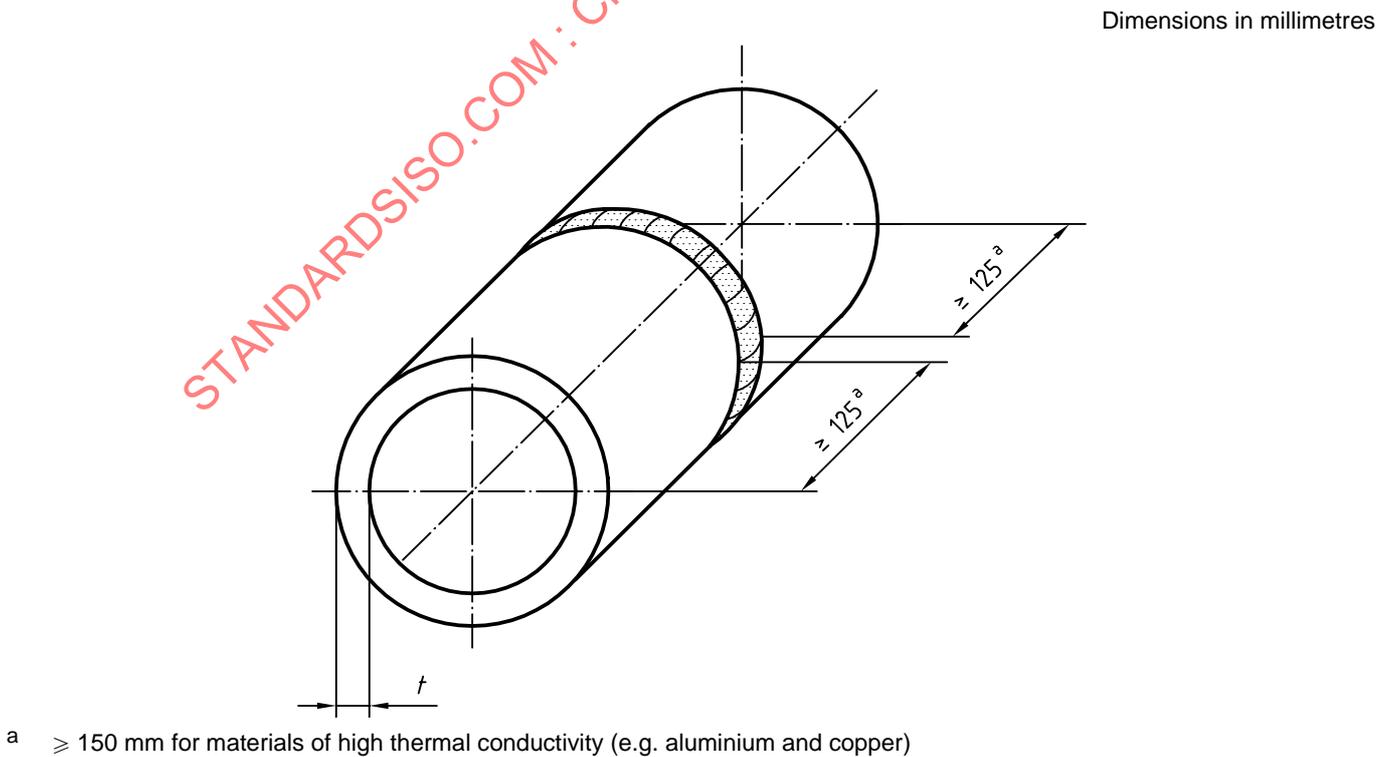


Figure 2 — Test piece for butt welds in pipe

Dimensions in millimetres

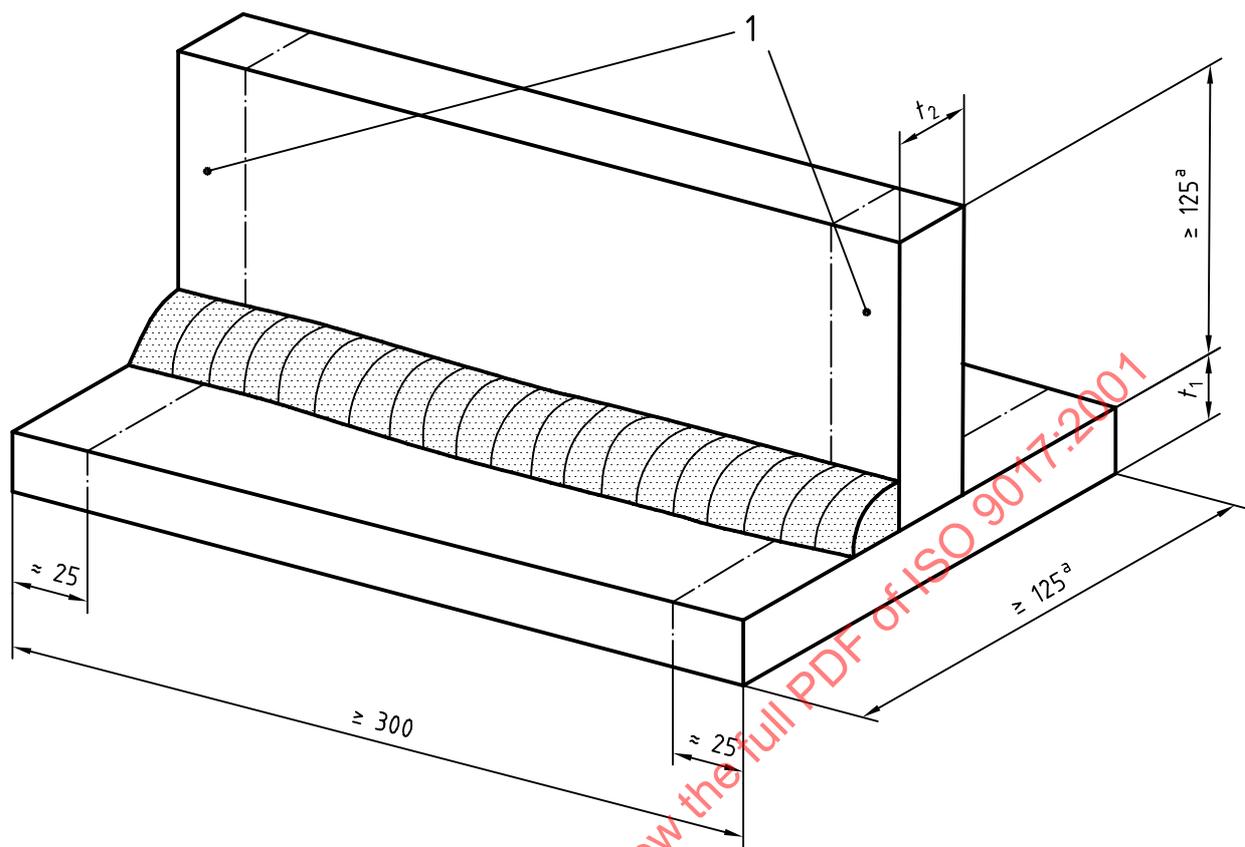


Key

1 Discard

a ≥ 150 mm for materials of high thermal conductivity (e.g. aluminium and copper)

Figure 3 — Test piece for fillet welds on plate

Dimensions in millimetres

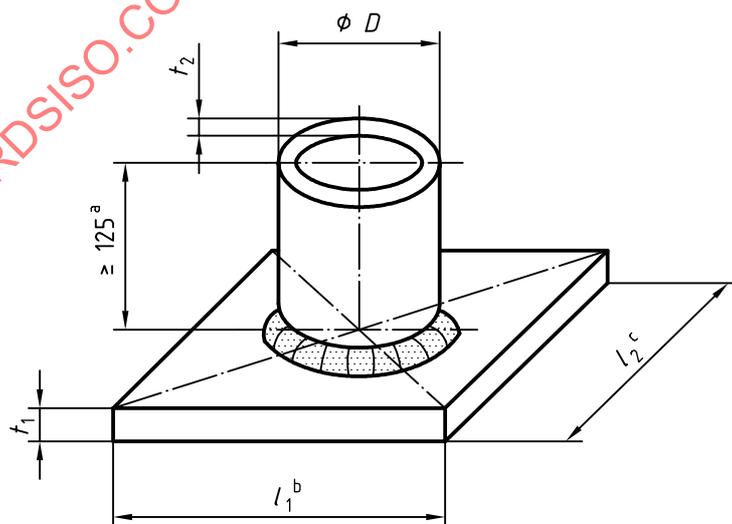

a ≥ 150 mm for materials of high thermal conductivity (e.g. aluminium and copper)

b $l_1 \approx l_2$; $l_1 \geq (D + 100)$

c $l_2 \geq (D + 100)$

Figure 4 — Test piece for fillet welds on pipe

7 Removal of test specimens

7.1 General

The examination length (L_f) and area (A_f), and the number of test specimens shall be specified by the application standard or by agreement between the contracting parties. Welded joints in plates shall be cut transversely to the welded joint in test specimens of approximately equal weld length. The weld axis shall remain in the middle of the test specimen for butt welds.

For welded joints in pipe, unless otherwise specified in the application standard or by agreement between the contracting parties, the test piece shall provide at least two test specimens.

When carrying out bend tests, equal numbers of specimens shall be tested with the root in tension and the face in tension. If the pipe diameter is too small for removing the required number of test specimens, additional test pieces shall be welded.

7.2 Marking

Each test piece shall be marked to identify its exact location in the manufactured product or in the joints from which it has been removed.

When removed from the test piece, each test specimen shall be marked.

7.3 Extraction

7.3.1 General

The extraction method shall avoid the introduction of detrimental thermal or mechanical effects.

In general a portion 25 mm from both ends of the test welds shall be discarded, unless information about the ends of the welds is required (e.g. start/stop imperfections).

7.3.2 Steels

The test specimens shall be cut by thermal cutting or by mechanical means.

7.3.3 Other metallic materials

Other metallic materials shall only be cut mechanically.

7.4 Preparation

Fracture of welds in plates or pipes may be assisted by one or more of the following:

- removing the weld reinforcement;
- notching both edges of the weld (side notching);
- notching into the reinforcement (longitudinal notching).

Depending on the ductility of the weld metal, square, round or sharp notches may be used, (see Figures 5, 6, 7 and 8). For materials of high ductility (e.g. aluminium and copper) sharp notches may be recommended.

The depth of the notches shall be sufficient to induce fracture in the weld.

Unless otherwise specified by the application standard or by agreement between the contracting parties, the notch depth should be such that:

- for the side notch, examination length, L_f , shall be greater than or equal to 70 % of the original width of the test specimen, w (see Figure 6), or the total examination length, ΣL_f , shall be greater than or equal to 60 % of the length of the test specimen;
- for the longitudinal notch, examination thickness, a_f , shall be greater than or equal to 80 % of the original thickness of the test specimen, t (see Figure 7).


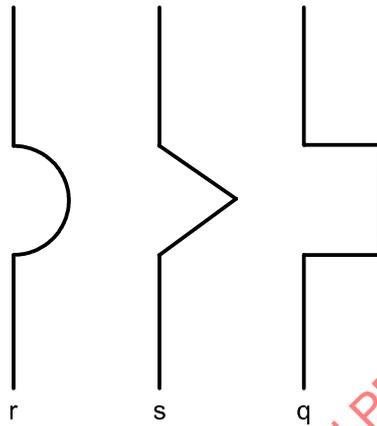



Figure 5 — Notch profiles

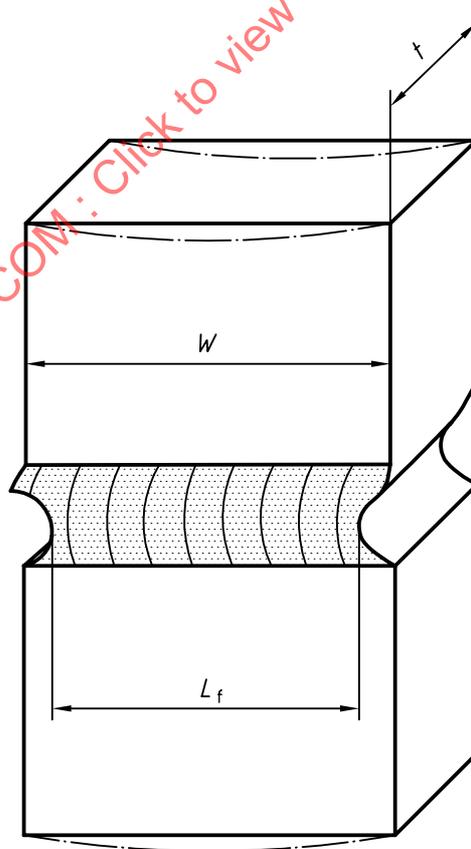


NOTE Full line for plates; chain dotted line for pipes.

Figure 6 — Side notches

a) Face notch

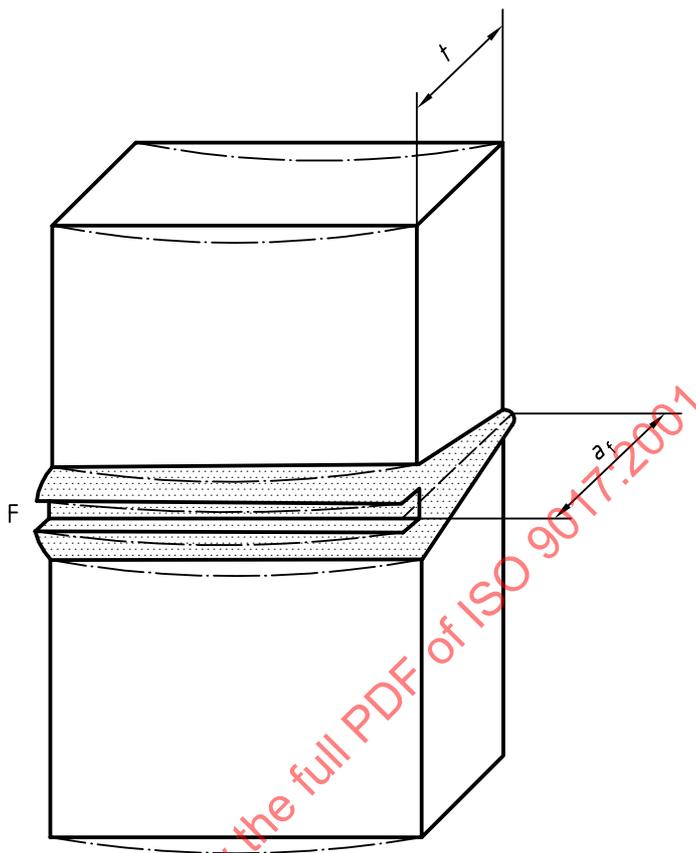

b) Root notch

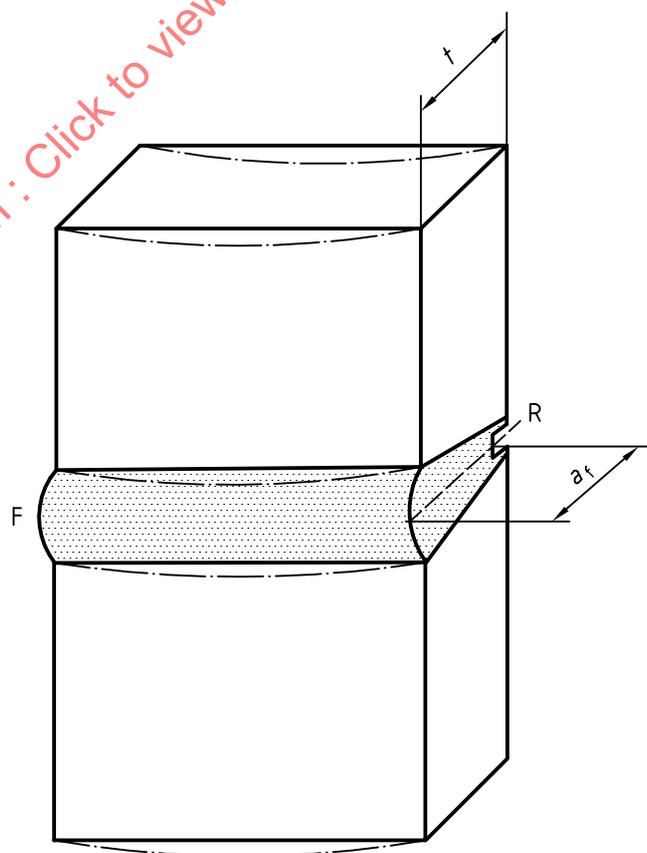

NOTE Full line for plates; chain dotted line for pipes

Figure 7 — Longitudinal notches in butt welds

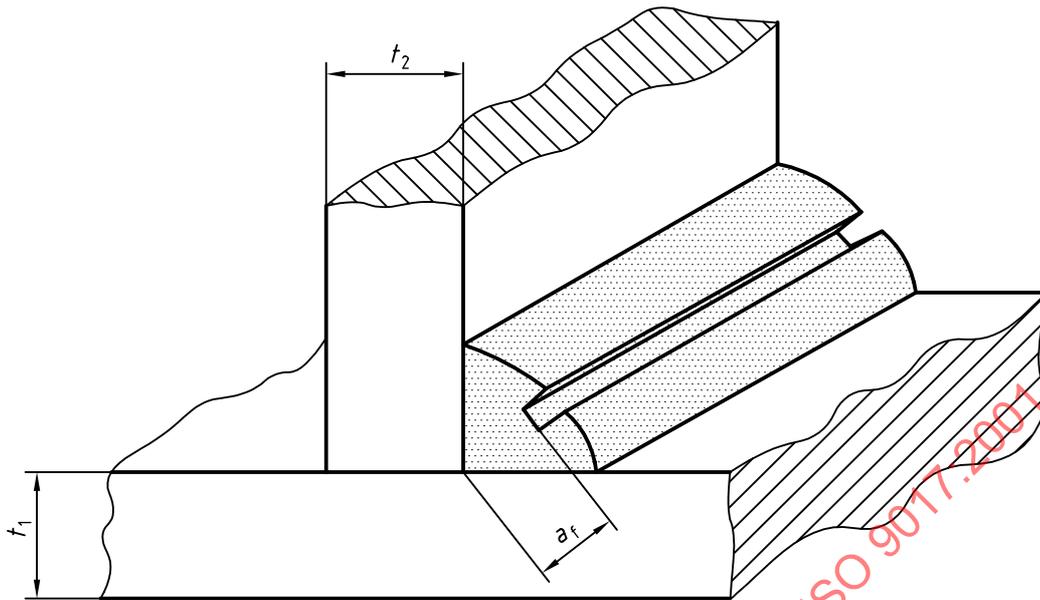


Figure 8 — Longitudinal notch in fillet welds

8 Test procedure

8.1 Butt welds


8.1.1 General

Fracture tests may be carried out by:

- dynamic strokes e.g. with a hammer, [see Figures 9 a) ,b) ,c)];
- applying a load by pressing in a vice, bending machine or workshop press [see Figures 9 d), e), f)];
- applying a load by tension [see Figure 9 g)].

For ductile materials, it may be useful to have a minimum distance between the notch and the jaws of the clamping device [see Figure 9 c)].

For some materials, it may be useful to test at a low temperature in order to initiate fracture.

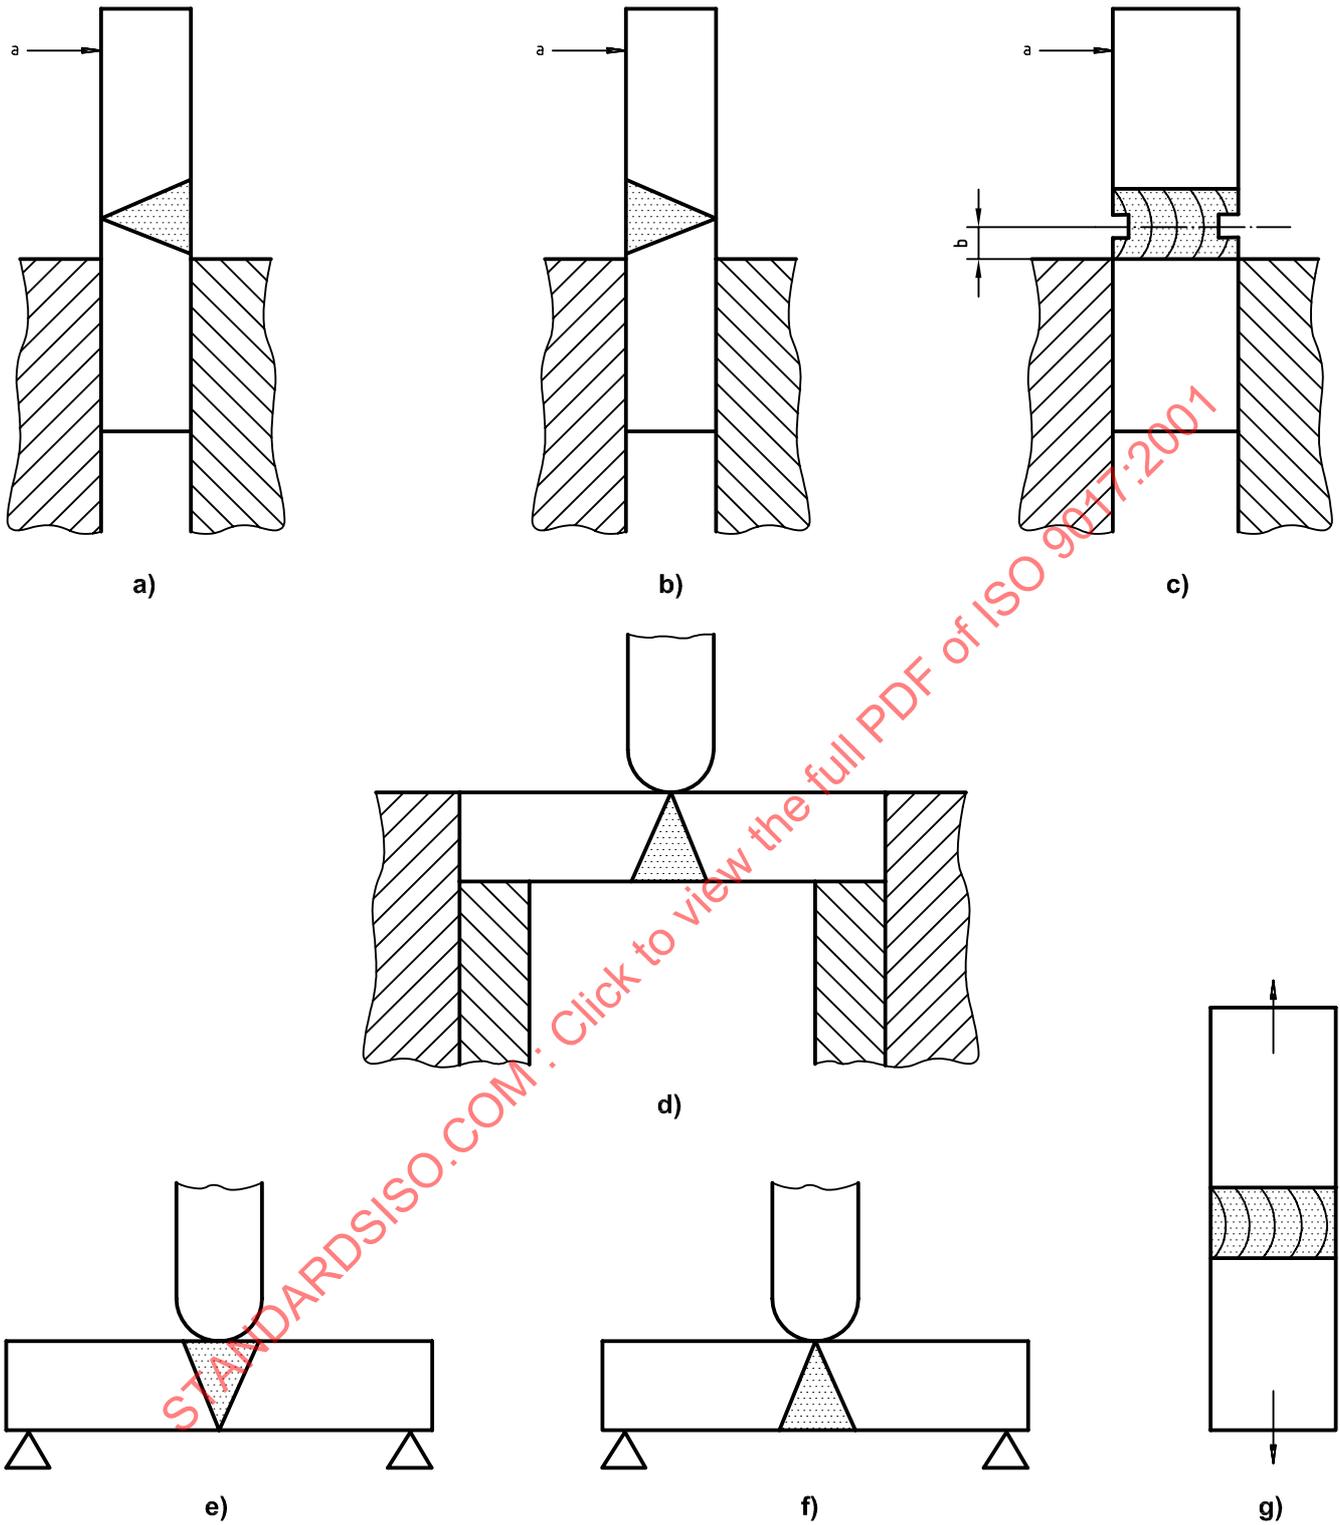

- a Impact.
- b See 8.1.1

Figure 9 — Examples of test methods for butt welds (BW)
(Notches according to Figures 5 to 7)