



<b>SURFACE VEHICLE INFORMATION REPORT</b>	<b>J2798™</b>	<b>DEC2021</b>
	Issued	2007-04
	Revised	2021-12
Superseding J2798 AUG2014		
Power Cylinder Blow-by: Problem Solving		

RATIONALE

This Five-Year Review and update include additional detail and clarifications on how to solve potential blow-by issues. Some of the updates are:

- Examples of key parameters to investigate in an oil analysis
- Information regarding potential problems with breathers
- An description of potential blow-by measurement mistakes
- New photos of carbon packing damage
- A paragraph to ensure that components are made per their specification
- A better description of the swapping technique for measuring evaluating high blow-by
- And various small editorial updates.

TABLE OF CONTENTS

1.	SCOPE.....	4
1.1	Purpose.....	4
2.	REFERENCES.....	4
3.	DEFINITIONS.....	4
4.	LIST OF METHODS.....	4
5.	CHECK THE HISTORY OF THE ENGINE.....	5
6.	ELIMINATE THE SIMPLE POSSIBILITIES (BEFORE ENGINE TEARDOWN).....	5
6.1	Check for Malfunctioning Blow-By Measurement Transducer.....	5
6.2	Check for Problems with the Breather.....	5
6.3	Check for Malfunctioning External Components.....	6
6.4	Check for Coolant in the Oil.....	6
6.5	Check for Fuel in the Oil.....	6
6.6	Compression Check.....	6
6.7	Leak Down Test.....	6

SAE Executive Standards Committee Rules provide that: "This report is published by SAE to advance the state of technical and engineering sciences. The use of this report is entirely voluntary, and its applicability and suitability for any particular use, including any patent infringement arising therefrom, is the sole responsibility of the user."

SAE reviews each technical report at least every five years at which time it may be revised, reaffirmed, stabilized, or cancelled. SAE invites your written comments and suggestions.

Copyright © 2021 SAE International

All rights reserved. No part of this publication may be reproduced, stored in a retrieval system or transmitted, in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, without the prior written permission of SAE.

TO PLACE A DOCUMENT ORDER: Tel: 877-606-7323 (inside USA and Canada)  
 Tel: +1 724-776-4970 (outside USA)  
 Fax: 724-776-0790  
 Email: CustomerService@sae.org  
 SAE WEB ADDRESS: http://www.sae.org

For more information on this standard, visit  
[https://www.sae.org/standards/content/J2798\\_202112](https://www.sae.org/standards/content/J2798_202112)

6.8	Cracked Head or Block .....	6
6.9	Borescope the Engine.....	6
6.10	Examine the Color of the Exhaust .....	7
6.11	Complete an Oil Analysis .....	7
6.12	Verify the Blow-By was Measured Correctly.....	7
7.	ELIMINATE THE POTENTIAL MISTAKES (AFTER ENGINE TEARDOWN) .....	7
7.1	Incorrect, Missing, or Misassembled Components .....	7
7.1.1	Broken Parts .....	7
7.1.2	Abnormal Marks .....	7
7.1.3	Improperly Handled Rings .....	8
8.	HIGH BLOW-BY AS A RESULT OF A FAILURE .....	8
8.1	Broken Rings.....	8
8.2	Face Coating Failure.....	8
8.3	Scuffed Power Cylinder.....	9
8.4	Carbon Deposits on the Piston Top Land and Top Ring Groove .....	9
8.4.1	Carbon Packing on the Top Land .....	9
8.4.2	Carbon Buildup in the Top Ring Groove .....	10
8.4.3	Carbon Tracking.....	10
8.5	Excessive Wear .....	11
8.6	Debris.....	12
8.7	Lack of Lubrication .....	12
8.8	Bore Washing from the Fuel .....	12
8.9	Oil Burning from the Cylinder Wall.....	12
9.	CHECK FOR PROPER DESIGN .....	12
10.	MODELING AND MAPPING.....	13
10.1	Cylinder Kit Dynamics .....	13
10.2	Engine Blow-By Steady State Mapping .....	13
11.	COMPONENT NOT MADE PER SPECIFICATION .....	14
12.	COMPONENT SWAPPING AND VARIATION TECHNIQUES .....	14
12.1	Swapping Technique.....	14
12.2	Variation Technique .....	14
13.	SYSTEM SEPARATION .....	14
13.1	Isolating the Overhead .....	14
13.2	Isolating the Turbocharger/Supercharger .....	15
13.3	Isolating the Crankcase Ventilation Systems.....	15
13.4	Isolating the External Components .....	15
14.	OTHER POSSIBLE FACTORS .....	15
14.1	Customer Duty Cycle .....	15
15.	BLOW-BY PROBLEM SOLVING SEQUENCE - <b>BLOW-BY HAS BECOME BAD</b> .....	15
15.1	Before Disassembly of the Engine.....	15
15.1.1	Check the History .....	15
15.1.2	Investigate the Source .....	15
15.1.3	Check for Problems.....	16
15.2	Minimal Disassembly of the Engine.....	16
15.3	Remove the Cylinder Head.....	16
15.4	Remove the Power Cylinder Components.....	16
15.4.1	Check for Incorrect Installation Issues .....	16
15.4.2	Check for Carbon Packing on the Top Land of the Piston.....	16
15.4.3	Check for Damage .....	16
15.4.4	Evaluate the Components.....	17
15.4.5	Check for Wear .....	17

15.4.6	Check for Manufacturing Issues .....	17
15.5	Swap Testing .....	17
16.	<b>BLOW-BY PROBLEM SOLVING SEQUENCE - BLOW-BY IS HIGH BUT ACCEPTABLE ON OTHER ENGINES</b> .....	17
16.1	Before Disassembly of the Engine .....	17
16.1.1	Check the History .....	18
16.1.2	Investigate the Source .....	18
16.1.3	Check for Problems.....	18
16.2	Minimal Disassembly of the Engine .....	18
16.3	Remove the Cylinder Head .....	18
16.4	Remove the Power Cylinder Components.....	19
16.4.1	Check for Assembly Issues.....	19
16.4.2	Check for Carbon Packing on the Top Land of the Piston.....	19
16.4.3	Check for Damage .....	19
16.4.4	Evaluate the Components Visually .....	19
16.4.5	Check for Manufacturing Issues .....	20
16.5	Swap Testing .....	20
17.	<b>BLOW-BY PROBLEM SOLVING SEQUENCE - BLOW-BY IS ALWAYS HIGH</b> .....	20
17.1	Before Disassembly of the Engine .....	20
17.1.1	Check the History .....	20
17.1.2	Investigate the Source .....	20
17.2	Remove the Cylinder Head .....	21
17.3	Remove the Power Cylinder Components.....	21
17.3.1	Evaluate the Components Visually .....	21
17.3.2	Check for Manufacturing Issues .....	21
17.4	Evaluate the Design .....	21
17.5	Model the Power Cylinder Dynamics.....	21
17.6	Variation Testing .....	21
18.	NOTES .....	22
18.1	Revision Indicator.....	22
Figure 1	Example of damaged to the third land due to installation damage .....	8
Figure 2	Example of broken piston ring.....	8
Figure 3	Example of failed ring face coatings .....	9
Figure 4	Example of piston scuff.....	9
Figure 5	Example of carbon polishing .....	10
Figure 6	Example of carbon tracking caused by excessive bore distortion .....	11
Figure 7	Examples of excessively worn rings .....	11
Figure 8	Example of excessive polish due to bore washing or oil burning .....	12
Figure 9	Example of inter-ring gas pressure and ring motion .....	13

## 1. SCOPE

This document describes methodologies to determine the causes blow-by oil consumption caused by the power cylinder.

### 1.1 Purpose

During the combustion event, the intent of the engine design is to contain the combustion gases in the combustion chamber to load the piston and drive the piston to turn the crankshaft. It is the intent of the power cylinder system to seal the gases and to control the oil film on the power cylinder parts. The gas that escapes around the rings and piston is referred to as blow-by gases, or just blow-by. The power cylinder system and individual components are designed to seal the gases. The understanding associated with which features affect blow-by is important in the engine design and development process.

When diagnosing blow-by problems the engineer must be aware that other engine systems can affect blow-by. These systems are as follows:

- Power cylinder system (piston, rings, liner)
- Head gasket
- Cylinder head system (valves, valve stem guides and seals, etc.)
- Turbocharger
- Supercharger
- Air compressors

This document describes general methods for determining the causes of high blow-by so that it might be corrected.

## 2. REFERENCES

There are no referenced publications specified herein.

## 3. DEFINITIONS

There are no unique definitions.

## 4. LIST OF METHODS

The following is a list of the basic methods for determining the causes of high blow-by:

- Check the history of the engine
- Eliminate the simple possibilities
- Eliminate the mistakes
- Determine if high blow-by as a result of a failure
- Modeling and mapping
- Component swapping and variation techniques
- System separation

## 5. CHECK THE HISTORY OF THE ENGINE

High blow-by may be a result of how the engine was operating. Make sure that the engine was run properly. Some of the areas to check on engine operation are:

- Check for sudden changes in the blow-by. This might indicate a problem in the engine.
- Check the history for changes in temperatures and/or pressures that might indicate incorrect engine operation or problems:
  - Oil
  - Coolant
  - Intake
  - Exhaust
- Check the condition of the oil for signs of potential problems. Example of lubrication conditions to analyze are:
  - Oxidation parameters
  - Viscosity
  - Wear metals (e.g., Al, Fe, Cr)
  - Contaminants (e.g., Si)
  - Elements from Coolant (e.g., Na, K)
  - Fuel concentration
- Check for incorrect engine operation.
  - Speed
  - Load
- Check warranty data to determine if the engine has a history of problems and under what conditions.
- Check the history of past engine test done on the same engine configuration. Have things changed? Was the engine run differently?

## 6. ELIMINATE THE SIMPLE POSSIBILITIES (BEFORE ENGINE TEARDOWN)

When there is a problem with high blow-by of an engine, it is important to eliminate the simple potential causes first. These are the things that are done prior to any engine teardown.

### 6.1 Check for Malfunctioning Blow-By Measurement Transducer

Investigate the blow-by measurement transducer for indications that it is malfunctioning. It is common for some transducers to be affected by oil that gets trapped in the device. Check to make sure the calibration of the device is correct.

### 6.2 Check for Problems with the Breather

Problems with the breather may affect blow-by.

Design issues:

- Poorly designed breather
- Incorrectly positioned breather
- Plugged breather or valve (PCV)
- Missing breather or valve (PCV)
- Malfunctioning breather

### 6.3 Check for Malfunctioning External Components

Components other than the power cylinder may contribute to high blow-by. Check these components for potential problems that may result in blow-by problems.

Turbocharger/supercharger: Can often be isolated from the main engine to determine the turbocharger/supercharger contribution to blow-by.

Valve guides: Gases may flow around the valve stems. Replace the valve stem seals if possible.

### 6.4 Check for Coolant in the Oil

Coolant in the cylinder will vaporize causing high blow-by. Also it will affect lubricity of the oil and result in high wear of the cylinder walls that will affect blow-by and oil consumption. Coolant in the oil could also indicate a failed cylinder head gasket which could cause high blow-by and/or oil consumption. Also a failed oil cooler could cause coolant to into the cylinder.

Coolant in the oil can be determined by an oil analysis. Foam on the oil or increasing sump levels can be a sign of coolant in the oil.

### 6.5 Check for Fuel in the Oil

Excessive fuel in the oil will affect the lubricity of the oil and result in high wear of the cylinder walls that will affect blow-by. Fuel in the oil can be determined by an oil analysis. Low oil viscosity or increasing sump levels can be signs of fuel in the oil.

### 6.6 Compression Check

A compression check can help to determine if there is a problem with the rings, valves, gaskets, cylinder head, or pistons that might be resulting in high blow-by.

### 6.7 Leak Down Test

A leak down test can follow a compression check to identify the source of the leak. Look for signs of leaking in the intake ports, exhaust ports, crankcase, or coolant. Signs for leaks may be leakage noise in the ports and crankcase, or gas bubbles in the coolant. This test makes it possible to better understand whether the power cylinder (piston and rings) is the source of the blow-by.

### 6.8 Cracked Head or Block

Investigate the engine for signs of a cracked head or block which will cause high blow-by. Signs of this might include water in the oil and gases in the coolant.

### 6.9 Borescope the Engine

A borescope of the cylinder will help to identify if there has been scuffing or piston damage, valve burning damage, or other in-cylinder damage that has occurred that might explain the cause of high blow-by.

## 6.10 Examine the Color of the Exhaust

The color of the exhaust gases might indicate problems:

- Excessive white smoke might indicate coolant in the cylinder.
- Excessive black smoke might indicate excessive fuel.

## 6.11 Complete an Oil Analysis

Analyze the oil for signs of potential problems. Analyze viscosity change and base number change for oil degradation. Check for wear metals (iron, chrome, etc.) in the oil for indications of failures occurring within the engine. The oil should also be analyzed for contaminants such as fuel and coolant. Excessive fuel or coolant in the oil may diminish the lubricity which will cause excessive wear or scuffing of the cylinder. This can result in high blow-by.

## 6.12 Verify the Blow-By was Measured Correctly

Various mistakes can be made when measuring blow-by. Evaluate the measurement method.

## 7. ELIMINATE THE POTENTIAL MISTAKES (AFTER ENGINE TEARDOWN)

### 7.1 Incorrect, Missing, or Misassembled Components

- Have the correct pistons been used?
- Are all the correct piston rings on the piston?
- Are there any missing piston rings?
- Are all the rings orientated correctly with the proper side up?

#### 7.1.1 Broken Parts

Check all the piston rings for breakage. Piston rings may have been broken during operation or during assembly. Rings that were broken on assembly can often be identified by damage to the piston. The broken ends of the rings become polished against the cylinder bore and/or against each other during running if they were broken at assembly or during running. If they were broken during or after tear-down, the broken ends are not polished.

Broken ring lands on the piston would also be a cause of high oil consumption and blow-by (see Figure 1). It may be necessary to remove the rings to determine whether any ring lands are cracked or broken. Look for cracks on the cylinder head and also for damage on the head gasket.

#### 7.1.2 Abnormal Marks

Installation errors: Check the pistons and rings for abnormal markings. This could be an indication of assembly damage.

Look for manufacturing issues such as signs of waviness in the piston rings.



**Figure 1 - Example of damaged to the third land due to installation damage**

#### 7.1.3 Improperly Handled Rings

A piston ring that is overextended or excessively twisted during installation might break in operation (see Figure 2) or show abnormal marks on the face of the ring.

### 8. HIGH BLOW-BY AS A RESULT OF A FAILURE

High blow-by will be caused by failure of components. This must be determined when investigating the cause of high blow-by. In the subsequent sections there are a few examples of failures that may result in high blow-by.

#### 8.1 Broken Rings


A broken piston ring can easily be found and can result in high oil consumption and high blow-by (see Figure 2).



**Figure 2 - Example of broken piston ring**

#### 8.2 Face Coating Failure

Failure of the top ring face coating will result in high blow-by (see Figure 3).

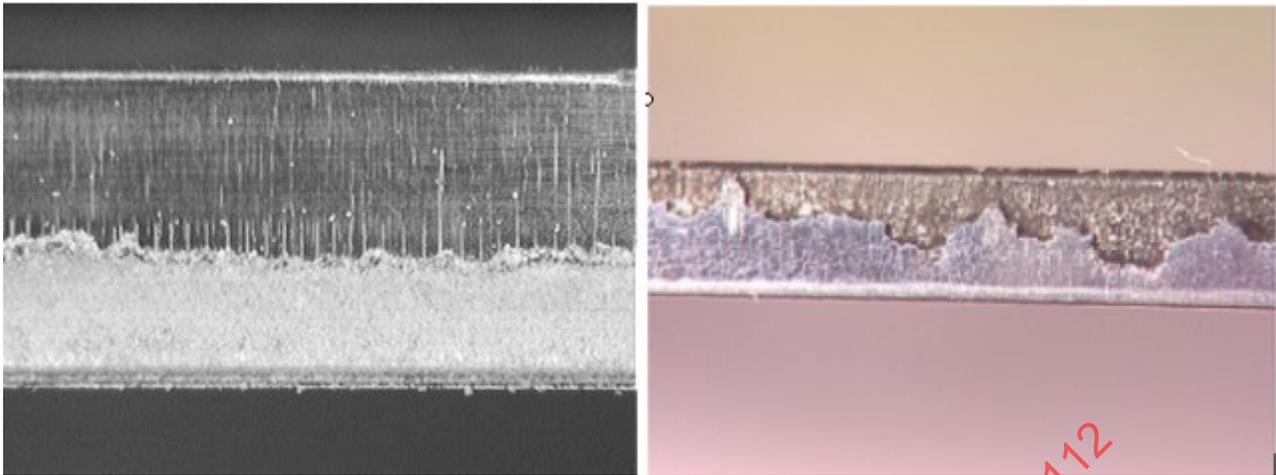

**Figure 3 - Example of failed ring face coatings**

### 8.3 Scuffed Power Cylinder

Blow-by will be high if the cylinder is scuffed.



**Figure 4 - Example of piston scuff**

### 8.4 Carbon Deposits on the Piston Top Land and Top Ring Groove

#### 8.4.1 Carbon Packing on the Top Land

Excessive carbon deposits on the top land of the piston is a major cause for wear and the resultant high blow-by. Problems with carbon build-up include:

- Polishing of the cylinder walls.
- Scraping oil upward from the carbon that is built up.
- Potential lack of ability to energize the top ring because the carbon blocks the pressure build-up.



**Figure 5 - Example of carbon polishing**

#### 8.4.2 Carbon Buildup in the Top Ring Groove


Inspect the top ring groove for excessive carbon deposits which can cause the top ring to be stuck and ineffective. Carbon in the top ring groove which makes the top ring ineffective is typically accompanied by high blow-by.

Excessive carbon packing in the ring groove may decrease its effectiveness to seal the gases and oil because:

- The ring may stick in the groove.
- There may be interference between the ring and the carbon in the groove.

#### 8.4.3 Carbon Tracking


Carbon tracking around a piston ring might be a sign of a leakage path for the blow-by gases that needs to be investigated (see Figure 6).

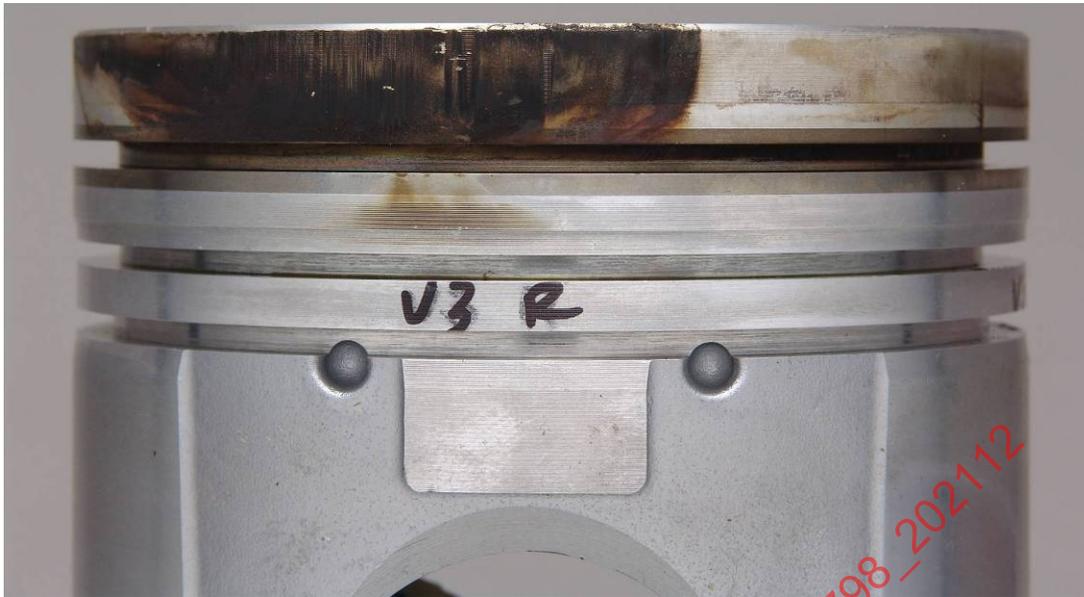

**Figure 6 - Example of carbon tracking caused by excessive bore distortion**

#### 8.5 Excessive Wear

Excessively worn rings can result in high blow-by. If the wear is very high and at low mileage, it might be caused by dust in the engine. This could occur if the proper air filter is not used or if there is a leak path for dirty air to enter the clean side of the intake system, e.g., cracked air duct or loose clamp.

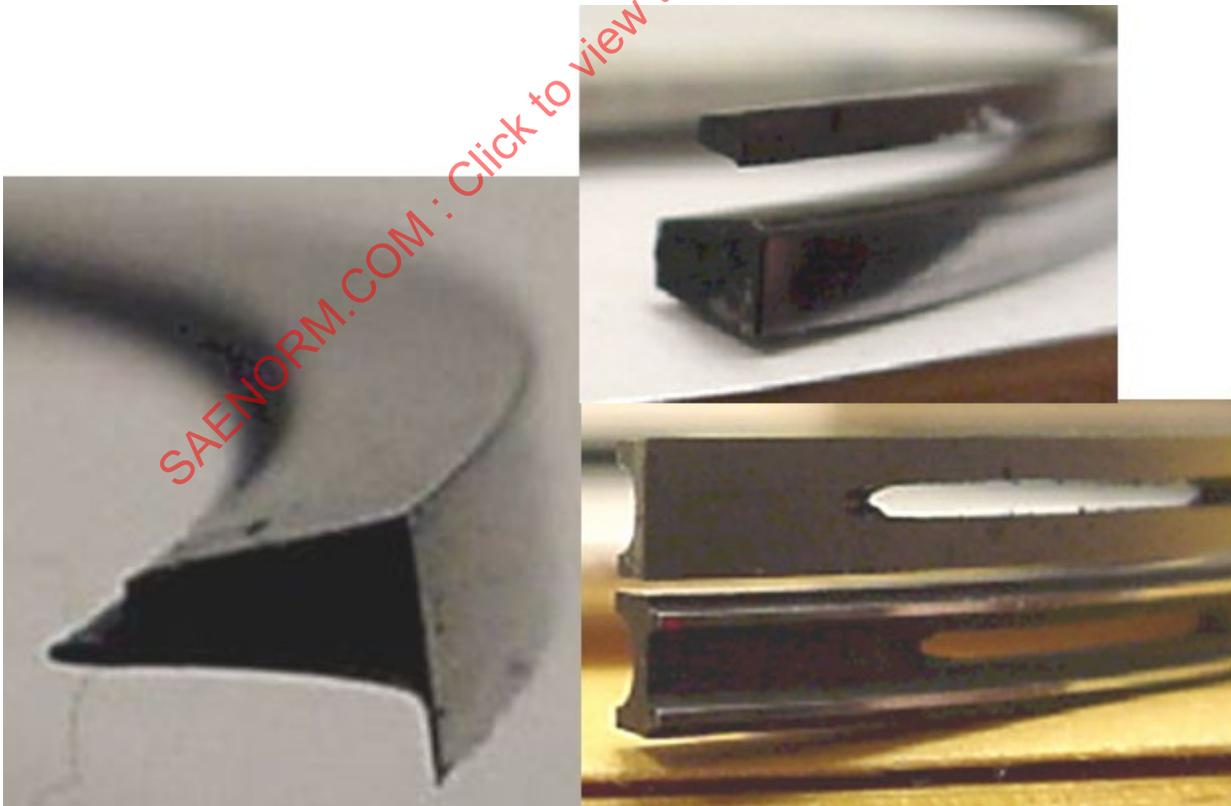

**Figure 7 - Examples of excessively worn rings**

## 8.6 Debris

Examine the engine for damage. Excessive vertical scratching on the cylinder bore walls, piston skirts, and piston ring face might indicate a problem. Also, examine the intake manifold for signs of debris or sediment, some of which might have been ingested by the engine. Bearings often will show scratching from debris.

## 8.7 Lack of Lubrication

Examine the engine for signs that the engine might have lost lubrication which caused problems in the power cylinder. Main and/or connecting rod bearings, when worn down to the copper, are an indicator of loss of oil pressure during operation. Scuffed pistons with a bright metallic appearance and little evidence of burned oil around the scuffed zone is an indication of a lack of lubrication.

## 8.8 Bore Washing from the Fuel

Liquid fuel impinging on the cylinder walls may result in excessive polishing and wear which will result in high blow-by. Polishing that corresponds to spray plumes of an injector might be an indication of bore wall washing with fuel (see Figure 8).

## 8.9 Oil Burning from the Cylinder Wall

When the combustion gets too close to the cylinder wall, the oil may evaporate. The rings will not be lubricated in that region causing high wear. The wear may occur in regions that correspond to the spray plumes of an injector.



**Figure 8 - Example of excessive polish due to bore washing or oil burning**

## 9. CHECK FOR PROPER DESIGN

The power cylinder components may not be designed properly and as a result will have high blow-by. SAE J2797 describes the design parameters that will affect blow-by. These parameters should be carefully considered to ensure a low blow-by engine design.

## 10. MODELING AND MAPPING

Blow-by can be affected by the pressure balance within the ring pack and the motion of the rings.

### 10.1 Cylinder Kit Dynamics


Cylinder kit dynamics model or experimental measurements can be used to determine the build-up of gas pressures within the ring pack, determine how the gases and oils flow through the ring pack, and determine how the rings move (see Figure 9). The motion of the rings and the pressure built up between the rings significantly affects blow-by.

Ring flutter can be a cause of high blow-by. Top rings in high speed low load applications may be susceptible to fluttering. A possible solution to reduce this type of flutter is to reduce the mass of the top ring. A negative twist second ring will be more susceptible to fluttering than a positive twist second ring. Therefore the negative twist second ring will generally have higher blow-by.

A ring must be adequately energized or the ring will collapse radially inward from the pressures acting on the ring face. A significant taper or cutback on the upper portion of the ring face can result more pressure acting on the ring face which may result in collapse. Radial ring collapse will result in high blow-by.

In many cases, as blow-by increases, oil consumption will go down. However, there are conditions where blow-by and oil consumption can be reduced at the same time. The models can also predict how the gases flow upward into the combustion chamber. This is called blow-back. Increased blow-back will tend to increase oil consumption but potentially lower blow-by.

Analytical models are available to predict blow-by directly and are well established in the industry.

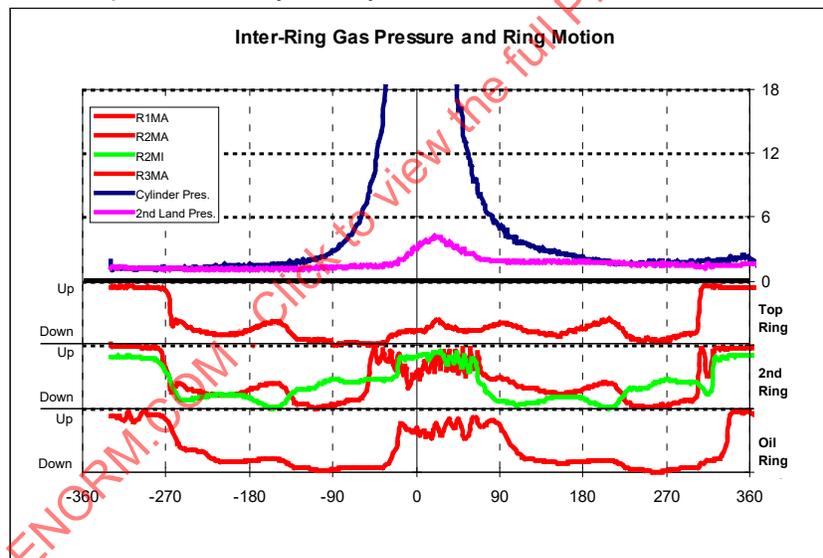

**Figure 9 - Example of inter-ring gas pressure and ring motion**

### 10.2 Engine Blow-By Steady State Mapping

Blow-by mapping of the effects of speed and load might show where there are regions of high blow-by. This might indicate a condition with non-optimal ring pack dynamics. Some conditions that have been prone to having high blow-by are:

- High speed and load
- High speed and light load (high idle)

## 11. COMPONENT NOT MADE PER SPECIFICATION

Check the key specifications of the components in the engine that will affect blow-by. Were the parts made correctly per the specifications? Sometimes this will be difficult to determine after the parts are worn. Therefore, if possible, measure parts before engine testing. Alternatively, it may be helpful to measure parts made from the same batch as the parts in engine that has high blow-by.

## 12. COMPONENT SWAPPING AND VARIATION TECHNIQUES

When trying to find the component that is causing high blow-by a swapping or variation technique might help. However, in both of these cases, for the testing to be effective a good repeatable method for measuring blow-by needs to be utilized. Otherwise the results will be confounded with variation in the measurement system.

### 12.1 Swapping Technique

This technique works when there is a known high blow-by engine and a different engine of the same configuration with low blow-by. The concept is to swap components between engines and monitor the effect on blow-by. For example, if the top ring is moved from the bad engine to the good engine and then the blow-by becomes bad on the engine that was good before, the problem is with the ring. If the original good engine continues to have low oil consumption then the ring is not the problem.

Once the component or components causing the high blow-by has been determined, it will be necessary to compare detailed measurements of the parts. The differences in measurements will determine the feature of that component that is causing the high blow-by.

### 12.2 Variation Technique

In this case, variations of various design parameters might be tested. For example, variations in the end gaps of the rings might be tested. Often there are multiple design parameters that could be tested. Therefore, a design of experiments might be useful to process the results of the test.

It is very important in this type of testing that all the power cylinder components are measured dimensionally before tests. Then it is important that all the key dimensions that affect blow-by are controlled as appropriate so that they do not confound the results of the main variation that is being tested.

## 13. SYSTEM SEPARATION

In searching for the causes of high blow-by, it is often not known which systems are contributing. Therefore, it is common to try to separate the various systems to isolate the system that is causing the problem. The systems that might be contributing to high blow-by are as follows:

- The power cylinder (piston, rings, liner)
- The overhead (valves, valve stem guides and seals, etc.)
- The turbocharger/supercharger
- Head gasket
- The air compressor
- Other external components

### 13.1 Isolating the Overhead

The overhead will be difficult to isolate. The alternative might be to replace parts in the overhead that might contribute to blow-by to evaluate their effect. For example the valves, valve stem seals, lifters, or cam shaft may be replaced.

### 13.2 Isolating the Turbocharger/Supercharger

The performance of the turbocharger/supercharger should be checked to ensure that it is delivering the proper boost pressure for the power cylinder.

To isolate the turbocharger/supercharger, the lube oil to the turbocharger/supercharger is isolated from the engine. Then blow-by is measured from the main engine using the standard techniques. The difference between the total engine blow-by and the base engine blow-by is the blow-by from the turbocharger/supercharger.

In some cases, to isolate the turbocharger/supercharger a flow meter may be placed on the isolator vent to measure seal leakage then, this flow can be subtracted from total engine blow-by to obtain base engine blow

### 13.3 Isolating the Crankcase Ventilation Systems

If a component in the crankcase ventilation system (e.g., PCV valve, breather) is malfunctioning, it will affect the blow-by. Make sure that there are no issues with these systems. An example might be plugging of the PCV valve or breather.

### 13.4 Isolating the External Components

There are other external components that might be causing high blow-by. An example might be an air compressor. The gas flow connection to these components must be isolated or the component removed directly from the engine to determine their contribution.

## 14. OTHER POSSIBLE FACTORS

### 14.1 Customer Duty Cycle

Oil consumption of an engine will be subject to the variation of the customer duty cycle or to the application in which the engine is placed.

## 15. BLOW-BY PROBLEM SOLVING SEQUENCE - **BLOW-BY HAS BECOME BAD**

This is the sequence of steps that are followed when an engine that was running with acceptable blow-by has suddenly developed high blow-by.

### 15.1 Before Disassembly of the Engine

The following steps should be followed before the engine is disassembled:

#### 15.1.1 Check the History

Check the engine history for potential causes of the change in blow-by as described in the preceding sections. Have there been any changes in how the engine was operating (loss of pressure, increase in temperature, etc.)?

#### 15.1.2 Investigate the Source

Check for the source of the high blow-by.

- Are the crankcase ventilation systems working properly? (Air breather, PCV valve)
- What is the blow-by from other components? (Turbocharger, supercharger, air compressor)
- Separate the systems if possible to determine the source. (Turbocharger, overhead)

### 15.1.3 Check for Problems

- Are there any problems with the blow-by measuring equipment?
- Did anything change in the installation of the engine during service checks? Did anything break?
- Are there signs of coolant in the oil?
- Are there signs of fuel in the oil?
- Are there gas bubbles in the coolant? Is coolant becoming over-pressurized due to combustion pressures leaking into the coolant passageways?

### 15.2 Minimal Disassembly of the Engine

Look for potential signs of the cause of the problem by:

- Using a borescope to inspect the cylinder walls and internal components. Are there signs of scuffing or scoring of the bore walls? Has anything broken? These will result in high blow-by.
- Do a compression test to check if a piston ring has broken, a valve is damaged, or a gasket may not be sealing.
- Do a leak down test to identify the source of the leak.

### 15.3 Remove the Cylinder Head

With the head removed from the engine check the following:

- Evaluate the cylinder walls for signs of scuffing, scoring, or debris damage that might have caused the high blow-by.
- Check the piston for signs of cracking, debonding of a ring carrier insert (if present), contact with the valves or cylinder head, debris damage, and melting.
- Evaluate the head for signs of damage to the valves.
- Check the intake system for signs of water or debris entering the cylinder.
- Review the exhaust system for signs of damage or debris that went through the engine.

### 15.4 Remove the Power Cylinder Components

Once the power cylinder components are removed then check the following:

#### 15.4.1 Check for Incorrect Installation Issues

- Most installations problems will manifest themselves from the very beginning of the test. If the blow-by was good originally, then there was probably not an installation problem.

#### 15.4.2 Check for Carbon Packing on the Top Land of the Piston

If there is carbon that has packed on the top land of the piston to the point that it is contacting the cylinder bore and polishing the cylinder bore, it will cause high blow-by.

#### 15.4.3 Check for Damage

- Check for broken components (piston rings, pistons).
- Check for chipping or delamination of the ring coatings.

- Check for rings that have been stuck in the grooves. Rings may be stuck in the grooves because of:
  - Carbon packing.
  - Micro-welding of the ring to the groove.
  - Scuffing.
  - Impact damage to the piston.
- Check for damage to the cylinder bore from:
  - Scuffing.
  - Scratching from debris.
  - Dust in the cylinder causing excessive wear. This can most commonly be seen on the piston ring faces and bottom side.
  - Carbon polishing causing bore polishing.
  - Bore washing and excessive polishing from fuel.
  - Bore washing and excessive polishing from coolant.

#### 15.4.4 Evaluate the Components

It is sometimes possible to look at the components to determine how oil and gases are flowing through the ring pack. This will give an indication of potential problems that can be resolved. Indications may be seen:

- In the carbon marks on the pistons and/or rings showing how blow-by gases flow past the rings.
- Polishing of the components showing signs of sealing. Non-polished regions might indicate a flow path.

#### 15.4.5 Check for Wear

If the engine parts are worn too much or there is too much polishing, this will cause an increase in blow-by. It then must be determined if the wear is excessive or not. Excessive wear might be a sign of dust getting into the engine. Excessive polish might indicate other problems as described above.

#### 15.4.6 Check for Manufacturing Issues

- Verify all critical dimensions on the power cylinder components that affect component durability and reliability which will ultimately affect blow-by.

### 15.5 Swap Testing

If all the above has not identified the problem, then do a swap test with an engine that has good oil consumption control to determine the component that is causing the issue.

## 16. BLOW-BY PROBLEM SOLVING SEQUENCE - **BLOW-BY IS HIGH BUT ACCEPTABLE ON OTHER ENGINES**

This is the sequence of steps that are followed when an engine has high blow-by, but other engines of the same configuration show acceptable blow-by.

### 16.1 Before Disassembly of the Engine

The following steps should be followed before the engine is disassembled: