
**Geometrical Product Specifications
(GPS) — Acceptance and reverification
tests for coordinate measuring machines
(CMM) —**

**Part 3:
CMMs with the axis of a rotary table as the
fourth axis**

*Spécification géométrique des produits (GPS) — Essais de réception et de
vérification périodique des machines à mesurer tridimensionnelles
(MTT) —*

*Partie 3: MMT ayant l'axe de rotation d'un plateau tournant comme
quatrième axe*



PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 10360-3:2000

© ISO 2000

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 734 10 79
E-mail copyright@iso.ch
Web www.iso.ch

Printed in Switzerland

Contents

	Page
Foreword.....	iv
Introduction.....	v
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Requirements for metrological characteristics	2
4.1 Error of indication.....	2
4.2 Environmental conditions.....	2
4.3 Rotary table	2
4.4 Stylus system.....	2
4.5 Operating conditions.....	2
5 Acceptance test and reverification test.....	3
5.1 Principles.....	3
5.2 Measuring equipment.....	3
5.3 Procedure	3
5.4 Obtention of test results	5
6 Compliance with specifications	8
6.1 Acceptance test	8
6.2 Reverification test.....	8
7 Applications	8
7.1 Acceptance test	8
7.2 Reverification test.....	8
7.3 Interim check.....	8
Annex A (informative) Interim check.....	9
Annex B (informative) Relation to the GPS matrix model	10
Bibliography	12

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 3.

Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this part of ISO 10360 may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

International Standard ISO 10360-3 was prepared by Technical Committee ISO/TC 213, *Dimensional and geometrical product specifications and verification*.

ISO 10360 consists of the following parts, under the general title *Geometrical Product Specifications (GPS) — Acceptance and reverification tests for coordinate measuring machines (CMM)*:

- *Part 1: Vocabulary*
- *Part 2: CMMs used for measuring linear dimensions*
- *Part 3: CMMs with the axis of a rotary table as the fourth axis*
- *Part 4: CMMs used in scanning measuring mode*
- *Part 5: CMMs using multiple stylus probing systems*
- *Part 6: Estimation of errors in computing Gaussian associated features*

Annexes A and B of this part of ISO 10360 are for information only.

Introduction

This part of ISO 10360 is a geometrical product specification (GPS) standard and is to be regarded as a general GPS standard (see ISO/TR 14638). It influences link 5 of the chains of standards on size, distance, radius, angle, form, orientation, location, run-out and datums.

For more detailed information on the relationship of this part of ISO 10360 to other standards and the GPS matrix model, see annex B.

The acceptance test and reverification test of this part of ISO 10360 are applicable to CMMs which use a rotary table for the orientation of a workpiece being measured.

The tests specified in this part of ISO 10360 are performed in addition to the size measuring tests according to ISO 10360-2, which are conducted with the rotary table stationary. They are designed to detect the system measuring errors relative to an axis system fixed to the rotary table. It is normally not useful to isolate the rotary table errors from other sources of machine error.

STANDARDSISO.COM : Click to view the full PDF of ISO 10360-3:2000

Geometrical Product Specifications (GPS) — Acceptance and reverification tests for coordinate measuring machines (CMM) —

Part 3: CMMs with the axis of a rotary table as the fourth axis

1 Scope

This part of ISO 10360 specifies the acceptance test which verifies that the performance of four-axis coordinate measuring machines (CMM) is in accordance with that stated by the manufacturer. It also specifies the reverification test, which enables the user to reverify the performance of a four-axis CMM periodically.

The acceptance test and reverification test described in this part of ISO 10360 are applicable only to four-axis machines with three axes for measuring workpiece coordinates, plus a rotary table for orienting the workpiece.

2 Normative references

The following normative documents contain provisions which, through reference in this text, constitute provisions of this part of ISO 10360. For dated references, subsequent amendments to, or revisions of, any of these publications do not apply. However, parties to agreements based on this part of ISO 10360 are encouraged to investigate the possibility of applying the most recent editions of the normative documents indicated below. For undated references, the latest edition of the normative document referred to applies. Members of ISO and IEC maintain registers of currently valid International Standards.

ISO 10360-1:—¹⁾, *Geometrical Product Specifications (GPS) — Acceptance and reverification tests for coordinate measuring machines (CMM) — Part 1: Vocabulary.*

ISO 14253-1:1998, *Geometrical Product Specifications (GPS) — Inspection by measurement of workpieces and measuring equipment — Part 1: Decision rules for proving conformance or non-conformance with specifications.*

International Vocabulary of Basic and General Terms in Metrology (VIM). BIPM, IEC, IFCC, ISO, IUPAC, IUPAP, OIML, 2nd edition, 1993.

3 Terms and definitions

For the purposes of this part of ISO 10360, the terms and definitions given in ISO 10360-1, ISO 14253-1 and VIM apply.

1) To be published.

4 Requirements for metrological characteristics

4.1 Error of indication

The errors of indication, FR, FT, FA, as defined in ISO 10360-1, for the three four-axis errors shall not exceed the maximum permissible errors, MPE_{FR} , MPE_{FT} , MPE_{FA} , as defined in ISO 10360-1, as stated by:

- the manufacturer, in case of acceptance tests;
- the user, in case of reverification tests.

The errors of indication (FR, FT, FA) and the maximum permissible errors (MPE_{FR} , MPE_{FT} , MPE_{FA}) are expressed in micrometres.

4.2 Environmental conditions

Limits to be respected for permissible environmental conditions such as temperature conditions, air humidity and vibration at the site of installation that influence the measurements shall be specified by:

- the manufacturer, in case of acceptance tests;
- the user, in case of reverification tests.

In both cases, the user is free to choose the conditions within the specified limits.

4.3 Rotary table

The maximum permissible errors (MPE_{FR} , MPE_{FT} , MPE_{FA}) apply for any permitted loading, location and orientation of the rotary table on the CMM and for any locations of the test spheres on the rotary table within specified limits.

4.4 Stylus system

Limits to be respected for the stylus system configuration, to which the stated values of MPE_{FR} , MPE_{FT} , MPE_{FA} apply, shall be specified by:

- the manufacturer, in case of acceptance tests;
- the user, in case of reverification tests.

In both cases, the user is free to choose the stylus system configuration within the specified limits.

The form deviation of the stylus tip will influence the measurement results and shall be considered when proving conformance or non-conformance with specifications.

4.5 Operating conditions

The CMM shall be operated using the procedures given in the manufacturer's operating manual when conducting the tests given in clause 5. Specific areas in this manual to be adhered to are, for example:

- a) machine start up/warm up cycles;
- b) stylus system configuration;
- c) cleaning procedures for stylus tip and reference sphere;
- d) probing system qualification;
- e) rotary table set-up and qualification.

NOTE The stylus tip and the reference sphere should be cleaned before the probing system qualification so as to leave no residual film which could affect the measuring or test result.

5 Acceptance test and reverification test

5.1 Principles

The principle of the assessment method is to establish whether the CMM is capable of measuring within the stated maximum permissible errors (MPE_{FR} , MPE_{FT} , MPE_{FA}) by determining the variation of the measured coordinates of the centres of two test spheres mounted on the rotary table.

It is noted that on a perfect four-axis CMM, the location of the measured centres of the test spheres would remain fixed in the workpiece coordinate system while the table is rotated.

Each test sphere centre is determined in three directions: radial, tangential and axial. The position of each test sphere centre is represented in the workpiece coordinate system on a rotary table.

The centre of each test sphere, mounted on a rotary table, is measured in a series of measurements with different angular positions of the rotary table.

The errors of indication (FR, FT, FA) are calculated separately for each test sphere as the range between the maximum and minimum measurement results for each of the three directions.

In the following:

- acceptance tests are executed according to the manufacturer's specifications and procedures;
- reverification tests are executed according to the user's specifications and the manufacturer's procedures.

5.2 Measuring equipment

5.2.1 Two test spheres (A and B), with diameters no less than 10 mm and no greater than 30 mm and with certified form.

The diameters of the two test spheres, used in these tests as the corresponding input quantities, need not be calibrated since only the centres of the test spheres are used to determine the three four-axis errors. The form of the test spheres must be calibrated since the form deviations influence the test results and shall be taken into account when proving conformance or non-conformance with specifications.

The mounting of the test spheres should be sufficiently rigid to avoid errors due to bending especially when the axis of the rotary table is horizontal.

5.3 Procedure

Position the test sphere A on the rotary table as close as possible to the rotary table surface at a radius r , in accordance with Table 1. Position the test sphere B approximately at the same radius, r , and approximately diametrically opposite the test sphere A at a height, Δh (see Table 1 and Figure 1).

Define a Cartesian workpiece coordinate system on the rotary table (see Figure 1) conforming to the following conditions:

- a) the centre of test sphere B (farthest from the table surface) establishes the origin;
- b) the primary axis which defines the axial direction shall be parallel to the axis of the rotary table;
- c) the secondary axis which defines the radial direction shall lie in a plane that contains the primary axis and the centre of test sphere A.

NOTE 1 The tertiary axis defines the tangential direction.

Once the workpiece coordinate system is established begin the test by measuring test sphere B in its original position (position 0). The user can choose any angular position other than the zero reading of the rotary table for position 0 in Table 2.

Then the rotary table is rotated through a series of seven angular positions, and the position of the test sphere A is measured in each position. It is recommended that the positions of the seven measurements extend at least 720° from the starting position. Then the rotary table is rotated in the opposite direction to seven angular positions and the test sphere A is measured in each position. When the rotary table is returned to its starting position both test spheres should then be measured as position 14.

The rotary table is then rotated in the same direction to seven different angular positions and then rotated in the opposite direction to seven angular positions. The test sphere B is measured at each position. When the rotary table is returned to its original position both test spheres should be measured as position 28 (see Table 2).

NOTE 2 The heights and radii according to Table 1 are specified to facilitate comparisons between CMMs.


NOTE 3 The values of 200 mm transform each second of arc of angular error to approximately one micrometre of linear error. For aid in comparison of machines with differing measuring volumes, and in matching machine capability to workpiece tolerance requirements for large parts (i.e. parts larger than the table size), the errors resulting from the test procedures above are approximately proportional to the height and distance used.

NOTE 4 The user may choose any loading, location and orientation of the rotary table on the CMM within the limits specified by the manufacturer. The manufacturer and user may agree to additional test(s) using different test sphere location(s), if required.

NOTE 5 Some CMMs use the rotary table as a means of extending the measuring volume. On such CMMs, the test sphere may only be accessible to the probing system over an arc of rotation of the table which is less than 360°. On such machines the starting angular position of the rotary table must be such that the positions of both test spheres can be measured.

Table 1 — Location of the test spheres on the rotary table

Combination No.	Height difference	Radius
	Δh mm	r mm
1	200	200
2	400	200
3	400	400
4	800	400
5	800	800
NOTE Default values — one of the above combinations which must be specified by the manufacturer. Other values may be used by agreement between the manufacturer and the user.		

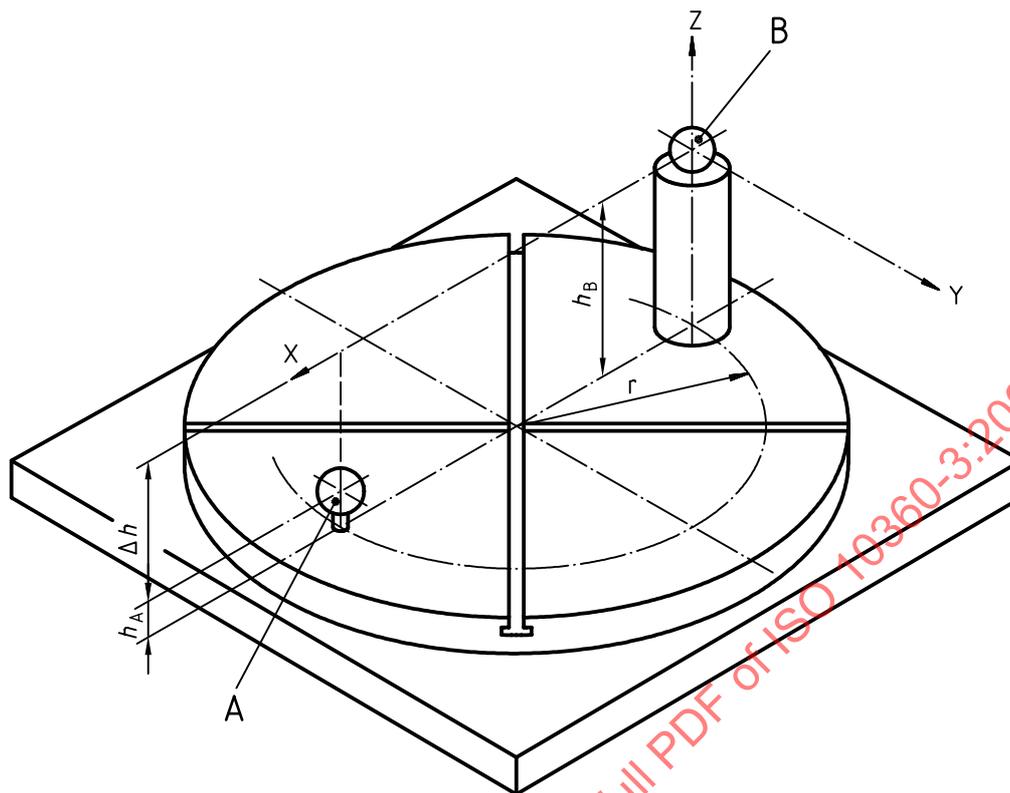

NOTE The X, Y and Z designations in this figure are used to illustrate directions with respect to the rotary table and do not necessarily represent machine axis designations.

Figure 1 — Test sphere positions on the rotary table for the acceptance test and reverification test


5.4 Obtainment of test results

Using measurements from positions 0 to 28 (designated X_A , Y_A , Z_A coordinates for test sphere A and X_B , Y_B , Z_B coordinates for test sphere B), compute the three four-axis errors (FR, FT, FA) as the peak-to-peak variation of each of the radial, tangential and axial coordinates of both the test sphere centres (see Table 2 and Figure 2).

NOTE 1 X_A and X_B are the radial components of the centres of the test spheres A and B to be used for the calculation of the radial four-axis error FR_A and FR_B .

NOTE 2 Y_A and Y_B are the tangential components of the centres of the test spheres A and B to be used for the calculation of the tangential four-axis error FT_A and FT_B .

NOTE 3 Z_A and Z_B are the axial components of the centres of the test spheres A and B to be used for the calculation of the axial four-axis error FA_A and FA_B .

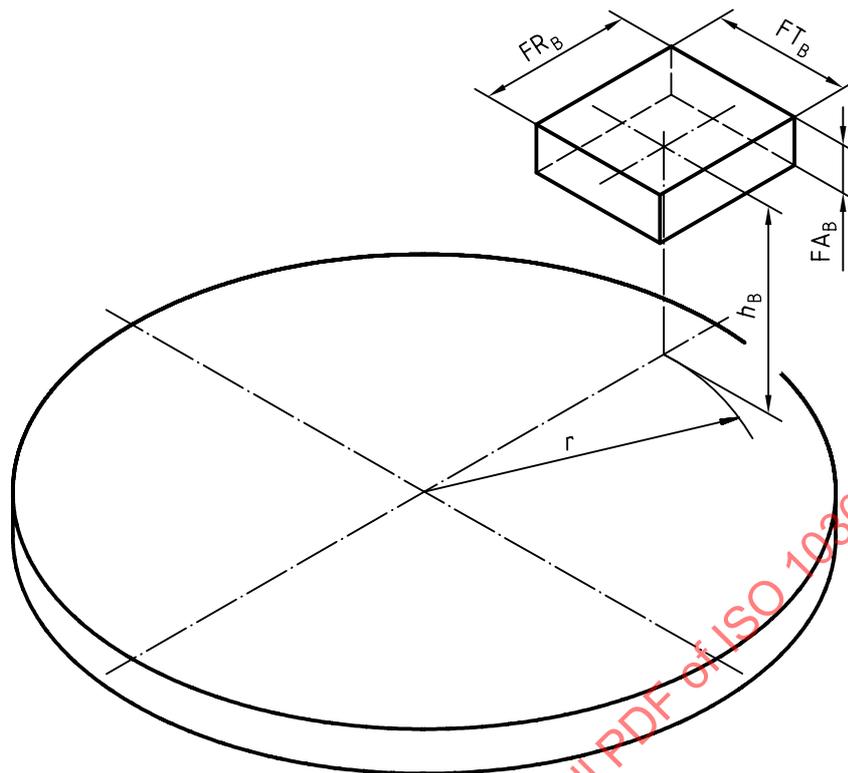

NOTE 1 r is the radius of test sphere B from the axis of the rotary table.

NOTE 2 h_B is the height of the centre of test sphere B from the workpiece clamping surface of the rotary table.

NOTE 3 The position of test sphere A is not indicated for reasons of clarity.

Figure 2 — Schematic representation of the volume generated by the three four-axis errors (FR_B , FT_B , FA_B) for the acceptance test and reverification test for a CMM with the axis of a rotary table as the fourth axis

Table 2 — Default nominal angular positions for rotary table test

Position No.	Angular position		Measured coordinates for					
	degrees		Test sphere A			Test sphere B		
	W_1	W_2	X_A	Y_A	Z_A	X_B	Y_B	Z_B
0	0	0	X_{A0}	$Y_{A0} = 0$	Z_{A0}	$X_{B0} = 0$	$Y_{B0} = 0$	$Z_{B0} = 0$
1	75	135	X_{A1}	Y_{A1}	Z_{A1}	—	—	—
2	125	225	X_{A2}	Y_{A2}	Z_{A2}	—	—	—
3	175	315	X_{A3}	Y_{A3}	Z_{A3}	—	—	—
4	385	405	X_{A4}	Y_{A4}	Z_{A4}	—	—	—
5	410	540	X_{A5}	Y_{A5}	Z_{A5}	—	—	—
6	510	630	X_{A6}	Y_{A6}	Z_{A6}	—	—	—
7	820	810	X_{A7}	Y_{A7}	Z_{A7}	—	—	—
8	510	630	X_{A8}	Y_{A8}	Z_{A8}	—	—	—
9	410	540	X_{A9}	Y_{A9}	Z_{A9}	—	—	—
10	385	405	X_{A10}	Y_{A10}	Z_{A10}	—	—	—
11	175	315	X_{A11}	Y_{A11}	Z_{A11}	—	—	—
12	125	225	X_{A12}	Y_{A12}	Z_{A12}	—	—	—
13	75	135	X_{A13}	Y_{A13}	Z_{A13}	—	—	—
14	0	0	X_{A14}	Y_{A14}	Z_{A14}	X_{B14}	Y_{B14}	Z_{B14}
15	– 75	– 135	—	—	—	X_{B15}	Y_{B15}	Z_{B15}
16	– 125	– 225	—	—	—	X_{B16}	Y_{B16}	Z_{B16}
17	– 175	– 315	—	—	—	X_{B17}	Y_{B17}	Z_{B17}
18	– 385	– 405	—	—	—	X_{B18}	Y_{B18}	Z_{B18}
19	– 410	– 540	—	—	—	X_{B19}	Y_{B19}	Z_{B19}
20	– 510	– 630	—	—	—	X_{B20}	Y_{B20}	Z_{B20}
21	– 820	– 810	—	—	—	X_{B21}	Y_{B21}	Z_{B21}
22	– 510	– 630	—	—	—	X_{B22}	Y_{B22}	Z_{B22}
23	– 410	– 540	—	—	—	X_{B23}	Y_{B23}	Z_{B23}
24	385	– 405	—	—	—	X_{B24}	Y_{B24}	Z_{B24}
25	– 175	– 315	—	—	—	X_{B25}	Y_{B25}	Z_{B25}
26	– 125	– 225	—	—	—	X_{B26}	Y_{B26}	Z_{B26}
27	– 75	– 135	—	—	—	X_{B27}	Y_{B27}	Z_{B27}
28	0	0	X_{A28}	Y_{A28}	Z_{A28}	X_{B28}	Y_{B28}	Z_{B28}
Four-axis errors			FR_A	FT_A	FA_A	FR_B	FT_B	FA_B
NOTE Angular positions W_1 apply to CMMs with partial coverage of the rotary table. Angular positions W_2 apply to CMMs with full coverage of the rotary table. Only one of these columns applies to a specific machine being tested. In this table a dash (—) means that no measurement is made of the location of that test sphere in that angular position. (See note 5, 5.3.)								

6 Compliance with specifications

6.1 Acceptance test

The performance of the CMM with the axis of a rotary table as the fourth axis is verified if none of the four-axis errors (FR_A , FT_A , FA_A , FR_B , FT_B , FA_B) are greater than the three maximum permissible four-axis errors (MPE_{FR} , MPE_{FT} , MPE_{FA}) as specified by the manufacturer, taking into account the uncertainty of measurement according to ISO 14253-1.

6.2 Reverification test

The performance of the CMM with the axis of a rotary table as the fourth axis is verified if none of the four-axis errors (FR_A , FT_A , FA_A , FR_B , FT_B , FA_B) are greater than the three maximum permissible four-axis errors (MPE_{FR} , MPE_{FT} , MPE_{FA}) as specified by the user. If compliance with specification shall be proved, the uncertainty of measurement shall be taken into account according to ISO 14253-1.

7 Applications

7.1 Acceptance test

In a contractual situation between a supplier and a customer such as described in

- a purchasing contract,
- a maintenance contract,
- a repair contract,
- a renovation contract,
- an upgrading contract, etc.,

the acceptance test described in this part of ISO 10360 can be used as a test to verify the performance of a CMM with the axis of a rotary table as the fourth axis in accordance with the specified maximum permissible errors MPE_{FR} , MPE_{FT} and MPE_{FA} as agreed upon by the supplier and the customer.

If the supplier does not specify any limitations, the three stated maximum permissible errors MPE_{FR} , MPE_{FT} and MPE_{FA} apply for any loading, location and orientation of the rotary table on the CMM.

7.2 Reverification test

In an organization's internal quality assurance system, the reverification test described in this part of ISO 10360 can be used as a test to verify the performance of a CMM with the axis of a rotary table as the fourth axis in accordance with the specified maximum permissible errors MPE_{FR} , MPE_{FT} and MPE_{FA} as stated by the user with possible detailed limitations applied.

7.3 Interim check

In an organization's internal quality assurance system, a reduced reverification test may be used periodically to demonstrate the probability that the CMM will conform with specified requirements regarding the three maximum permissible errors MPE_{FR} , MPE_{FT} and MPE_{FA} .

The extent of the reverification test as described in this part of ISO 10360 may be reduced in the following areas: number of test spheres, angular positions and number of measurements being performed.

Annex A (informative)

Interim check

If a rotary table is fixed to the CMM, the test described in clause 5 may be sufficient to quantify all errors related to all machine axes. It is not required to re-check all linear axes since all axes must be in “good working order” for the result of FR, FT and FA to conform with the specifications.

STANDARDSISO.COM : Click to view the full PDF of ISO 10360-3:2000

Annex B (informative)

Relation to the GPS matrix model

For full details about the GPS matrix model, see ISO/TR 14638.

B.1 Information about this part of ISO 10360 and its use

This part of ISO 10360 specifies the verification methods for proving conformance of coordinate measuring machines with the specified MPEs. The tests of this part of ISO 10360 are:

- applicable to a four-axis coordinate measuring machine with three axes for measuring workpiece coordinates, plus a rotary table for orienting the workpiece;
- designed to detect the system measuring errors relative to an axis system fixed to the rotary table;
- performed in addition to the size measuring tests according to ISO 10360-2, which are conducted with the rotary table stationary.

B.2 Position in the GPS matrix model

This part of ISO 10360 is a general GPS standard, which influences the chain link 5 of the chains of standards on size, distance, radius, angle, form, orientation, location, run-out and datums in the general GPS matrix, as graphically illustrated in Figure B.1.

Global GPS standards						
General GPS standards						
Chain link number	1	2	3	4	5	6
Size						
Distance						
Radius						
Angle						
Form of line independent of datum						
Form of line dependent on datum						
Form of surface independent of datum						
Form of surface dependent on datum						
Orientation						
Location						
Circular run-out						
Total run-out						
Datums						
Roughness profile						
Waviness profile						
Primary profile						
Surface imperfections						
Edges						

**Fundamental
GPS
standards**

Figure B.1