

INTERNATIONAL
STANDARD

ISO
14118

First edition
2000-09-15

**Safety of machinery — Prevention of
unexpected start-up**

Sécurité des machines — Prévention de la mise en marche intempestive

STANDARDSISO.COM : Click to view the full PDF of ISO 14118:2000



Reference number
ISO 14118:2000(E)

© ISO 2000

PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 14118:2000

© ISO 2000

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.ch
Web www.iso.ch

Printed in Switzerland

Contents

Foreword.....	iv
Introduction.....	v
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 General requirements.....	2
4.1 Isolation and energy dissipation.....	2
4.2 Other means to prevent unexpected [unintended] start-up.....	3
5 Means for isolation and energy dissipation.....	3
5.1 Devices for isolation from power supplies	3
5.2 Locking [securing] devices	3
5.3 Devices for stored-energy dissipation or restraint [containment]	4
5.4 Verification	5
6 Measures, other than isolation and energy dissipation, to prevent unexpected start-up	5
6.1 Design strategy	5
6.2 Measures to prevent accidental generation of start commands	6
6.3 Measures to prevent accidental start commands resulting in unexpected start-up	6
6.4 Automatic monitoring of the category 2 stopped condition	9
Annex A (informative) Examples of tasks which can require the presence of persons in danger zones	10
Annex B (informative) Signalling and warning.....	11
Bibliography.....	12

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 3.

Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this International Standard may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

International Standard ISO 14118 was prepared by Technical Committee ISO/TC 199, *Safety of machinery*.

ISO 14118 has been prepared to be a harmonized standard in the sense of the Machinery Directive of the European Union and associated regulations of the European Free Trade Association (EFTA). It is in relationship with, in particular, the essential safety requirements expressed in subclauses 1.2.3, 1.2.6, 1.2.7, 1.6.3 and 1.6.4 of annex A of ISO/TR 12100-2:1992.

STANDARDSISO.COM : Click to view the PDF of ISO 14118:2000

Introduction

Keeping a machine in a stopped condition while persons are present in danger zones is one of the most important conditions of the safe use of machinery and hence one of the major aims of the machine designer and machine user.

In the past, the concepts of "operating machine" and "stopped machine" were generally unambiguous; a machine was:

- operating when its movable elements, or some of them, were moving;
- stopped when its movable elements were at rest.

Machine automation has made the relationship between "operating" and "moving" on the one hand and "stopped" and "at rest" on the other hand, more difficult to define. Automation has also increased the potential for unexpected start-up, and a significant number of accidents have occurred where machines, stopped for diagnostic work or corrective actions, started up unexpectedly.

Hazards other than mechanical hazards generated by movable elements (e.g. from a laser beam) also need to be taken into account.

The risk assessment relating to the presence of persons in a danger zone of a stopped machine needs to take into account the probability of an unexpected start-up of the hazard-generating elements.

This International Standard provides machine designers and machinery safety standard technical committees with a survey of built-in measures which can be used to prevent unexpected start-up.

STANDARDSISO.COM : Click to view the full PDF of ISO 14118:2000

Safety of machinery — Prevention of unexpected start-up

1 Scope

This International Standard specifies designed-in means aimed at preventing unexpected machine start-up (see 3.2) to allow safe human interventions in danger zones (see annex A).

This International Standard applies to unexpected start-up from all types of energy source, i.e.:

- power supply, e.g. electrical, hydraulic, pneumatic;
- stored energy due to, e.g., gravity, compressed springs;
- external influences, e.g. from wind.

2 Normative references

The following normative documents contain provisions which, through reference in this text, constitute provisions of this International Standard. For dated references, subsequent amendments to, or revisions of, any of these publications do not apply. However, parties to agreements based on this International Standard are encouraged to investigate the possibility of applying the most recent editions of the normative documents indicated below. For undated references, the latest edition of the normative document referred to applies. Members of ISO and IEC maintain registers of currently valid International Standards.

ISO/TR 12100-1:1992, *Safety of machinery — Basic concepts, general principles for design — Part 1: Basic terminology, methodology.*

ISO/TR 12100-2:1992, *Safety of machinery — Basic concepts — General principles for design — Part 2: Technical principles and specifications.*

ISO 14121, *Safety of machinery — Principles for risk assessment.*

IEC 60204-1:1997, *Electrical equipment of industrial machines — Part 1: General requirements.*

EN 1070, *Safety of machinery — Terminology.*

3 Terms and definitions

For the purposes of this International Standard, the terms and definitions given in EN 1070 and the following apply.

3.1

start-up

machine start-up

change from rest to motion of a machine or of one of its parts

NOTE The definition includes functions other than motion, e.g. switch-on of a laser beam.

3.2

unexpected [unintended] start-up

any start-up caused by:

- a start command which is the result of a failure in, or an external influence on, the control system;
- a start command generated by inappropriate action on a start control or other parts of the machine as, e.g., a sensor or a power control element;
- restoration of the power supply after an interruption;
- external/internal influences (gravity, wind, self-ignition in internal combustion engines, etc.) on parts of the machine.

NOTE Start-up by the normal operation of automatic machinery is not to be considered as unintended start-up, but can be considered to be unexpected from the point of view of the operator. Prevention of accidents in this case involves the use of safeguarding measures (see ISO/TR 12100-2:1992, clause 4).

3.3

isolation and energy dissipation

procedure which consists of all of the four following actions:

- a) isolating (disconnecting, separating) the machine (or defined parts of the machine) from all power supplies;
- b) locking (or otherwise securing), if necessary (for instance in large machines or in installations), all the isolating units in the "isolated" position;
- c) dissipating or restraining [containing] any stored energy which may give rise to a hazard.

NOTE Energy considered in c) above may be stored in e.g.:

- mechanical parts continuing to move through inertia;
 - mechanical parts liable to move by gravity;
 - capacitors, accumulators;
 - pressurized fluids;
 - springs.
- d) verifying by using a safe working procedure that the actions taken according to a), b) and c) above have produced the desired effect.

4 General requirements

4.1 Isolation and energy dissipation

Machines shall be provided with means intended for isolation and energy dissipation (see clause 5), especially with a view to major maintenance, work on power circuits and decommissioning in accordance with the essential safety requirement expressed in ISO/TR 12100-2:1992, annex A, 1.6.3.

4.2 Other means to prevent unexpected [unintended] start-up

If the use of isolation and energy dissipation is not appropriate (e.g. for frequent short interventions), the designer shall provide, according to the risk assessment in accordance with ISO 14121, other measures (see clause 6) to prevent unexpected start-up. Additional means such as signalling and/or warning may be appropriate (see annex B).

NOTE 1 Examples of tasks which can require the presence of persons in danger zones are given in annex A.

NOTE 2 According to ISO/TR 12100-1:1992, 5.7.1, the designer should determine as completely as possible the different machine operating modes and the need for the presence of persons in danger zones. Appropriate safety measures can then be provided. These measures should prevent operators from being induced to use hazardous operating modes and hazardous intervention techniques caused by technical difficulties in the use of the machine (see ISO/TR 12100-1:1992, 3.12).

5 Means for isolation and energy dissipation

5.1 Devices for isolation from power supplies

5.1.1 Isolation devices shall:

- ensure a reliable isolation (disconnection, separation);
- have a reliable mechanical link between the manual control and the isolating element(s);
- be equipped with clear and unambiguous identification of the state of the isolation device which corresponds to each position of its manual control (actuator).

NOTE 1 For electrical equipment, a supply disconnecting device complying with IEC 60204-1:1997, 5.3 "Supply disconnecting (isolating) device" meets this requirement.

NOTE 2 Plug and socket systems (for electrical supplies), or their pneumatic, hydraulic or mechanical equivalents, are examples of isolating devices with which it is possible to achieve a visible and reliable discontinuity in the power supply circuits. For electrical plug/socket combinations, see IEC 60204-1:1997, 5.3.2 d).

NOTE 3 For hydraulic and pneumatic equipment, see also EN 982:1996, 5.1.6 and EN 983:1996, 5.1.6.

5.1.2 The location and number of isolation devices will be determined by the configuration of the machine, the need for the presence of persons in danger zones and the risk assessment. Each isolation device shall be readily identifiable as to which machine, or part of it, it isolates (e.g. by durable marking where necessary).

NOTE For electrical equipment of machinery, see also IEC 60204-1:1997, 5.4.

5.1.3 When, during isolation of the machine, certain circuits have to remain connected to their power supply in order, e.g., to hold parts, protect information or provide local lighting, special means shall be provided to ensure operator safety.

NOTE Such means include enclosures which can be opened only with a key or a special tool, warning labels and/or warning lights.

5.2 Locking [securing] devices

The isolation devices shall be capable of being locked or otherwise secured in the "isolated" position.

NOTE Locking devices may not be necessary when a plug/socket combination is used and the plug can be kept under immediate supervision of the person present in the danger zone.

Locking devices include:

- facilities to apply one or more padlocks;
- trapped-key interlocking devices (see ISO 14119:1998, annex E), one of the locks of which is associated with the manual control [actuator] of the isolating device;
- lockable housings or enclosures.

Locking devices are not required when reconnection cannot endanger persons.

5.3 Devices for stored-energy dissipation or restraint [containment]

5.3.1 General

5.3.1.1 Devices for stored-energy dissipation or restraint [containment] shall be incorporated into the machine where stored energy can give rise to a hazard.

NOTE Such devices include brakes intended to absorb kinetic energy of moving parts, resistors and relevant circuitry to discharge electrical capacitors, valves or similar devices to depressurize fluidic accumulators (see EN 982:1996, 5.1.6 and EN 983:1996, 5.1.6).

5.3.1.2 When dissipation of stored energy would excessively reduce the ability of the machine to be used, additional means shall be incorporated to reliably restrain or contain the remaining stored energy.

5.3.1.3 The devices for energy dissipation or restraint [containment] should be selected and arranged so that:

- dissipation or restraint [containment] results from the isolation of the machine (or part of it);
- the energy dissipation process does not give rise to hazardous situations.

5.3.1.4 The necessary procedures for energy dissipation or restraint [containment] shall be described in the instruction handbook of the machine or in warnings on the machine itself.

5.3.2 Mechanical elements

When mechanical elements can give rise to a hazardous situation

- by virtue of their mass and position (e.g. unbalanced, or raised, or in any situation where they could move under the effect of gravity),
- or as a result of the action upon them of spring load (whatever this "spring" is made of),

means shall be provided to bring them to the lowest energy state (e.g. lowest position or spring-relaxed) either by the usual machine manual controls or by devices specifically designed and identified (marked) for that function.

When the mechanical elements cannot be brought into an intrinsically safe state, they shall be mechanically secured by brakes or mechanical restraint devices in accordance with ISO/TR 12100-1:1992, 3.23.6.

5.3.3 Locking or securing facilities for the restraint [containment] devices

The devices for energy restraint [containment] shall whenever necessary be capable of being locked or otherwise secured.

5.4 Verification

5.4.1 General

The machine and the isolation and energy dissipation or restraint [containment] devices shall be designed, selected and arranged so that reliable verification of the effectiveness of the isolation and energy dissipation or restraint [containment] can be carried out.

Provisions to verify the effectiveness of the isolation, energy dissipation and restraint [containment] measures shall not impair their effectiveness.

5.4.2 Provisions for verifying isolation

Isolation from any power supply shall either be visible (visible break in the power supply circuits) or indicated by an unambiguous position of the manual control (actuator) of the isolating device.

NOTE See also 5.1.1 relating to the mechanical link between the isolating element(s) and the manual control.

5.4.3 Provisions for verifying energy dissipation or restraint [containment]

5.4.3.1 Built-in devices (such as pressure gauges) or test points shall be provided for verifying the absence of energy in parts of a machine in/on which interventions are intended.

5.4.3.2 The instruction handbook (see ISO/TR 12100-2:1992, 5.5) shall provide precise guidance on safe verification procedures.

5.4.3.3 Permanent labels shall be fixed to assemblies, warning against hazards due to stored energy (e.g. compressed springs) where assemblies can be removed or dismantled.

6 Measures, other than isolation and energy dissipation, to prevent unexpected start-up

6.1 Design strategy

For every application where isolation and energy dissipation are not appropriate for all interventions, the designer shall decide, in accordance with the risk assessment, the measures (among those listed below) considered necessary to prevent unexpected start-up. These are given as follows:

- measures (component design, selection and location) to prevent accidental generation of start commands from external or internal influences in any part of the machine (see 6.2);
- measures, dependent on the system architecture/structure, provided to prevent accidental start commands resulting in an unexpected start-up (see 6.3);
- means automatically stopping the hazard-generating part of the machine before a hazardous situation can arise from an unexpected/unintended start-up of this part (see 6.4).

The selected measures shall not be considered to be a substitute for the measures for isolation and energy dissipation set out in clause 5.

NOTE The selected measures will in most cases be a combination of the different measures described in this clause.

6.2 Measures to prevent accidental generation of start commands

6.2.1 Measures to prevent accidental actuation of (manual) start controls

Accidental actuation of (manual) start controls, as well as unexpected results from actuating these devices (e.g. start-up of a machine other than the expected one, or initiation of a movement in a wrong direction), shall be prevented by appropriate design, location, protection and marking of (manual) start controls [actuators]. The expected results/effects of actions on start controls shall be made clear, e.g. by use of indication means (see also first paragraph of annex B), in cases where lack of such information can endanger persons.

NOTE 1 Guidance is given in ISO/TR 12100-2:1992, 3.7.8 and in IEC 61310.

NOTE 2 Other examples of measures to prevent unauthorized/unintended start-up are locking of start manual controls, passwords in programmable control systems.

6.2.2 Design of safety-related parts of data storage and processing equipment

The safety-related parts of the data storage and processing equipment (see Figure 1) shall be designed, and their components selected, so that the probability of this equipment generating start commands which may lead to an unexpected start-up, when it is taken into account in the risk assessment carried out in accordance with ISO 14121, can be considered to be sufficiently low.

NOTE 1 Guidance is given in:

- ISO/TR 12100-2:1992, 3.7;
- IEC 60204-1:1997, especially clauses 9 and 11.

See also ISO 13849-1.

NOTE 2 Where programmable electronic systems are used for the control of machinery, it is believed at present that it is difficult to determine, with any degree of certainty in situations where a significant hazard can occur due to the maloperation of the control system, that reliance on correct operation of a single channel of programmable electronic equipment can be assured. Until this situation can be resolved, it is inadvisable to rely solely on the correct operation of such a single channel device (see IEC 60204-1:1997, NOTE to 11.3.4).

6.2.3 Selection and location of power control elements

Power control elements (e.g. contactors, valves: see Figure 1) shall be selected and/or applied so that they cannot change their state under the effect of external influences (such as vibration or shocks of the highest expected value within intended conditions of use) or of disturbances of the power supply (such as pressure or voltage fluctuations within defined tolerances).

Power control elements shall, if necessary (especially if they can be manually operated), be located in an enclosure to prevent their unauthorized or unintended actuation.

6.3 Measures to prevent accidental start commands resulting in unexpected start-up

6.3.1 Principle

Maintained stop commands are introduced, separately or in combination, in the machine at different "levels" (see Figure 1). These can be generated either by stop control devices (see 6.3.2) or by safety [protective] devices (see 6.3.3). Mechanical disconnection (see 6.3.4) or moving-part immobilization (see 6.3.5) may be used instead of, or in addition to, maintained stop commands.

An accidental start command should not result in machine start-up if it is generated by/in a machine component placed above the level at which a maintained stop command has been introduced (level A, B or C), or if mechanical disconnection (level D) or moving-part immobilization (level E) has been achieved (see Figure 1).

6.3.2 Input, at level A, B or C (see Figure 1), of a maintained stop command generated by a stop control device

To prevent unexpected [unintended] start-up due to accidental generation of start commands (including those generated within the control system itself), the stop manual control (or the stop control device) can be secured in the OFF/STOP condition, provided that the control system is designed so that the stop commands from the stop control device have priority over the start commands in accordance with the essential safety requirement expressed in ISO/TR 12100-2:1992, annex A, 1.2.4. Securing in the OFF/STOP condition can be achieved by means of:

- a latching-in or key-operated stop control device which applies a maintained stop command until the device is reset manually;
- a lockable selector switch with a reliable and unambiguous indication of position which applies a maintained stop command until the switch is manually reset;
- a lockable cover which, when locked closed, forces the stop manual control into the OFF/STOP condition. If this cover also prevents access to the start manual control, accidental operation of this start control is prevented;
- a movable guard which, from the very beginning of its opening stroke, forces the stop manual control into the OFF/STOP condition. If the movable guard also prevents access to the start manual control, accidental operation of this start control is prevented.

Criteria for the design and selection of the securing means suitable for the intended application are:

unambiguity, i.e. clear and unambiguous indication when the device is in the OFF/STOP condition;

reliability, as far as the ability of the device to remain in the OFF/STOP condition is concerned.

Where a stop control is provided with a securing device to retain it in the OFF/STOP condition, removal of the securing device shall not by itself cause a restart command.

6.3.3 Input, at level A, B or C (see Figure 1), of a maintained stop command generated by a safety [protective] device

To prevent operation of a machine (from whatever cause, including unexpected start-up) when a person is in a danger zone, a safety [protective] device or combination of safety [protective] devices can be selected. The permanent stop command it generates shall be introduced at the appropriate level (see Figure 1), in accordance with the risk assessment (see ISO 14121).

NOTE International Standards giving guidance include:

- ISO/TR 12100-2:1992, 4.1;
- ISO 14119, dealing with interlocking devices associated with guards.
- ISO 13856-1, dealing with pressure-sensitive mats and floors.
- IEC 61496-1 and IEC 61496-2, dealing with electrosensitive protective equipment.

International Standards on pressure-sensing edges, bars, bumpers, plates and on trip wires are in preparation (see Bibliography).

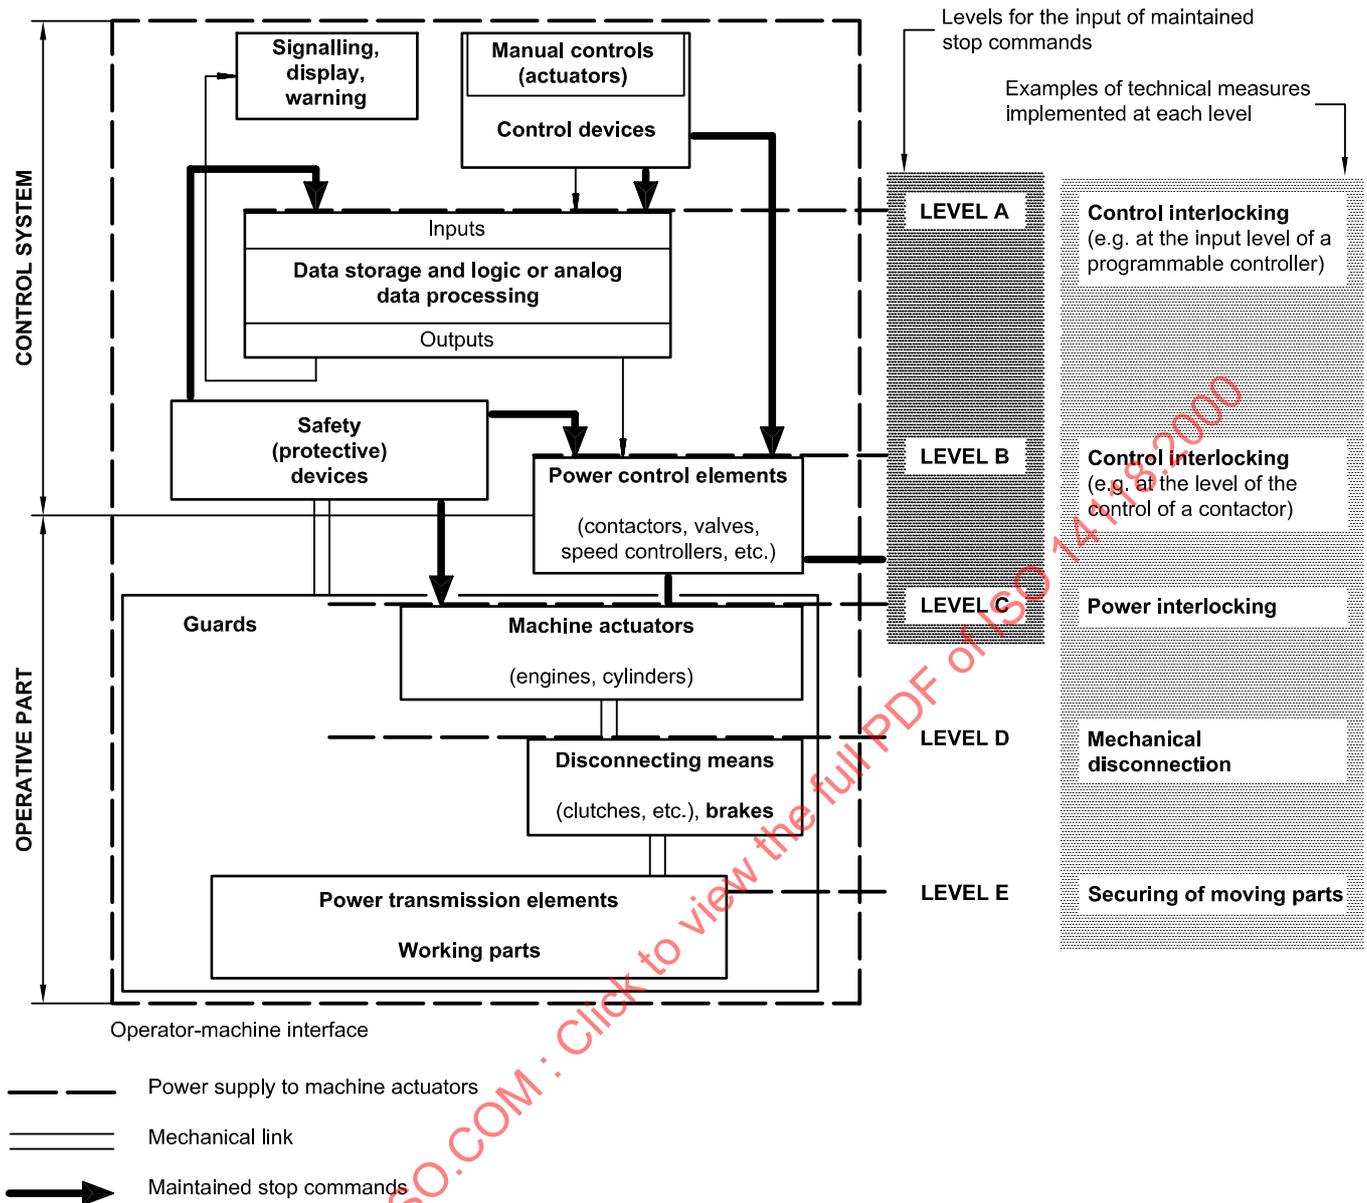


Figure 1 — Application of measures, other than isolation and energy dissipation, to prevent accidental start commands resulting in unexpected start—up

[based on ISO/TR 12100—1:1992, annex A]

6.3.4 Mechanical disconnection (level D: see Figure 1)

Mechanical disconnecting devices, e.g. clutches, shall be designed, selected and used, and where necessary monitored, so that the separation from machine actuators is ensured.

6.3.5 Moving-part immobilization (level E: see Figure 1)

When a moving part is immobilized by means of a mechanical restraint device (see for example ISO/TR 12100-1:1992, 3.23.6), e.g. a wedge, spindle, strut, scotch, which is an integral part of the machine, the mechanical strength of this mechanical restraint device shall be sufficient to withstand the forces resulting from start-up of the machine.

Where this is not practicable and mechanical immobilization is needed to prevent, for instance, movement of parts under the influence of gravity, or if starting up the machine actuators with immobilized moving parts can damage the machine or generate risk for persons in its vicinity, an interlocking device operating at level B or C (see Figure 1) shall prevent the machine from starting up as long as the mechanical restraint device immobilizes the moving parts.

6.4 Automatic monitoring of the category 2 stopped condition

When a machine is at rest as a result of a category 2 stop as defined in IEC 60204-1:1992, 9.2.2, any accidental start command could give rise to an unexpected start-up.

If other measures to prevent unexpected start-up are not practicable, one method is to monitor the stopped condition and to arrange for a category 0 stop to be initiated as soon as the conditions for (or the beginning of) an unexpected start-up are detected.

STANDARDSISO.COM : Click to view the full PDF of ISO 14118:2000

Annex A
(informative)

**Examples of tasks which can require the presence of persons
in danger zones**

- inspection;
- corrective actions (clearing blockages, etc.);
- setting, adjustment;
- manual loading/unloading;
- tool change;
- lubrication;
- cleaning;
- decommissioning;
- minor maintenance/repair;
- diagnostic, testing;
- work on power circuits;
- major maintenance (works requiring significant dismantling).

STANDARDSISO.COM : Click to view the full PDF of ISO 14118:2000