
**Space systems — Safety and
compatibility of materials —**

Part 1:

**Determination of upward flammability of
materials**

Systèmes spatiaux — Sécurité et compatibilité des matériaux —

Partie 1: Détermination de l'inflammabilité verticale des matériaux

STANDARDSISO.COM : Click to view the full PDF of ISO 14624-1:2003



PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 14624-1:2003

© ISO 2003

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

Contents

Page

Foreword	iv
Introduction	v
1 Scope	1
2 Conformance	1
3 Terms and definitions	1
4 Principle	2
5 Reagents	2
6 Test system	2
7 Test specimens	5
8 Procedure	7
9 Accuracy	7
10 Test report	8
Annex A (informative) Competency and accreditation of test facilities	9
Annex B (informative) Preparation and qualification of chemical ignitors	10
Bibliography	15

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 14624-1 was prepared by Technical Committee ISO/TC 20, *Aircraft and space vehicles*, Subcommittee SC 14, *Space systems and operations*.

ISO 14624 consists of the following parts, under the general title *Space systems — Safety and compatibility of materials*:

- *Part 1: Determination of upward flammability of materials*
- *Part 2: Determination of flammability of electrical-wire insulation and accessory materials*
- *Part 3: Determination of offgassed products from materials and assembled articles*
- *Part 4: Determination of upward flammability of materials in pressurized gaseous oxygen or oxygen-enriched environments*
- *Part 5: Determination of reactivity of materials with aerospace propellants*
- *Part 6: Determination of reactivity of processing materials with aerospace fluids*
- *Part 7: Determination of permeability of materials to aerospace fluids*

Introduction

Throughout this part of ISO 14624, the minimum essential criteria are identified by the use of the imperative or the key word “shall”. Recommended criteria are identified by the use of the key word “should” and, while not mandatory, are considered to be of primary importance in providing serviceable, economical and practical designs. Deviations from the recommended criteria may be made only after careful consideration, extensive testing and thorough service evaluation have shown an alternative method to be satisfactory.

STANDARDSISO.COM : Click to view the full PDF of ISO 14624-1:2003

Space systems — Safety and compatibility of materials —

Part 1: Determination of upward flammability of materials

1 Scope

This part of ISO 14624 specifies a method for the determination of the flammability of aerospace materials by upward flame propagation. Specifically, this test determines if a material, when exposed to a standard ignition source, will self-extinguish and not transfer burning debris to adjacent materials which can be ignited by such debris.

2 Conformance

The test shall be performed in an accredited test facility (see Annex A for guidelines).

The authority having jurisdiction, or the test requester, shall provide properly identified material(s) for testing. Alternatively, accredited test facilities may be authorized by the test requester to procure the appropriate material(s).

3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

3.1

burn length

distance from the bottom of the specimen to the farthest evidence of damage to the test specimen due to flame impingement

NOTE This distance includes areas of partial or complete combustion, charring or embrittlement, but does not include areas which are sooted, stained, warped or discoloured, or areas where the material has shrunk or melted away from the heat.

3.2

burn propagation time

time that elapses from ignition of the specimen until vertical flame propagation stops

3.3

self-extinguishing

phenomenon wherein the burn length of a material does not exceed 150 mm

3.4

thin-film specimen

specimen with a total thickness of less than 0,25 mm

NOTE Fabrics or coatings applied to a substrate are excluded.

3.5

transfer of burning debris

movement of burning particles from a burning specimen to adjacent materials

3.6 worst-case configuration
combination of material thickness, test pressure, oxygen concentration and temperature that make the material most flammable

3.7 worst-case use thickness
material thickness that, for a specific application, makes the material most flammable

EXAMPLE The smallest thickness for use without a substrate or the greatest thickness for use with a substrate.

4 Principle

An ignition source with specific characteristics is applied for a defined period of time to the lower end of a specimen of material oriented vertically in a test chamber or fume hood containing a specific test environment. The maximum post-test burn length for at least three standard-sized specimens is recorded. Materials are considered self-extinguishing, when this test method is used, if the maximum burn length for three standard-sized specimens does not exceed 150 mm. In addition, the ignited specimens shall not transfer burning debris to adjacent materials. Failure of any one specimen constitutes failure of the material in that test environment. Materials shall be tested in the worst-case configuration.

5 Reagents

5.1 Test gases, premixed before exposing the specimen to them and verified for conformity with the specification (including accuracy) for oxygen concentration to within $\pm 0.1\%$.

6 Test system

6.1 Test chamber, large enough so that complete combustion of the specimen can occur with no more than a 5 % relative depletion of oxygen concentration. In addition, the test chamber shall not interfere chemically or physically with the test.

Testing may be conducted in a fume hood if the above conditions can be met.

6.2 Measuring devices, properly calibrated.

6.3 Chemical ignition source, meeting the following specifications under ambient conditions:

- a) energy: 3 000 J;
- b) temperature: $1\,100\text{ °C} \pm 90\text{ °C}$;
- c) burning duration: $25\text{ s} \pm 5\text{ s}$;
- d) maximum visible flame height: $65\text{ mm} \pm 6,5\text{ mm}$.

Annex B provides a procedure for preparing, certifying and storing chemical ignitors.

Alternative ignition mechanisms may be utilized if they meet the requirements outlined in a) to d) above.

6.4 Power supply, capable of providing 15 A (RMS), connected to a bare 20 AWG nickel-chromium wire (6.5) to initiate the igniter.

6.5 Bare 20 AWG nickel-chromium wire, with a nominal resistivity of $2,3\ \Omega\cdot\text{m}$ and of sufficient length to wrap three equally spaced turns around the chemical igniter.

6.6 Suitable specimen holder, capable of supporting the specimen in the vertical position.

6.6.1 Standard specimen holder (see Figure 1), allowing 50 mm of the width of the specimen to be exposed and extending over the full length of the specimen.

The bottom of the specimen holder shall be located at least 250 mm from the bottom of the test chamber.

6.6.2 Specimen holder for thin-film specimens, allowing at least 50 mm of the width of the specimen to be exposed and minimizing shrinkage of the test material away from the flame. For large thin-film specimens, the exposed width may be up to 150 mm.

Two types of specimen holder may be used:


- a) a holder similar to the standard specimen holder (see 6.6.1 and Figure 1), except that it employs three wing-nut clamps instead of one long clamp;
- b) a holder employing needle rakes to hold the specimen (see Figure 2).

6.7 Scale, attached to one side of the specimen holder, for measurement of the burn length.

6.8 Sheet of paper, mounted horizontally approximately 200 mm below the specimen holder, but 50 mm above the bottom of the test chamber, centred directly below the specimen and having the following characteristics:

- a) dimensions: (200 mm \pm 50 mm) \times (300 mm \pm 50 mm);
- b) surface density: between 200 g/m² and 300 g/m²;
- c) type: chemical wood index;
- d) colour: uniformly white;
- e) condition: clean, free from dirt spots, oil spots and foreign matter (lint, fuzz, etc.), free from holes, tears, cuts, folds and scuff marks, and containing no splices.

The sheet of paper is used to assess if burning debris from the specimen would cause ignition of adjacent materials.

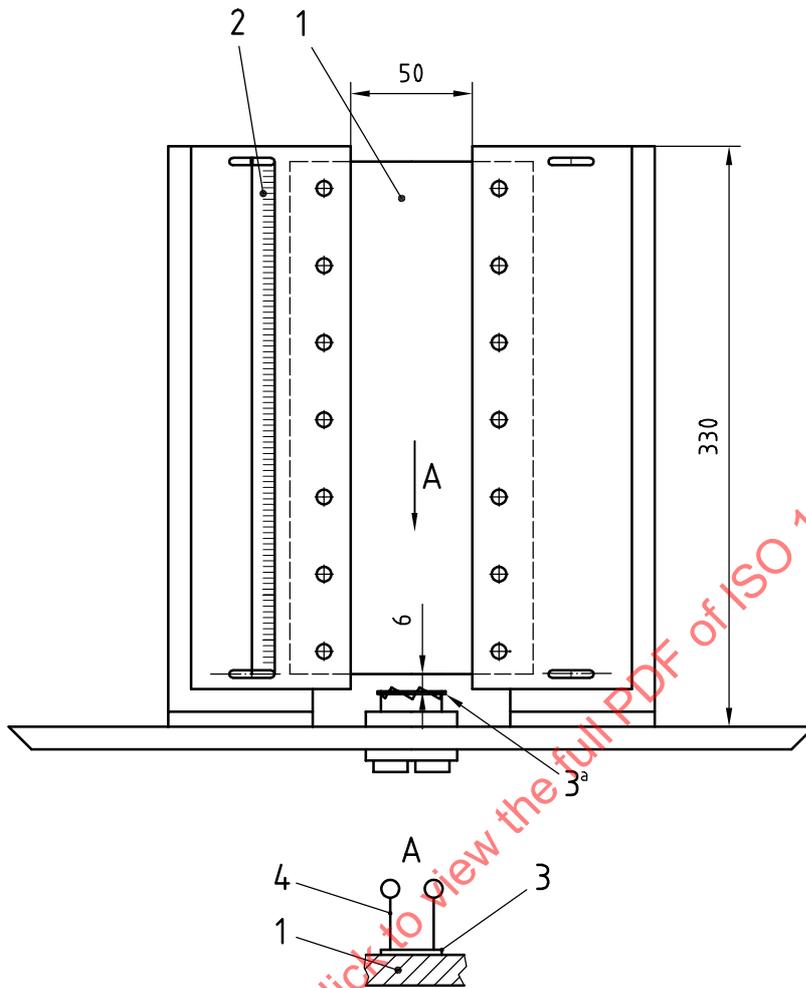


Key

- 1 specimen
- 2 scale
- 3 ignitor
- 4 nickel-chrome wire

^a The ignitor is placed inside the coil.

Figure 1 — Standard specimen holder

Dimensions in millimetres

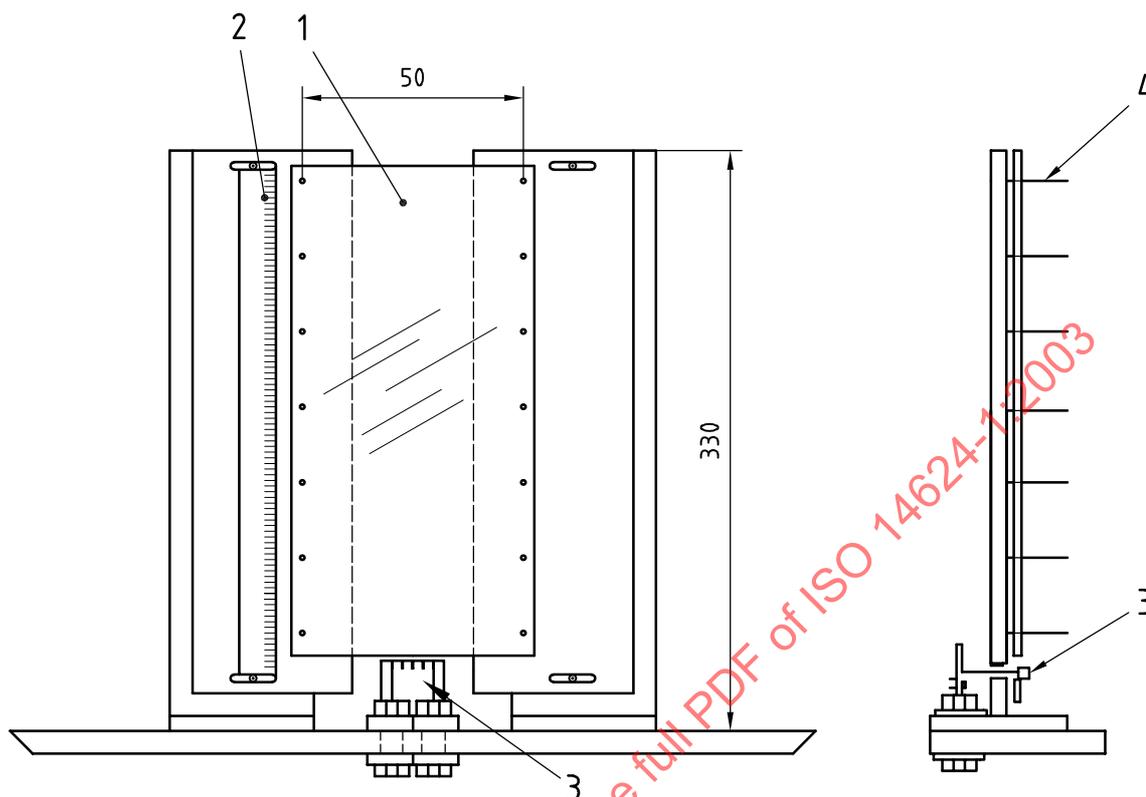**Key**

- 1 specimen
- 2 scale
- 3 ignitor
- 4 needle

Figure 2 — Needle-rake mount for thin-film specimens**7 Test specimens****7.1 Materials**

The minimum quantities of materials required to perform each test properly are summarized in Table 1. Actual test configurations and material quantities for material forms other than those listed (e.g. O-rings and other seals) shall be established and approved by the responsible procuring activity/user materials organization.

Table 1 — Minimum quantities of materials required for testing for each atmosphere

Form of material	Minimum quantity
Sheets	6 specimens measuring 300 mm × 65 mm × the required thickness
Thin films	6 specimens measuring 300 mm × 75 mm × the required thickness When the influence of the test stand on the results is of concern, large thin films measuring 300 mm × 200 mm × the required thickness may optionally be used, subject to the approval of the authority having jurisdiction.
Coatings	Sufficient to cover, at the required thickness, 6 substrates measuring 300 mm × 65 mm
Foams	6 specimens measuring 300 mm × 65 mm × the required thickness
Insulated wires	2 m in length

As a minimum, all materials used in testing shall meet or exceed user specifications.

Material and configured-system characteristics can be significantly compromised by sources of contamination, such as exposure to solvents, cleaning agents, abnormal temperatures, variations in humidity, environmental pollutants, particulates and handling. It is important that exposure of test material(s) to these and other contamination sources be sufficiently controlled to minimize variation in test results.

7.2 Reception and inspection of material

7.2.1 Receive and visually inspect the test material: when received, it shall be accompanied by proper identification and its thickness shall correspond to the specified worst-case use thickness. Any flaws shall be noted. Specimens should have been cleaned and dried to the end-use specifications prior to receipt at the test facility.

7.2.2 If required, prepare specimens to the proper dimensions, including worst-case use thickness.

7.2.3 If specimens are received with obvious contamination, clean them. All cleaning methods shall be approved by the test requester prior to use. Surface contamination should be removed by washing with deionized water and mild detergent, rinsing with deionized water, and drying with filtered nitrogen gas. As a minimum, particulates on the surfaces of solid porous specimens should be removed with filtered nitrogen gas.

7.2.4 After preparation and/or cleaning at the test facility, inspect the specimens to ensure that they are at the specified worst-case use thickness. Any flaws and any residual contamination shall be noted. If the flaws result from specimen preparation at the test facility, new specimens shall be prepared. Specimens shall be weighed and individually identified.

7.3 Preparation of test specimens

7.3.1 Sheet and other bulk-form specimens shall be cut to 300 mm × 65 mm in the worst-case use thickness. Materials, configurations and components that cannot be prepared to these requirements shall be tested in the configuration as purchased. Non-standard specimens shall be mounted in the chamber in a manner that will not inhibit flame propagation.

7.3.2 Materials that require a cure shall be prepared in the worst-case use thickness and cured according to the requester's instructions. The specimens shall be cut to 300 mm × 65 mm.

7.3.3 Coatings or any viscous material that cannot be mounted for testing without a substrate shall be applied to the end-use substrate material in the worst-case use thickness. Aluminium substrates approximately 0,5 mm thick may be used if the end-use substrate is unknown or inappropriate. Any requested cures shall be performed. The specimens shall measure 300 mm × 65 mm. Coatings, films or adhesive-backed tapes proposed for use on non-metallic surfaces shall be applied to the proposed non-metallic surface, in the worst-case use thickness.

7.3.4 Non-adhesive-backed hook-and-loop tapes shall be tested in the "as received" condition, unless otherwise noted by the requester. Adhesive-backed hook-and-loop tapes shall be applied to a 300 mm × 65 mm × 0,5 mm aluminium substrate. To ensure ignition of the tape backing, as opposed to the hooks or loops only, approximately 13 mm of the test specimen shall extend beyond the substrate.

7.3.5 Semi-solid materials shall be applied to a suitable non-combustible substrate such as glass-fibre cloth. Semi-solids shall be applied to the substrate as a uniform coat.

7.3.6 Liquid materials shall be tested using an appropriate standard test for determining the flash point of liquids.

7.3.7 Thin-film specimens shall be cut to 300 mm × 75 mm. Optionally, large thin films measuring 300 mm × 200 mm may be used, subject to the approval of the authority having jurisdiction, to reduce material shrinkage away from the flame.

8 Procedure

WARNING — Burning of materials may produce smoke and toxic gases, which can affect the health of operators. The test area shall be cleared of smoke and fumes by suitable means.

8.1 Before testing

Before testing, record all pertinent information (including oxygen concentration, specimen identification, and specimen pre-test mass and size). All specimens should be photographed.

The test system shall be visibly clean, and all measuring devices shall be in proper calibration.

The exposed centre section of standard-sized specimens shall be 50 mm wide. Specimens shall not be overly stretched or tightened, which would cause lines of horizontal stress. Mount thin films with 10 mm of slack in the width to allow for shrinkage.

Place the ignitor parallel to the lower edge of the specimen and centred along the plane of the front surface of the specimen, 6 mm \pm 1 mm below the lower edge of the specimen. Care shall be exercised when testing materials on substrates to ensure that the ignitor is centred along the plane of the front surface of the specimen and not that of the substrate.

All tests should be videotaped.

8.2 Test

8.2.1 Before ignition

Prior to ignition, expose the specimen to the proper test atmosphere for a minimum of 3 min (exposure of the specimen to a vacuum shall be less than 3 min). At least three replicate specimens shall be tested.

Measure, verify and record the percentage oxygen concentration and the total pressure.

Activate the chemical ignitor and the timing device used to measure the burn propagation time. Immediately upon ignition of the ignitor, turn off the power to the ignitor.

8.2.2 After ignition

Observe the vertical surfaces of the specimen and record any pertinent observations.

EXAMPLE Transfer of burning debris.

8.3 After testing

After the test, record the final oxygen concentration, the burn length and the post-test mass. Post-test photographs should be taken, as required, to document any abnormal occurrences.

9 Accuracy

Measurements shall be made within the following tolerance limits:

- a) absolute pressure: $\pm 1 \%$;
- b) oxygen concentration: $\pm 0,5 \%$;
- c) specimen dimensions: $\pm 5 \%$;
- d) specimen mass: $\pm 1 \%$;
- e) burn length: $\pm 10 \text{ mm}$.

10 Test report

10.1 Standard tests

The test report shall include details of the specimen identification, the specimen configuration, the test conditions and the observations from the test. Proper reporting of the test observations, such as the burn length, the transfer of burning debris, and other observations (especially of unusual behaviour) is critical. The test report shall be submitted to the authority having jurisdiction and/or the test requester.

10.2 Non-standard tests

When there is a deviation from standard test parameters, such as non-standard specimen preparation, specimen dimensions, specimen orientation, test stand or ignition source, the test shall be identified as non-standard. In addition, all information in 10.1 shall be reported.

STANDARDSISO.COM : Click to view the full PDF of ISO 14624-1:2003(E)

Annex A (informative)

Competency and accreditation of test facilities

A.1 Competency

Laboratories should be accredited to perform the flammability and/or combustion test methods contained within this part of ISO 14624. Accreditation is necessary because data from such testing is presented for aerospace flight material selection approval. Accreditation should be based on ISO/IEC 17025 and the specific requirements described in this part of ISO 14624.

The accreditation programme should include proficiency testing and should be consistent with ISO/IEC Guide 43-1.

A.2 Accreditation

Accreditation is the responsibility of the accreditation body recognized within its jurisdiction to administer laboratory accreditation. An acceptable laboratory accreditation body would be a signatory to the multi-lateral mutual recognition arrangement (MRA) of the International Laboratory Accreditation Cooperation (ILAC)¹⁾ or a signatory to an ILAC-equivalent regional/national MRA that requires accreditation bodies to conform to ISO/IEC Guide 58.

A.3 Guidelines

An accredited laboratory should conform to the following guidelines:

- a) For required tests, the test facility should have performed the test method at least once during the last eighteen months and participated in comparisons of results with other accredited test facilities (round-robin testing).
- b) All instrumentation used in the test should be in proper calibration and bear the appropriate documentation to validate traceability to appropriate national or international measurement standards.
- c) The test facility should ensure that all testing is accomplished in accordance with approved test plans and procedures, and that the data records and test results are complete and accurate.
- d) Complete test records should be prepared by the test facility for each material tested and the test facility should maintain a permanent record of test data for a minimum of fifteen years for historical purposes.

1) Full information is available at the web site <http://www.ilac.org> of ILAC - International Laboratory Accreditation Cooperation or through the ILAC Secretariat, c/o NATA, 7 Leeds Street, Rhodes NSW 2138, Australia. Tel.: +61 2 9736 8374, Fax: +61 9736 8373, e-mail: ilac@nata.asn.au

Annex B (informative)

Preparation and qualification of chemical ignitors

B.1 Safety requirements

All personnel associated with the manufacturing of these ignitors should be familiar with the safety requirements associated with the materials and equipment used.

B.2 Materials

B.2.1 Hexamethylenetetramine (HMT), 98 % pure reagent grade, in powder form, properly packaged and stored to prevent contamination by moisture.

B.2.2 Anhydrous sodium metasilicate, 98 % pure reagent grade, in granule form, properly packaged and stored to prevent contamination by moisture.

B.2.3 Gum arabic (acacia), in powder form.

B.2.4 Deionized water, for mixing with the dry ingredients to form the ignitor dough.

B.2.5 Certified breathing air, used in the certification of the ignitors (see ISO 14951-13).

B.3 Equipment

B.3.1 Hammer mill, for grinding the dry components of the ignitor mixture.

B.3.2 Glove box with a temperature/humidity meter, used when grinding some of the dry ingredients.

B.3.3 Bags, for storing the ground dry ingredients.

B.3.4 40-mesh (40 μ m) screen, for sieving the ground dry ingredients.

B.3.5 Fume hood, used when grinding some of the dry ingredients, and for mixing the ignitor dough. The air flow rate in the fume hood should be at least 30 m/s.

B.3.6 Respirator with organic canisters, used when grinding the HMT.

B.3.7 250 ml burette, for holding the deionized water and gradually adding it to the mixture.

B.3.8 Heavy-duty electric mixer, for mixing the ignitor dough.

B.3.9 Spatula, for scraping the sides of the mixing bowl during preparation of the ignitor dough.

B.3.10 Plastic trays, non-stick, measuring approximately 76 mm \times 380 mm \times 1,5 mm, to catch the extruded ignitor dough and hold it while it dries.

B.3.11 Conveyor belt, to move the plastic trays at a constant rate so that the string of ignitor dough is not stretched or allowed to become too thick.

B.3.12 Extruder, for extruding the ignitor dough on to the plastic trays.

B.3.13 Cutting tools, for cutting the ignitor dough string to the proper lengths.

B.3.14 Drying racks, for holding the plastic trays containing the ignitor dough string.

B.3.15 Desiccator with desiccant, to ensure that the proper humidity is maintained during drying and storage of the ignitors.

B.3.16 Balance, for weighing the dried ignitors.

B.3.17 Corrugated plastic holder, used when cutting overweight dried ignitors to a length that ensures the correct mass.

B.3.18 Power supply, capable of providing 15 A (RMS), used in the certification of the ignitors.

B.3.19 Bare 20 AWG nickel-chromium wire, with a nominal resistivity of $2,3 \Omega \cdot m$, used in the certification of the ignitors.

B.3.20 Graduated ruler, for measuring the length of the ignitors and the ignitor flame height during certification.

B.3.21 Test chamber (or fume hood), used during certification of the ignitors.

B.3.22 Calibrated stopwatch, for determining the burn time during certification of the ignitors.

B.3.23 Soft-bristled brush, for cleaning the ignitor coil between certification of individual ignitors.

B.3.24 Plastic container (box), for storing the ignitors.

B.3.25 Corrugated foam wrap, for wrapping the stored ignitors.

B.4 Grinding the ignitor-mix ingredients

B.4.1 To ensure a homogeneous mixture, grind the raw materials using a hammer mill. Grinding is not necessary for the gum arabic.

B.4.2 Grind the sodium metasilicate in a glove box, as follows. Place the hammer mill, the material to be ground and any other necessary tools inside the glove box. Attach a bag to the output end of the hammer mill with tape to capture the ground material. In addition, place a 40-mesh screen inside the hammer mill. Seal the glove box and, before grinding the material, purge the glove box with dry air for approximately 4 h or until the humidity inside the glove box is below 10 %.

B.4.3 Grind the material. Detach the bag from the hammer mill, seal the bag, place it inside another bag and seal the second bag.

B.4.4 Clean the hammer mill between the grinding of different materials.

B.4.5 Grind the HMT in a fume hood. The air flow rate in the fume hood shall be at least 30 m/s, and a respirator with organic canisters shall be worn by the operator. Follow the same procedures as when grinding the sodium metasilicate described in B.4.2 to B.4.4.

B.4.6 After grinding, store each material separately, suitably identified.

B.5 Weighing and mixing the ignitor-mix ingredients

B.5.1 To make a 400 g mixture, the following amounts of each solid ingredient are necessary:

- (280,8 ± 0,2) g of HMT;
- (105,2 ± 0,2) g of anhydrous sodium metasilicate;
- (14,0 ± 0,2) g of gum arabic.