
**Fine ceramics (advanced ceramics,
advanced technical ceramics) — Test
method for hardness of monolithic
ceramics at room temperature**

*Céramiques techniques — Méthode d'essai de dureté des céramiques
monolithiques à température ambiante*

STANDARDSISO.COM : Click to view the full PDF of ISO 14705:2000



PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 14705:2000

© ISO 2000

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 734 10 79
E-mail copyright@iso.ch
Web www.iso.ch

Printed in Switzerland

Contents

Page

Foreword.....	iv
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Vickers hardness	2
4.1 Principle.....	2
4.2 Symbols and designations	2
4.3 Significance and use	5
4.4 Apparatus	5
4.5 Test pieces	5
4.6 Procedure	5
4.7 Test report	7
5 Knoop hardness.....	10
5.1 Principle.....	10
5.2 Symbols and designations	10
5.3 Significance and use	12
5.4 Apparatus	13
5.5 Test pieces	13
5.6 Procedure	13
5.7 Test report	14
Bibliography	18

STANDARDSISO.COM : Click to view the full PDF of ISO 14705:2000

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 3.

Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this International Standard may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

International Standard ISO 14705 was prepared by Technical Committee ISO/TC 206, *Fine ceramics*.

STANDARDSISO.COM : Click to view the full PDF of ISO 14705:2000

Fine ceramics (advanced ceramics, advanced technical ceramics) — Test method for hardness of monolithic ceramics at room temperature

1 Scope

This International Standard describes the method of test for determining the Vickers and Knoop hardness of monolithic fine ceramics at room temperature.

2 Normative references

The following normative documents contain provisions which, through reference in this text, constitute provisions of this International Standard. For dated references, subsequent amendments to, or revisions of, any of these publications do not apply. However, parties to agreements based on this International Standard are encouraged to investigate the possibility of applying the most recent editions of the normative documents indicated below. For undated references, the latest edition of the normative document referred to applies. Members of ISO and IEC maintain registers of currently valid International Standards.

ISO 4546:1993, *Metallic materials — Hardness test — Verification of Knoop hardness testing machines.*

ISO 6507-1:1997, *Metallic materials — Vickers hardness test — Part 1: Test method.*

ISO 6507-2:1997, *Metallic materials — Vickers hardness test — Part 2: Verification of testing machines.*

ISO 10250:1994, *Metallic materials — Hardness test — Tables of Knoop hardness values for use in tests made on flat surfaces.*

3 Terms and definitions

For the purposes of this International Standard, the following terms and definitions apply.

3.1

Vickers hardness

value obtained by dividing the applied force by the surface area of the indentation computed from the mean of the measured diagonals of the indentations assuming that the indentation is an imprint of the undeformed indenter

Vickers hardness may be expressed in two different units:

- with units of GPa, obtained by dividing the applied force in kN by the surface area of the indentation in mm²;
- Vickers hardness number, obtained by dividing the applied force in kgf by the surface area of the indentation in mm², without units specified.

NOTE Use of Vickers hardness with units of GPa is preferred.

3.2

Vickers indenter

indenter in the shape of right angle pyramid with a square base and an angle between opposite faces of 136°

See Table 1 and Figure 1.

3.3

Knoop hardness

value obtained by dividing the applied force by the projected area of the indentation computed from the measurement of the long diagonal of the indentation assuming that the indentation is an imprint of the undeformed indenter

The Knoop hardness may be expressed in two different units:

- a) with units of GPa, obtained by dividing the applied force in kN by the projected area of the indentation in mm²;
- b) Knoop hardness number, obtained by dividing the applied force in kgf by the projected area of the indentation in mm², without units specified.

NOTE Use of the Knoop hardness with units of GPa is preferred.

3.4

Knoop indenter

indenter in the shape of a rhombic-based pyramid with the two angles between the opposite edges at 172,5° and 130°

See Table 3 and Figure 6.

4 Vickers hardness

4.1 Principle

Forcing a diamond indenter in the form of a right angle pyramid with a square base and with a specified angle between opposite faces at the vertex into the surface of a test piece and measuring the length of the diagonals of the indentation left in the surface after removal of the test force, *F*. See Figures 1 and 2.

4.2 Symbols and designations

4.2.1 See Table 1 and Figures 1 and 2.

4.2.2 The Vickers hardness is denoted by the symbol HV preceded by the hardness value and followed by a number representing the test force (see Table 2).

EXAMPLES

- a) Use of the SI unit (GPa)

15,0 GPa HV 9,807 N represents a Vickers hardness of 15,0 GPa, determined with a test force of 9,807 N (1 kgf).

- b) Use of the Vickers hardness number (no units specified)

1500 HV 1 represents a Vickers hardness number of 1 500, determined with a test force of 9,807 N (1 kgf).

Table 1 — Symbols and designations for Vickers hardness testing

Symbol	Designation
α	Angle between the opposite faces at the vertex of the pyramidal indenter ($136^\circ \pm 0,5^\circ$)
F	Test force, in newtons
d	Arithmetic mean, in millimeters, of the two diagonals d_1 and d_2
HV	<p>Vickers hardness</p> $= \text{Constant} \times \frac{\text{Test force}}{\text{Surface area of indentation}}$ <p>(1) units of GPa (preferred)</p> $= 0,001 \frac{2F \sin \frac{136^\circ}{2}}{d^2} = 0,001 854 \frac{F}{d^2}$ <p>(2) hardness number (no units specified)</p> $= 0,102 \frac{2F \sin \frac{136^\circ}{2}}{d^2} = 0,189 1 \frac{F}{d^2}$
c	Arithmetic mean of the half of the two median crack lengths $2c_1$ and $2c_2$
S.D.	<p>Standard deviation</p> $= \sqrt{\frac{\sum (\overline{HV} - HV_n)^2}{n - 1}}$ <p>where</p> <p>\overline{HV} is the arithmetic mean of the Vickers hardness = $\frac{\sum HV_n}{n}$</p> <p>HV_n is HV obtained from n th indentation;</p> <p>n is the number of indentations.</p>
NOTE	Constant = $\frac{1}{g} = \frac{1}{9,807} = 0,102$ where g is acceleration due to gravity.

Table 2 — Hardness symbols and the nominal values of test forces, F , for Vickers hardness testing

Hardness symbol	Test force, F (nominal value)
HV 4,903 N or HV 0,5	4,903 N
HV 9,807 N or HV 1	9,807 N
HV 19,61 N or HV 2	19,61 N
HV 29,42 N or HV 3	29,42 N
HV 49,03 N or HV 5	49,03 N
HV 98,07 N or HV 10	98,07 N

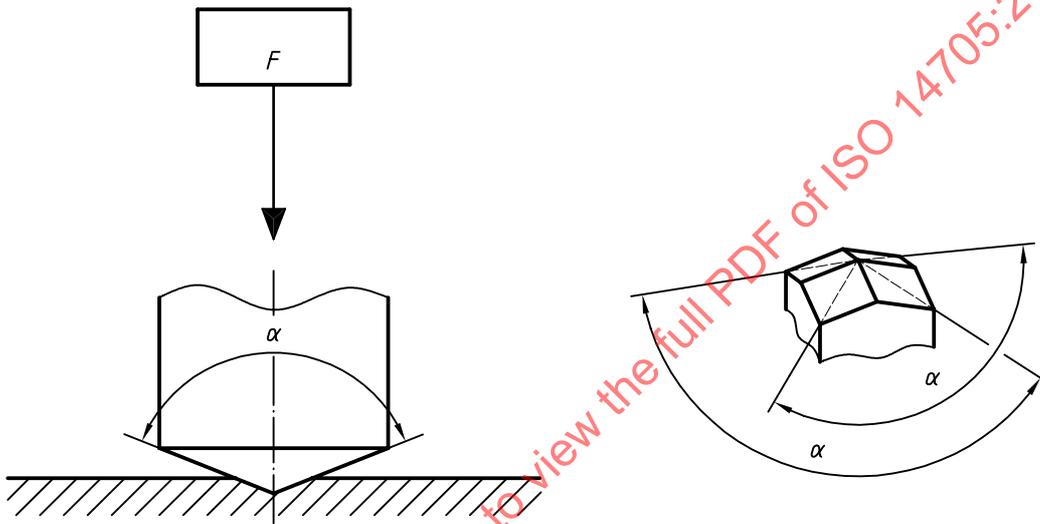


Figure 1 — Vickers indenter (diamond pyramid)

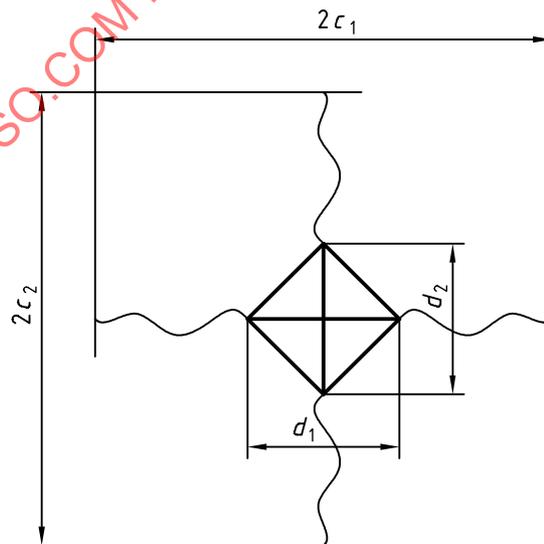


Figure 2 — Vickers indentation

4.3 Significance and use

Vickers indentation diagonal lengths are approximately 2,8 times shorter than the long diagonal of Knoop indentations, and the indentation depth is approximately 1,5 times deeper than Knoop indentations made at the same load. Vickers indentations are influenced less by specimen surface flatness, parallelism of the diamond axis to the test piece surface normal, and surface finish than Knoop indentations, but these parameters should be considered nonetheless. Vickers indentations are much more likely to cause cracks in fine ceramics than are Knoop indentations. Conversion between hardness scales shall not be made.

Vickers indentations on metallic materials are mainly formed by the plastic deformation. However, Vickers indentations on fine ceramics are formed by micro cracking and micro fracture, besides plastic deformation. This difference shall be noted for comparing the hardnesses of metals and ceramics.

4.4 Apparatus

4.4.1 Testing machine, capable of applying a predetermined test force in the range of 4,903 N (0,5 kgf) to 98,07 N (10 kgf), preferably 9,807 N (1 kgf), in accordance with ISO 6507-2. Verification of the test force shall be carried out in accordance with ISO 6507-2.

4.4.2 Diamond indenter, in the shape of a right angle pyramid with a square base, as specified in ISO 6507-2. Verification of the indenter shall be carried out in accordance with ISO 6507-2.

4.4.3 Measuring device, capable of measuring the indentation diagonals with a readout resolution of $\pm 0,2 \mu\text{m}$ or finer. A numerical aperture (NA) of between 0,65 and 0,95 for the objective lens for the microscope is recommended. Verification of the measuring device shall be carried out in accordance with ISO 6507-2.

NOTE Indirect verification may be carried out by means of standardized blocks calibrated in accordance with ISO 6507-3, following ISO 6507-2, or other approved and traceable ceramic standard reference blocks.

4.5 Test pieces

4.5.1 The test shall be carried out on a surface which is smooth, flat and free from foreign matter. The test piece shall be polished to permit accurate measurement of the diagonal lengths of the indentation. Preparation shall be carried out in such a way that any alteration of the surface hardness is minimized.

4.5.2 The thickness of the test piece shall be at least 0,5 mm. It shall be at least 1,5 times the diagonal of the indentation, d , and at least 2 times the crack length, c . No indentation damage shall be visible at the back of the test piece on completion of the test.

4.6 Procedure

4.6.1 In general the test shall be carried out at room temperature within the limits of 10 °C to 35 °C. Tests carried out under controlled conditions shall be made at a temperature of 23 °C \pm 5 °C.

4.6.2 The recommended test force is 9,807 N (1 kgf). In cases where significant chipping or lateral crack-spalling occurs or where the impression is too faint, the test forces within the range 4,903 N (0,5 kgf) to 98,07 N (10 kgf), listed in Table 2, may be used. Other instances where a heavier load may be required are where the grain structure is very coarse and the indentation area at lower loads may contact only a few grains of the material (e.g., a multiphase material).

4.6.3 The following items shall be confirmed before the test.

- a) Check the zero of the measuring system.
- b) Check the measuring system using a calibrated scale or certified indentation in a test block.
- c) Check the operation of the loading system by performing a test on a certified test block.
- d) Check the condition of the indenter by examination of the indentation made in the test block. Replace the indenter if necessary by taking into account the conditions given in 4.6.10.

4.6.4 The indenter shall be cleaned prior to and during the test series, as ceramic powders or fragments from the ceramic test piece can adhere to the diamond indenter.


4.6.5 The test piece shall be placed on a rigid support. The support surface shall be clean and free from foreign matter. It is important that the test piece lie firmly on the support so that displacement cannot occur during the test.

4.6.6 Carefully adjust the illumination and focusing conditions in order to obtain the optimum view and clarity of the indentation. Both indentation tips shall be in focus at the same time. Do not change the focus when measuring the distance from tip to tip.

4.6.7 Bring the indenter into contact with the test surface and apply the test force in a direction perpendicular to the surface, without shock or vibration, until the applied force attains the specified value. The approach velocity of the indenter shall not affect the hardness value. The time from the initial application of the force until the full test force is reached shall not be less than 2 s nor greater than 8 s. The duration of application of the constant maximum test force shall be 15 s.

4.6.8 Throughout the test, the apparatus shall be protected from shock or vibration.

4.6.9 The distance between the centre of any indentations and the edge of the test piece shall be at least 2,5 times the mean diagonal of the indentation, and at least 5 times the mean length of the crack, as shown in Figure 3. The distance between the centres of two adjacent indentations shall be at least 4 times the mean diagonal of the indentation, and at least 5 times the mean length of the crack, as shown in Figure 3. If two adjacent indentations differ in size and crack length, the spacing shall be based on the mean diagonal of the larger indentation and the longer crack length.

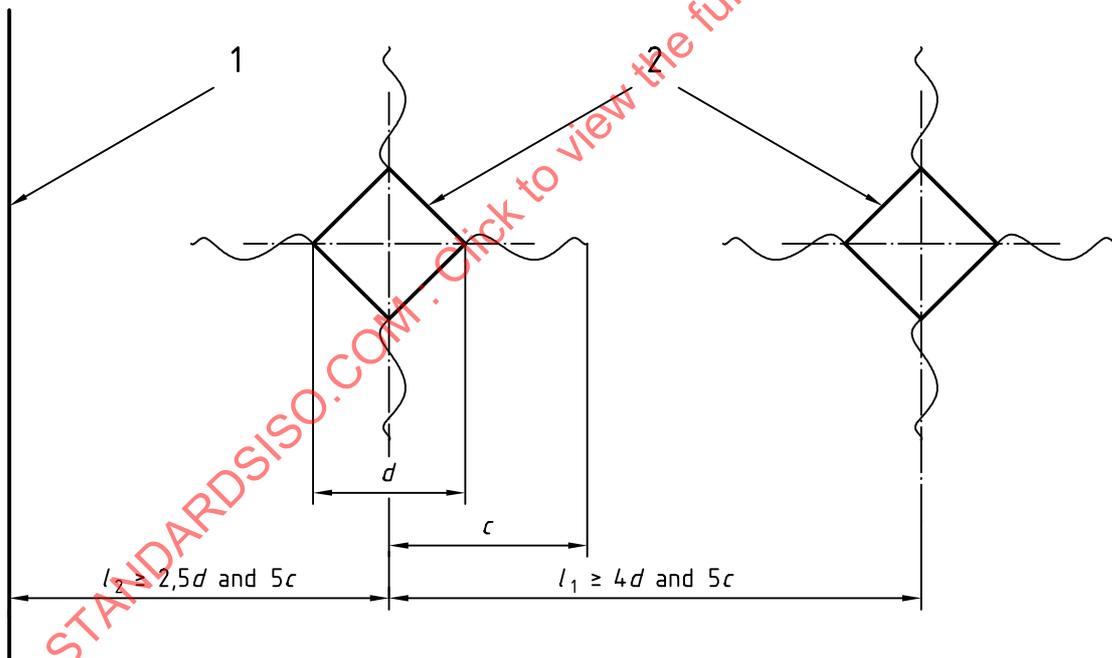

- c is the length from the centre of indentation to the end of crack
- d is the length of indent diagonal
- l_1 is the distance between centres of indentations
- l_2 is the distance from centre of indentation to the edge of sample

Key

- 1 Edge of test piece
- 2 Indentations

Figure 3 — Closest permitted spacing between indentations and from indentation to the test piece edge for Vickers indentations

4.6.10 The satisfactory condition of the indenter shall be verified frequently. Any irregularities in the shape of the indentation may indicate chipping, cracking or other deterioration of the indenter. If the examination of the indenter confirms this, then the test shall be rejected and the indenter replaced.

4.6.11 If there is excessive cracking from the indentation tips and sides, then the indentation shall be rejected and go unmeasured. If one of the tips of an indentation falls into a pore, the indentation shall be rejected. If the indentation lies in or on a large pore, the indentation shall be rejected. Figure 4 provides guidance in this assessment.

4.6.12 Measure the length of the two diagonals to within 0,2 μm for diagonals less than 50 μm , or to within 0,5 μm for diagonals equal to or more than 50 μm . The arithmetical mean of two readings shall be taken for the calculation of the Vickers hardness. If the difference of the two diagonals is more than 5 % of the mean value (Figure 4), the result shall be rejected, and a check made of the parallelism and flatness of the test piece, and of the alignment of the indenter. Follow the manufacturer's instructions very carefully as regards the proper usage of the measuring crosshairs. Figure 5 is provided for guidance.

4.6.13 At least 5 valid indentations shall be made for obtaining a mean result in accordance with this International Standard.


4.6.14 Calculate the Vickers hardness, HV, for each valid indentation, using the equation in Table 1. Calculate the mean hardness for all valid indentations, and the standard deviation.

4.6.15 Alternatively, see ISO 6507-1, for conversion tables for use in tests made on flat surfaces.


4.7 Test report

The test report shall include the following information:

- a) reference to this International Standard, i.e. ISO 14705;
- b) information on the test piece;
- c) test conditions, i.e.:
 - 1) thickness of test piece
 - 2) test force
 - 3) surface condition (polishing method)
 - 4) test temperature, or certification that the test was done at "room temperature"
 - 5) the number of valid indentations and the total number of indentations made to obtain these valid indentations
 - 6) magnification of microscope;
- d) the result obtained:
 - 1) arithmetic mean of the Vickers hardness
 - 2) standard deviation (S.D.) of the Vickers hardness;
- e) all operations not specified by this International Standard or regarded as optional;
- f) details of any circumstances (such as extensive cracking or chipping, porosity, multiphase nature of the material, coarse grain size, etc.) which may have affected the result.

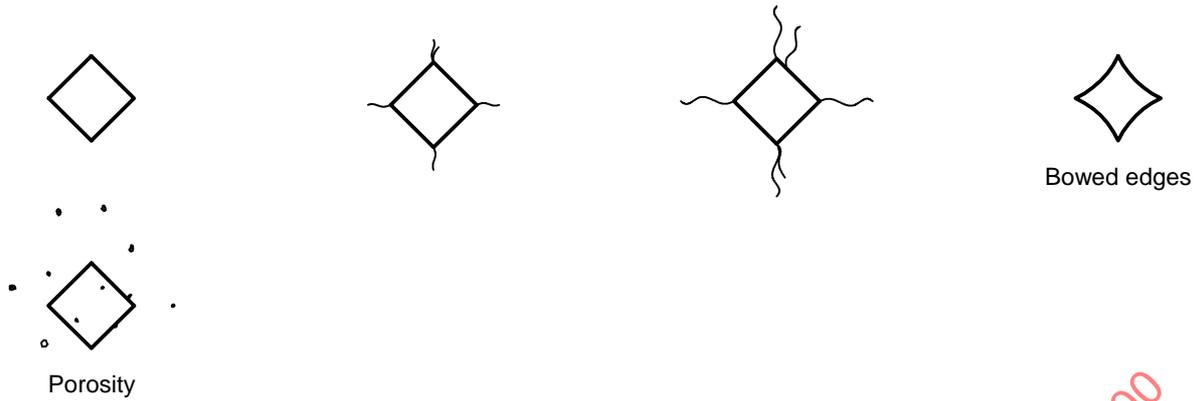

a) Acceptable indentations

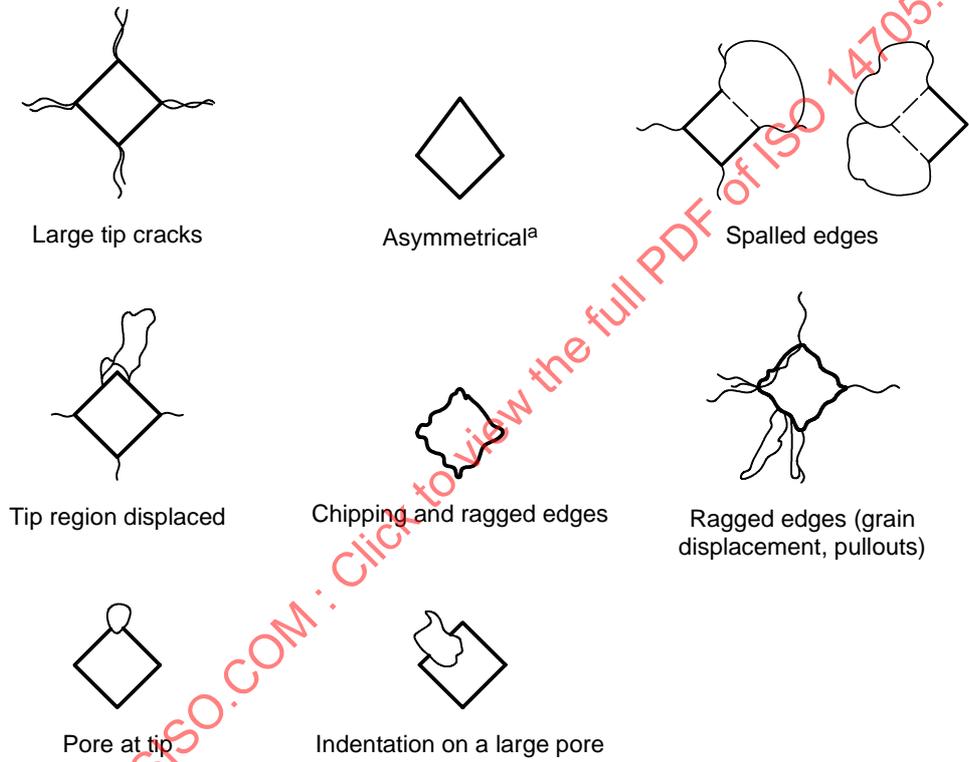


b) Unacceptable indentations


^a Permissible degree of asymmetry as defined in 4.6.12.

STANDARDSISO.COM :: Click to view the full PDF of ISO 14705:2000


Figure 4 — Guidelines for the acceptability of Vickers indentations

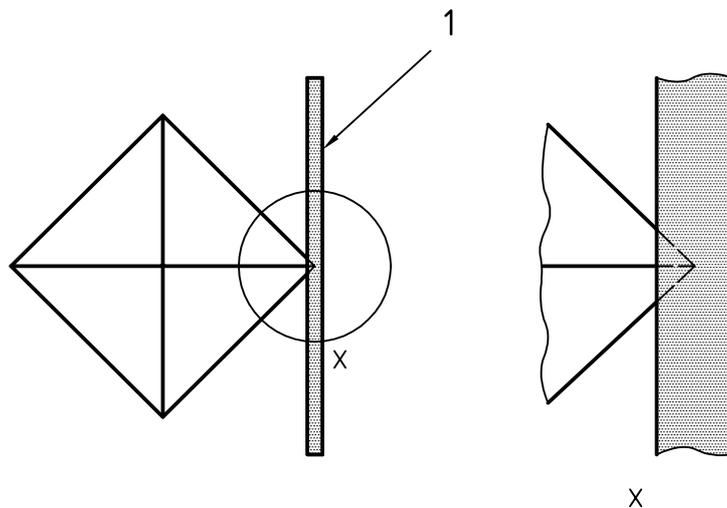

a) **Incorrect**, crosshair completely covers the tip.

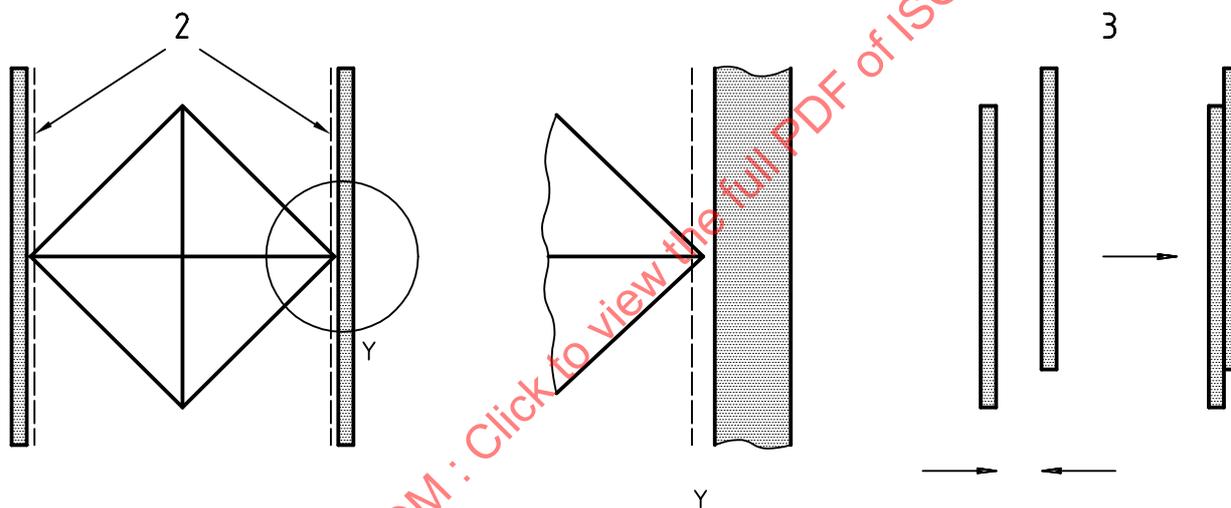

b) **Correct**, double crosshair measurement system, whereby the indentation is intended to be measured between two crosshairs or measuring lines. Indentation tips should be on the inside edge (in the fringe) of each crosshair. The measuring system is zeroed by bringing together the adjacent edges of the crosshairs as shown on the right.

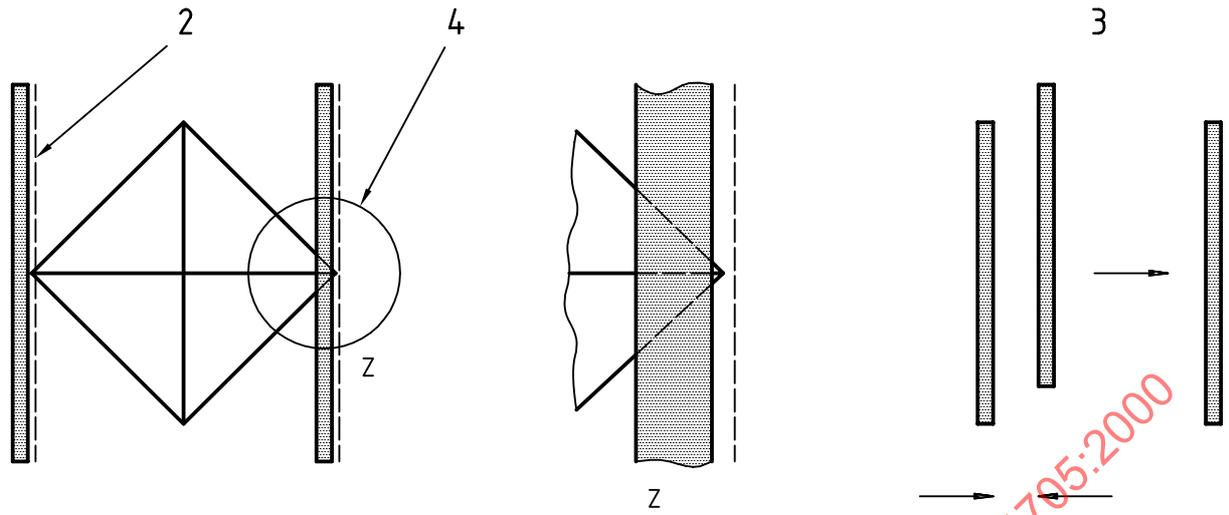

c) **Correct**, single crosshair and some double crosshair measurement systems. The indentation tip is on the same side of the crosshair line(s). For a single crosshair system, the measuring system is zeroed when the crosshair is correctly positioned on one indentation tip, or with both lines superimposed in a double crosshair system as shown on the right.

Key

- 1 Crosshair
- 2 Light fringe (size is exaggerated)
- 3 Setting to zero
- 4 Tip in the fringe

Figure 5 — Crosshair measurement systems for Vickers indentation

5 Knoop hardness

5.1 Principle

Forcing a diamond indenter, in the form of a rhombic-based pyramid with specified angles between opposite ridges at the vertex into the surface of a test piece and measuring the length of the long diagonal of the indentation left in the surface after removal of the test force, *F*. See Figure 6 and 7.

5.2 Symbols and designations

5.2.1 See Table 3 and Figures 6 and 7.

5.2.2 Knoop hardness is denoted by the symbol HK preceded by the hardness value and supplemented by a number representing the test force (see Table 4).

EXAMPLES:

a) Use of the SI unit (GPa)

15,0 GPa HK 9,807 N = Knoop hardness of 15,0 GPa, determined with a test force of 9,807 N (1 kgf).

b) Use of the Knoop hardness number (no units specified)

1 500 HK 1 = Knoop hardness number of 1 500, determined with a test force of 9,807 N (1 kgf).

Table 3 — Symbols and designations for Knoop hardness testing

Symbol	Designation
F	Test force, in newtons
d	Length, in millimeters, of the long diagonal
k	Indenter constant, relating projected area of the indentation to the square of the length of the long diagonal
HK	<p>Knoop hardness</p> $= \text{Constant} \times \frac{\text{Test force}}{\text{Projected area of indentation}}$ <p>(1) units of GPa (preferred)</p> $= 0,001 \frac{F}{d^2 \cdot k} = 0,001 \frac{F}{0,070\,28 \cdot d^2} = 0,014\,23 \frac{F}{d^2}$ <p>(2) hardness number (no units specified)</p> $= 0,102 \frac{F}{d^2 \cdot k} = 0,102 \frac{F}{0,070\,28 \cdot d^2} = 1,451 \frac{F}{d^2}$
S.D.	<p>Standard deviation</p> $= \sqrt{\frac{\sum (\overline{\text{HK}} - \text{HK}_n)^2}{n - 1}}$ <p>where</p> <p>$\overline{\text{HK}}$ is the arithmetic mean of the Knoop hardness = $\frac{\sum \text{HK}_n}{n}$</p> <p>$\text{HK}_n$ is HK obtained from nth indentation;</p> <p>n is the number of indentations.</p>
NOTE	<p>Constant = $\frac{1}{g} = \frac{1}{9,807} = 0,102$ where g is acceleration due to gravity.</p> <p>Indenter constant $k = \frac{\tan \frac{\beta}{2}}{2 \tan \frac{\alpha}{2}}$</p> <p>where α and β are the angles between the opposite edges (Figure 6).</p> <p>The values of α and β specified in ISO 4546, as $\alpha = 172,5^\circ \pm 0,1^\circ$ and $\beta = 130^\circ \pm 0,1^\circ$.</p>

Table 4 — Hardness symbols and nominal values of test force, F , for Knoop hardness testing

Hardness symbol	Test force, F (nominal value)
HK 4,903 N or HK 0,5	4,903 N
HK 9,807 N or HK 1	9,807 N
HK 19,61 N or HK 2	19,61 N
HK 49,03 N or HK 5	49,03 N

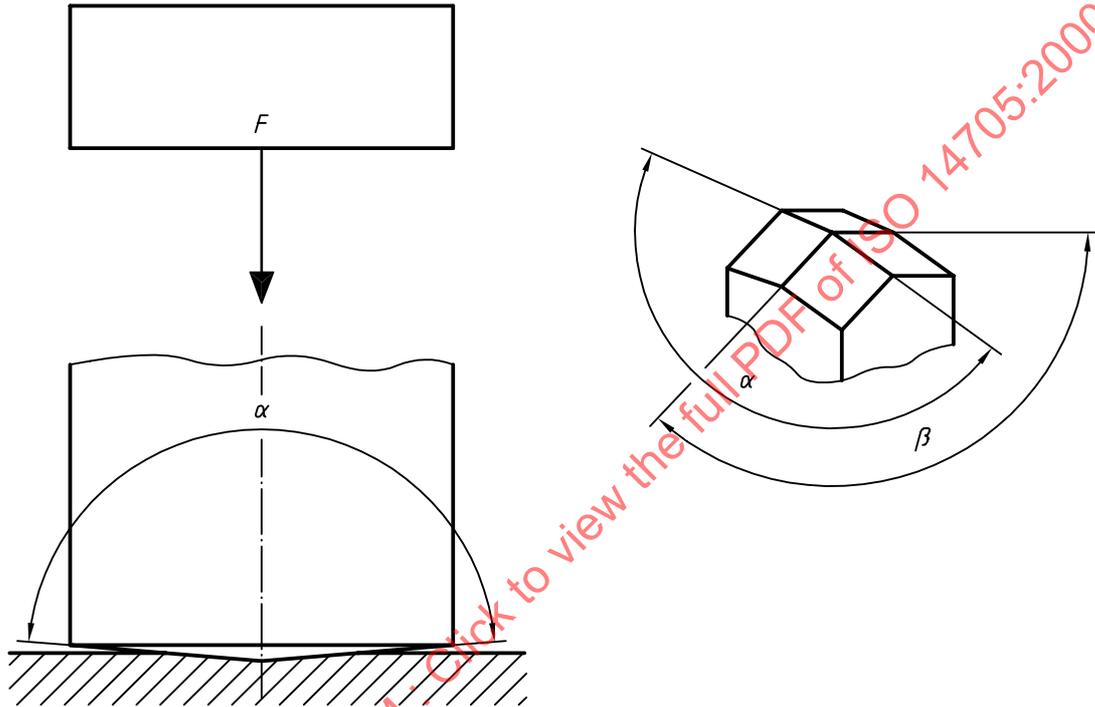


Figure 6 — Knoop indenter

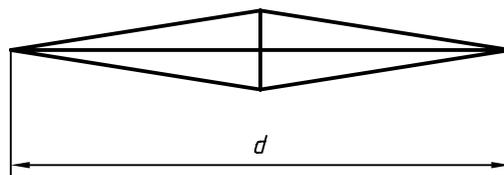


Figure 7 — Knoop indentation

5.3 Significance and use

For fine ceramics, the Knoop long diagonal length is approximately 2,8 times longer than the Vickers diagonal for the same load, and cracking is much less of a problem. On the other hand, the tip of Knoop indentation is more difficult to discern precisely. A Knoop indentation is shallower than a Vickers indentation made at the same load. Conversion between hardness scales shall not be made.

Knoop indentations on metallic materials are mainly formed by plastic deformation. However, Knoop indentations on fine ceramics are formed by micro cracking and micro fracture, besides plastic deformation. This difference shall be noted for comparing the hardnesses of metals and ceramics.

5.4 Apparatus

5.4.1 Testing machine, capable of applying a predetermined test force in the range of 4,903 N (0,5 kgf) to 49,03 N (5 kgf), preferably 9,807 N (1 kgf) or 19,61 N (2 kgf), in accordance with ISO 4546. Verification of the test force shall be carried out in accordance with ISO 4546.

5.4.2 Diamond indenter, in the shape of a rhombic-based pyramid, as specified in ISO 4546. Verification of the indenter shall be carried out in accordance with ISO 4546.

5.4.3 Measuring device, capable of measuring the indentation diagonal with a read-out resolution of 0,2 μm or finer. A numerical aperture (NA) of between 0,65 and 0,95 for the objective lens of the microscope is recommended. Verification of the measuring device shall be carried out in accordance with ISO 4546.

NOTE Indirect verification may be carried out by means of standardized blocks calibrated in accordance with ISO 4547, following ISO 4546, or other approved ceramic standard reference blocks.

5.5 Test pieces

5.5.1 The test shall be carried out on a surface which is smooth, flat and free from foreign matter. The test piece shall be polished to permit accurate measurement of the diagonal lengths of the indentation. Preparation shall be carried out in such a way that any alteration of the surface hardness is minimized.

5.5.2 The thickness of the test piece shall be at least 0,5 mm. No indenting damage shall be visible at the back of the test piece on completion of the test.

5.6 Procedure

5.6.1 In general the test shall be carried out at room temperature within the limits of 10 °C to 35 °C. Tests carried out under controlled conditions shall be made at a temperature of 23 °C \pm 5 °C.

5.6.2 The recommended test forces are 9,807 N (1 kgf) and 19,61 N (2 kgf). 19,61 N (2 kgf) will have greater precision; 9,807 N (1 kgf) may be used if the higher test force is not available on the apparatus, if cracking is a problem, or if preferred for a specific requirement. If cracking is a problem, or in the case of a specific requirement, the test forces within the range of 4,903 N (0,5 kgf) to 49,03 N (5 kgf), listed in Table 4, may be used.

5.6.3 The following items shall be confirmed before the test.

- a) Check the zero of the measuring system.
- b) Check the measuring system using a calibrated scale or certified indentation in a test block.
- c) Check the operation of the loading system by performing a test on a certified test block.
- d) Check the condition of the indenter by examination of the indentation made in the test block. Replace the indenter if necessary by taking into account the conditions given in 5.6.10.

5.6.4 The indenter shall be cleaned prior to and during the test series, as ceramic powders or fragments from the ceramic test piece can adhere to the diamond indenter.

5.6.5 The test piece shall be placed on a rigid support. The support surface shall be clean and free from foreign matter. It is important that the test piece lie firmly on the support so that displacement cannot occur during the test. The surface of the test piece being tested shall be in a plane normal to the axis of the indenter.

5.6.6 Carefully adjust the illumination and focusing conditions to obtain the optimum view and clarity of the indentation. Both indentation tips shall be in focus at the same time. Do not change the focus when measuring the distance from tip to tip.

5.6.7 Bring the indenter into contact with the test surface and apply the test force in a direction perpendicular to the surface, without shock or vibration, until the applied force attains the specified value. The approach velocity of the indenter shall not affect the hardness value. The time from the initial application of the force until the full test force is reached shall not be less than 2 s nor greater than 8 s. The duration of application of the test force shall be 15 s.

5.6.8 Throughout the test, the apparatus shall be protected from shock or vibration.

5.6.9 Allow a distance of at least 1,5 times the long diagonal length between the indentations as shown in Figure 8. If there is evidence of interaction between lateral cracking (from the sides of the indentation), then the spacing shall be increased. The minimum distance between the limit of any indentation and the edge of the test piece shall be at least 1,5 times the long diagonal of the indentation.

5.6.10 The satisfactory condition of the indenter shall be verified frequently. Any irregularities in the shape of the indentation may indicate chipping, cracking or other poor conditions of the indenter. If the examination of the indenter confirms this, then the test shall be rejected and the indenter replaced.

5.6.11 If there is excessive cracking from the indentation sides, the indentation shall be rejected and go unmeasured. If one of the tips of an indentation falls in a pore, the indentation shall be rejected. If the indentation lies in or on a large pore, the indentation shall be rejected. Figure 9 provides guidance in this assessment.

5.6.12 Measure the length of the long diagonal to within 0,2 μm for less than 50 μm , or to within 0,5 μm for equal to or more than 50 μm . The length is used for the calculation of the Knoop hardness number. If one leg (one half) of the long diagonal is more than 10 % longer than the other (Figure 9), or if the ends of the diagonals are not both in the field of focus, the surface of the test piece may not be normal to the axis of the indenter. Align the test piece surface properly and make another indentation. Follow the manufacturer's instructions very carefully as regards the proper usage of the measuring crosshairs. Figure 10 is provided for guidance.

5.6.13 At least 5 valid indentations shall be made for obtaining a mean result in accordance with this International Standard.

5.6.14 Calculate the Knoop hardness, HK, for each valid indentation, using the equation in Table 3. Calculate the mean hardness for all valid indentations, and the standard deviation.


5.6.15 See ISO 10250, for a table of values for use in tests made on flat surfaces.

5.7 Test report

The test report shall include the following information:

- a) reference to this International Standard, i.e. ISO 14705;
- b) information on the test piece;
- c) test conditions:
 - 1) thickness of test piece
 - 2) test force
 - 3) surface condition (polishing method)
 - 4) test temperature, or certification that the test was done at "room temperature"
- 5) the number of valid indentations and the total number of indentations made to obtain these valid indentations
- 6) magnification of microscope;

- d) the result obtained;
- 1) arithmetic mean of the Knoop hardness
 - 2) standard deviation (S.D.) of the Knoop hardness;
- e) all operations not specified by this International Standard or regarded as optional;
- f) details of any circumstances (such as extensive cracking or chipping, porosity, multi-phase nature of the material, coarse grain size etc.) which may have affected the result.

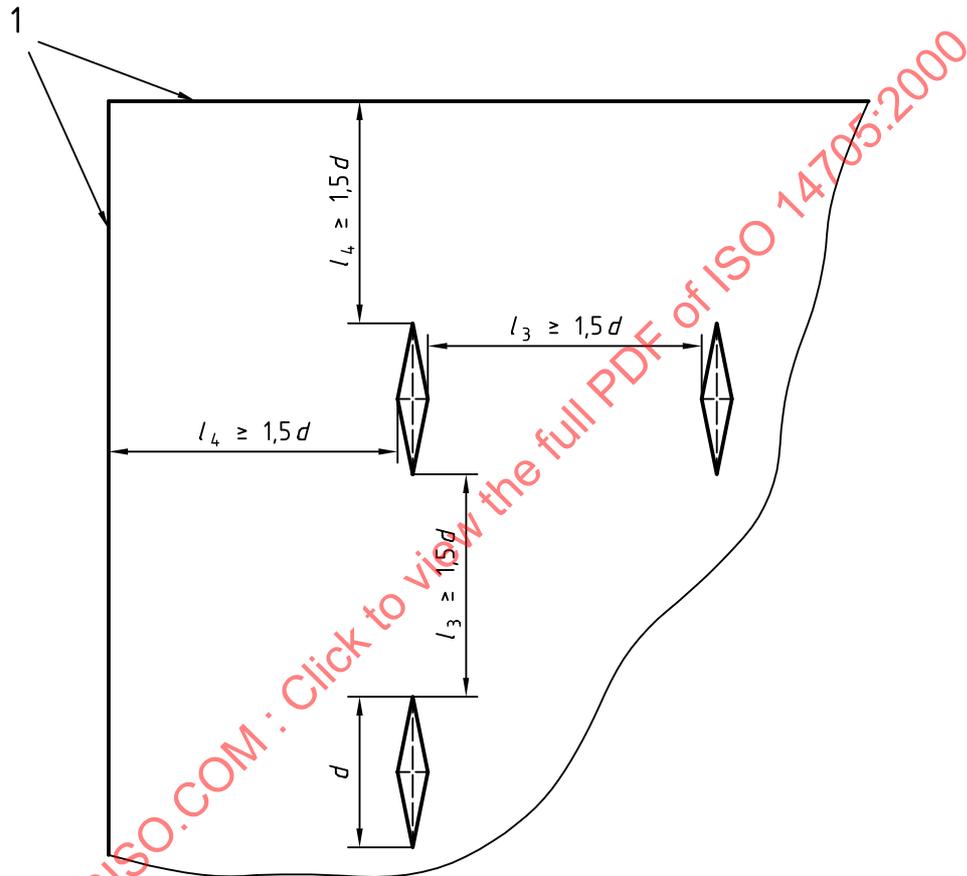

d is the length of the long diagonal of indentation

l_3 is the distance between nearest corners of indentations

l_4 is the distance from corner of indentation to the edge of test piece

Key

1 Edge of test piece

Figure 8 — Closest permitted spacing between indentations and from indentation to the edge of test piece for Knoop indentations